

## Wheel bearing kits, seals and tools for commercial vehicles



SKF is an international industrial Group operating in some 130 countries and is world leader in bearings.

The company was founded in 1907 following the invention of the self-aligning ball bearing by Sven Wingquist and, after only a few years, SKF began to expand all over the world.

Today, SKF has some 43 000 employees and more than 80 manufacturing facilities spread throughout the world. An international sales network includes a large number of sales companies and over 20 000 distributors and retailers. Worldwide availability of SKF products is supported by a comprehensive technical advisory service.

The key to success has been a consistent emphasis on maintaining the highest quality of its products and services. Continuous investment in research and development has also played a vital role, resulting in many examples of epoch-making innovations.

The business of the Group consists of bearings, seals, special steel and a comprehensive range of other high-tech industrial components. The experience gained in these various fields provides SKF with the essential knowledge and expertise required in order to provide the customers with the most advanced engineering products and efficient service.

© Copyright SKF 2003

The contents of this catalogue are the copyright of the publisher and may not be reproduced (even extracts) unless permission is granted. Every care has been taken to ensure the accuracy of the information in this catalogue but no liability can be accepted for any errors or omissions.

Catalogue **PUB 80/P1 5362 EN 03**

Reg. 471 01:831 • 10000 • 2003-05




Nya Almqvist & Wiksell Tryckeri, Uppsala, Sweden

# Symbols

## Universal symbols

	Model year		Manufacturers - conversion
	Vehicle manufacturers		Bus
	Front/rear axle		Trailer
	Axle type		Complete kit
	Inner/outer bearing		Bearing kit
	Inner/outer seal		Seal kit
	Remarks		Bearing
			Tool










# Abbreviations

... / ...	Continuing
Ch.-xxxxxx	All chassis up to and incl. No. xxxxxx
Ch.xxxxxx-	All chassis from No. xxxxxx onwards
-05/83	All models up to and incl. May 1983
06/83-	All models from June 1983 onwards
04/81-08/86	All models from April 1981 to and incl. August 1986
—	No kit available
	German models
	British manufactured models
	Tools see page 8
1)	Remarks, see page 291




## Contents of the kits

To determine the contents of the chosen kit, just follow the column until you find the right designation and then read the number of each of the symbolised components.


Kit	Contents						Manufacturer	Position
								
VKBA 1312	1		1	1	1		FIAT IVECO	•
VKBA 1385	2	1		1	1		FIAT IVECO	•
VKBA 1386	2	1		1	1		FIAT IVECO	•
VKBA 1387	2	1		1	1		FIAT IVECO	•
VKBA 1391	2	1		1			FIAT IVECO	•
VKBA 1392	2	1		1	1		FIAT IVECO	•
VKBA 1393	2			1			FIAT IVECO	•
VKBA 1394	2			1			FIAT IVECO	•
VKBA 1444	2	1		2			FIAT IVECO	•
VKBA 1445	2	1		1			CITROEN, FIAT IVECO, PEUGEOT	•
VKBA 1446	2	1		1			CITROEN, FIAT IVECO, PEUGEOT	•
VKBA 1462	2	1		1			CITROEN, FIAT IVECO, PEUGEOT	•
VKBA 1463	2	1		1			CITROEN, FIAT IVECO, PEUGEOT	•
VKBA 1465	2			1		1	FORD	•
VKBA 1466	1			1	1		FORD	•
VKBA 1467	1			1			FORD	•
VKBA 1470	1	1	7	1		1	MERCEDES-BENZ	•
VKBA 1477	1			1	1	2	VOLKSWAGEN	•
VKBA 1496	1			1	1	2	VOLKSWAGEN	•
VKBA 1497	1			1	1	1	VOLKSWAGEN	•
VKBA 3406	1	2		1			VOLKSWAGEN	•
VKBA 3407	2						VOLKSWAGEN	•
VKBA 3408	2						VOLKSWAGEN	•

How to use this catalogue.

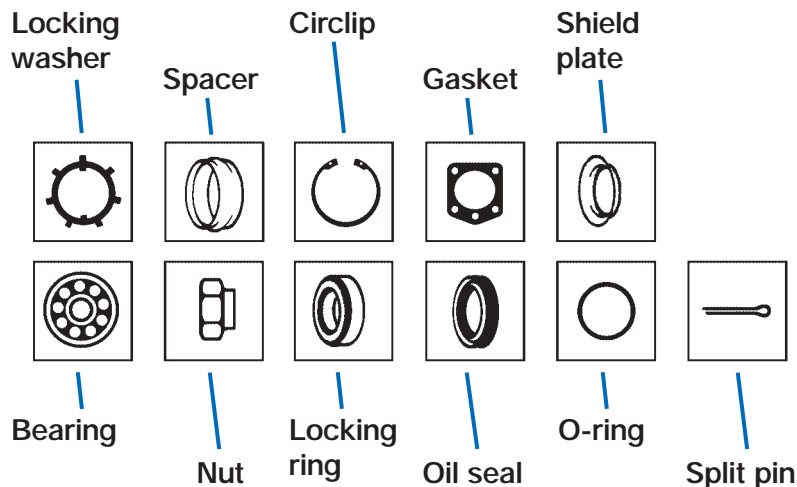



## *Index*

Symbols & abbreviations . . . . .	Flap
How to use the catalogue . . . . .	Flap
SKF Tools . . . . .	8
New kits and replacements . . . . .	9
Index of manufacturers . . . . .	11
Vehicle applications . . . . .	13
Conversion . . . . .	263
Remarks . . . . .	291

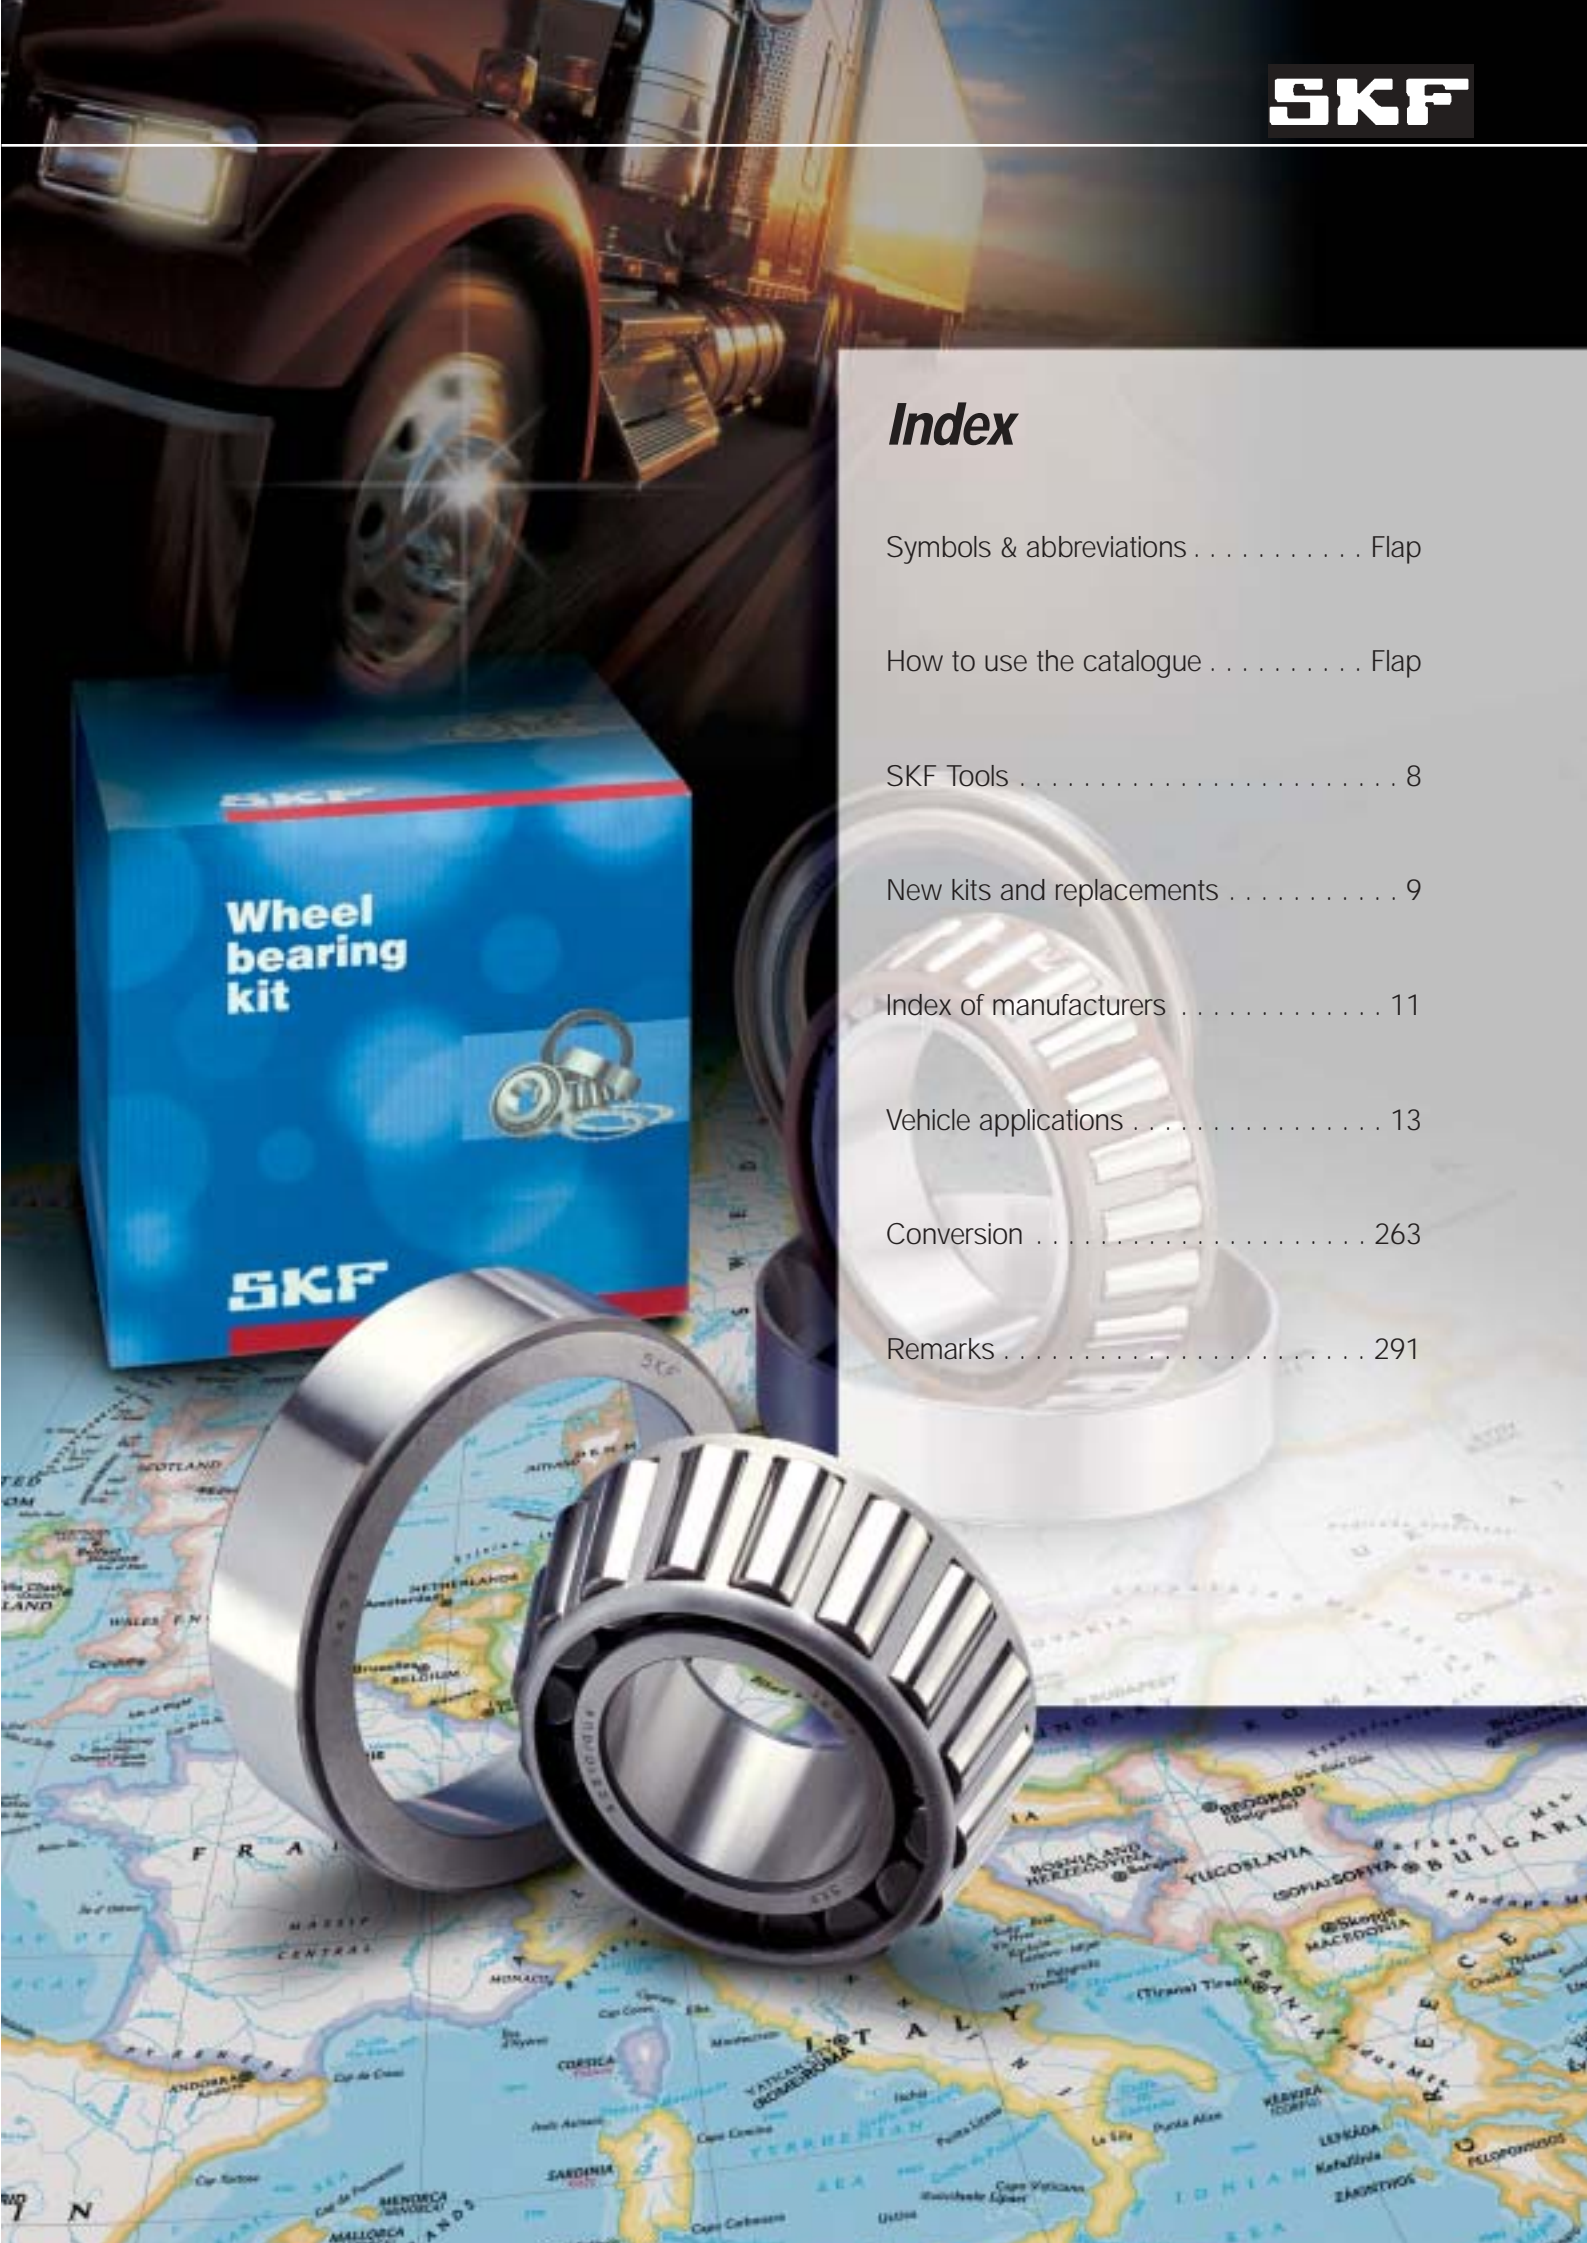

*When trucks aren't  
making your fleets money,  
they're costing them money.*

TFO<sup>®</sup>

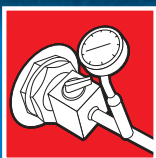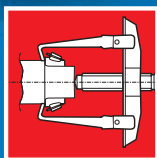


## *The SKF Trouble-Free Operation (TFO) Program — a direct route to reducing a fleet's cost-per-kilometer.*

Premature replacement of wheel-end bearings costs the European truck industry millions of Euro each year. These unnecessary maintenance costs negatively affect the profitability of fleets by causing:

- Downtime of vehicles
- Wasted labor resources
- Lost mileage revenue
- Even lost customers

That's why fleets all over Europe are looking into SKF's Wheel-End Trouble-Free Operation® program, or TFO,® a proven systems approach to wheel-end maintenance. By addressing all the critical wheel-end issues, from the proper mounting/dismounting of seals and bearings to lubrication and heat damage, we're helping fleets increase vehicle uptime and lower their cost-per-kilometer.

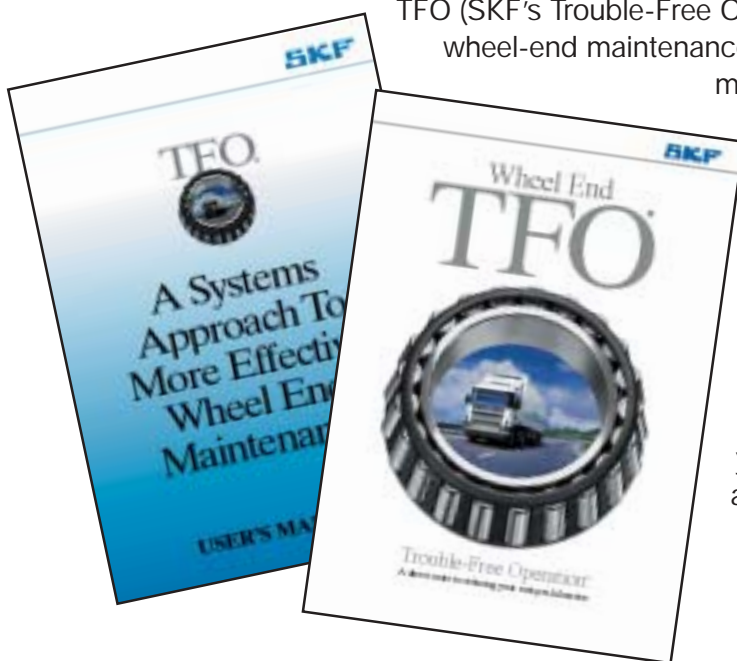

TFO (SKF's Trouble-Free Operation®) is a proven systems approach for wheel-end maintenance that is effective for both corrective maintenance (after a bearing or seal failure) and for preventive maintenance as part of a scheduled brake inspection or other regularly scheduled maintenance.

Don't overlook this unique opportunity to add value to your commercial fleet customer relationships. Encourage them to discover how much they could save with the SKF TFO program. Please contact your SKF representative for more information about TFO.


### *Step-by-step TFO Procedures include the following:*



Technicians attend TFO training



Lubrication guidelines for grease and oil wheel end systems

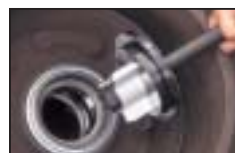


Removal and installation procedures and tooling guidelines



Wheel mounting and accurate end-play adjustment



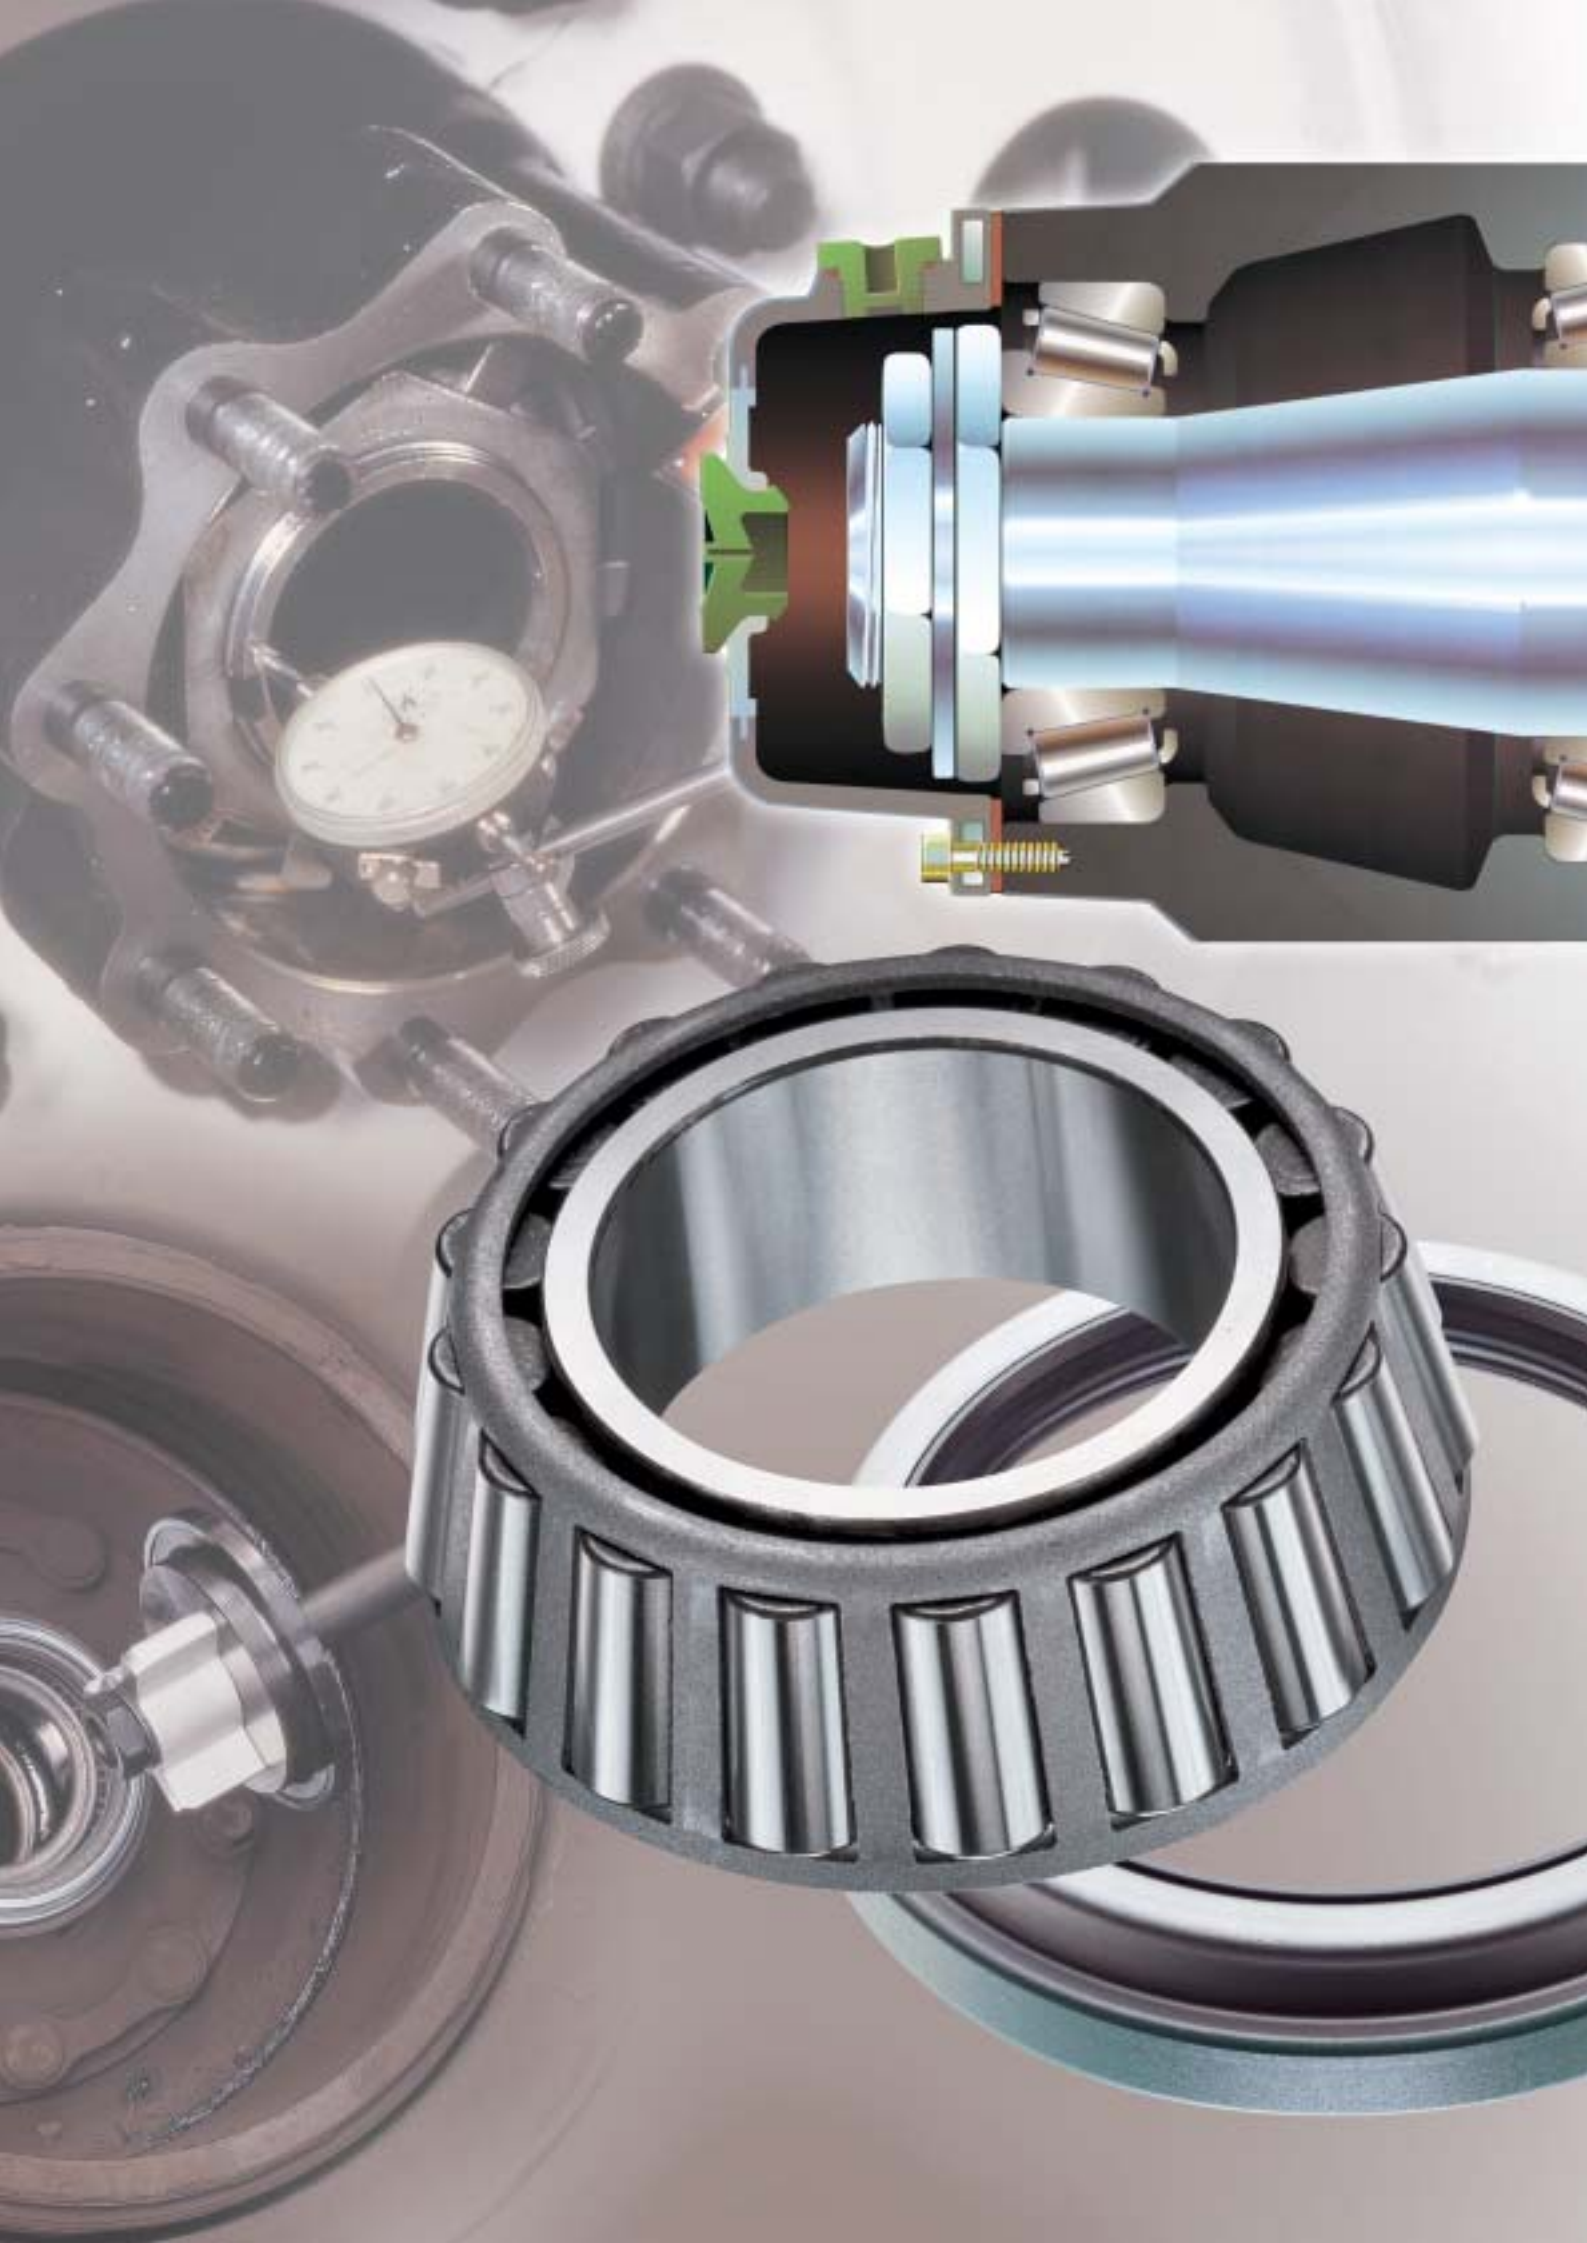

*Typical examples of bearing and seal failure.*



Etching, considerable corrosion.



Bearing adjustment too loose



Baked from loss of lubrication



Wrong geometry



Lack of lubrication



Damaged by spindle

**Wheel end TFO focuses on these critical factors – and your fleet customer's bottom line.**

### Premature wheel bearing failures

- Up to **80%** of bearing failures are caused by running conditions which are primarily heat and lubrication related.
- Approximately **20%** of bearing failures are due to improper or careless installation.

### Premature wheel seal failures

- Up to **80%** of seal failures are due to improper or careless installation.
- Approximately **20%** of seal failures are caused by running conditions – primarily heat and contaminants.

**TFO addresses both of these "80/20" factors with better evaluation of bearing and seal failures.**

TFO includes training materials for "Failure Analysis", to identify the problem so that steps can be taken to prevent the problem from repeating itself. TFO provides a simple but effective means of implementing Failure Analysis.

- Photos for comparison of visual inspection of damaged bearings and seals
- Guidelines on the likely cause of failure
- What to do to prevent similar failures in the replacement process.

### The SKF TQ Line Wheel Bearings



# SKF Tools *The shortcut to increased fleet uptime.*

## Mechanical Tools

TMMA puller series:  
EasyPull

*Safe and simple  
dismounting  
of bearings*



Bearing fitting  
tools TMFT series

*Reduced bearing damage  
through effective mounting*



Reversible jaw puller  
TMMR F series

*Combined internal and  
external puller*

VKN-500 series slide hammer  
bearing installer/removal tool kit

*Dismount and mount bearing cups  
without hub damage.*

SRT-1 seal  
removal tool


*The fast, easy way to  
remove wheel seals  
without damaging  
bearings or hubs.*



## Heaters

SCORPIO induction  
heater TMBH 1

*A portable bearing  
heater weighing  
only 4,5 kg (10 lb)*

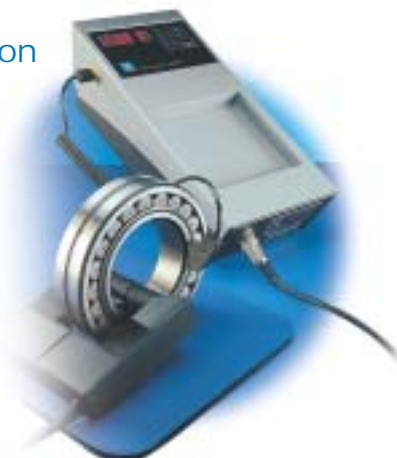

Electric  
hot plate  
729659 C

*Thermostat  
controlled  
bearing heating*



## Preventive Maintenance Products

SKF anti-fretting agent LGAF 3E



## Instruments

Non-contact laser-sighted thermometer



## Gloves

Special working gloves  
TMBA G11W

Heat resistant gloves  
TMBA G11

Disposable grease resistant gloves  
TMBA G11D

Reusable grease resistant gloves  
TMBA G11R



## Lubricators and Lubricants

SYSTEM 24 single-point automatic lubricator LAGD 125 and LAGD 60  
*Automatic lubrication, where you want it, 24 hours a day, 7 days a week*




Grease filler pumps  
LAGF series  
*High quantity grease packer*



Grease pumps  
LAGG series  
*Meeting all your grease lubricator needs*



VKG 1 grease

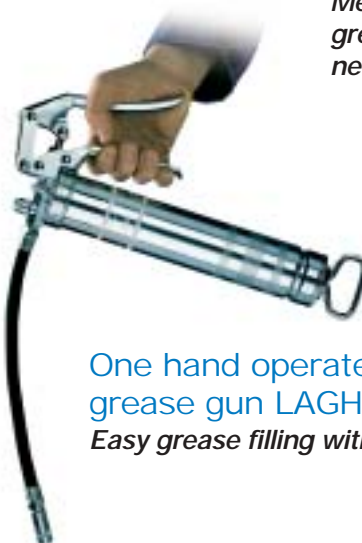


One hand operated grease gun LAGH 400  
*Easy grease filling with one hand*

Grease packer  
VKN-550



# SKF VKN 500 Series

## Slide hammer bearing installer/removal tool kit

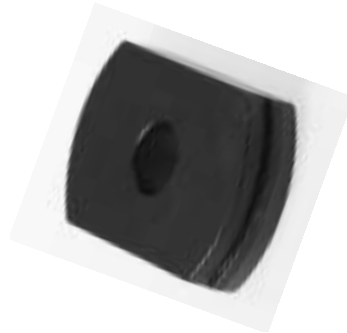

Kit designation	Fits bearing*	Manufacturer*
VKN 502	32310	Arvin Meritor(ROR), BPW
VKN 504	33116	Arvin Meritor(ROR), BPW
VKN 505	33118	BPW
VKN 506	33213	Arvin Meritor(ROR), BPW, SAF
VKN 507	33215	BPW
VKN 510	HM 218248/210	Arvin Meritor(ROR), Fruehauf, SAF, SMB, Trailor
VKN 511	HM 518445/410	Fruehauf
VKN 512	JM 718149/110	Trailor
VKN 513	JM 515649/610	Trailor
VKN 514	32924	SAF
VKN 515	32310	BPW
VKN 516	33213	BPW

\*) For correct information consult pages 256–261

## Slide Hammer



VKN 500

## NEW KITS

VKBA 5314	Scania
VKBA 5550	BPW
VKBA 5551	BPW
VKBA 5552	Mercedes-Benz, Gigant (SAE)
VKBA 5553	Arvin Meritor (ROR)

## NEW BEARINGS

VKHB 2331	Fiat-Iveco
VKHB 2332	DAF
VKHB 2333	DAF
VKHB 2697	Fiat-Iveco, Scania, Volvo
VKHB 2698	Arvin Meritor (ROR)
VKHB 2699	Arvin Meritor (ROR)

## NEW SEALS

VKS 6354	BPW
VKS 6357	DAF
VKS 6358	DAF
VKS 6360	Fiat-Iveco
VKS 6361	Fiat-Iveco
VKS 6362	Fiat-Iveco
VKS 6363	Fiat-Iveco
VKS 6364	Fruehauf, SMB, Tractor
VKS 6365	Fruehauf, SMB, Tractor
VKS 6366	Fruehauf, SMB, Tractor

## NEW TOOLS

VKN 500	
VKN 502	Arvin Meritor (ROR), BPW
VKN 504	Arvin Meritor (ROR), BPW
VKN 505	BPW
VKN 506	Arvin Meritor (ROR), BPW, SAF
VKN 507	BPW
VKN 510	Arvin Meritor (ROR), Fruehauf, SAF, SMB, Tractor
VKN 511	Frauhaf
VKN 512	Tractor
VKN 513	Tractor
VKN 514	SAF
VKN 515	BPW
VKN 516	BPW

## REPLACEMENTS

VKBA 5352	replaced by	VKBA 5344
-----------	-------------	-----------

## DELETED KITS

VKBA 5005	DAF
VKBA 5007	DAF
VKBA 5009	DAF
VKBA 5012	DAF
VKBA 5013	DAF
VKBA 5017	DAF
VKBA 5019	DAF
VKBA 5027	Mercedes-Benz
VKBA 5030	Mercedes-Benz
VKBA 5035	Mercedes-Benz
VKBA 5036	Mercedes-Benz
VKBA 5044	Mercedes-Benz
VKBA 5050	Mercedes-Benz
VKBA 5051	Mercedes-Benz
VKBA 5053	Mercedes-Benz
VKBA 5054	Mercedes-Benz
VKBA 5055	Mercedes-Benz
VKBA 5060	Mercedes-Benz
VKBA 5062	Scania
VKBA 5065	Scania
VKBA 5066	Scania
VKBA 5071	Scania
VKBA 5072	Scania
VKBA 5073	Scania
VKBA 5076	Scania
VKBA 5079	Scania
VKBA 5081	Scania
VKBA 5082	Scania
VKBA 5096	Volvo
VKBA 5097	Volvo
VKBA 5102	Volvo
VKBA 5103	Volvo
VKBA 5104	Volvo
VKBA 5106	Volvo
VKBA 5107	Volvo
VKBA 5108	Volvo
VKBA 5109	Volvo
VKBA 5110	Volvo
VKBA 5111	Volvo
VKBA 5112	Volvo
VKBA 5113	Volvo
VKBA 5114	Volvo
VKBA 5115	Volvo
VKBA 5116	Volvo
VKBA 5117	Volvo
VKBA 5118	Volvo
VKBA 5119	Volvo
VKBA 5120	Volvo
VKBA 5121	Volvo
VKBA 5122	Volvo
VKBA 5126	Volvo
VKBA 5128	Volvo
VKBA 5129	Volvo
VKBA 5130	Volvo
VKBA 5131	Volvo
VKBA 5132	Volvo
VKBA 5137	Volvo
VKBA 5138	Volvo
VKBA 5139	Volvo
VKBA 5161	MAN

VKBA 5167	MAN, Mercedes-Benz
VKBA 5168	Fiat-Iveco
VKBA 5169	Fiat-Iveco
VKBA 5172	Fiat-Iveco
VKBA 5173	Fiat-Iveco
VKBA 5175	Fiat-Iveco
VKBA 5176	Fiat-Iveco
VKBA 5177	Fiat-Iveco
VKBA 5178	Fiat-Iveco
VKBA 5181	Fiat-Iveco
VKBA 5182	Fiat-Iveco, Renault-RVI
VKBA 5183	Fiat-Iveco
VKBA 5183	Fiat-Iveco
VKBA 5184	Fiat-Iveco
VKBA 5186	Fiat-Iveco
VKBA 5187	Fiat-Iveco
VKBA 5191	Fiat-Iveco
VKBA 5193	Fiat-Iveco
VKBA 5194	Fiat-Iveco
VKBA 5195	Renault-RVI
VKBA 5196	Renault-RVI
VKBA 5197	Renault-RVI
VKBA 5198	Renault-RVI
VKBA 5199	Renault-RVI
VKBA 5202	Renault-RVI
VKBA 5203	Renault-RVI
VKBA 5204	Renault-RVI
VKBA 5210	Renault-RVI
VKBA 5211	Renault-RVI
VKBA 5213	Renault-RVI
VKBA 5215	Renault-RVI
VKBA 5219	Renault-RVI
VKBA 5222	Renault-RVI
VKBA 5223	Renault-RVI
VKBA 5235	Scania
VKBA 5266	Volvo
VKBA 5268	Volvo
VKBA 5271	Volvo
VKBA 5289	Volvo
VKBA 5321	Fiat-Iveco
VKBA 5325	Fiat-Iveco
VKHB 2022	Volvo
VKHB 2049	Volvo
VKHB 2062	Mercedes-Benz
VKHB 2069	Mercedes-Benz
VKHB 2130	DAF
VKHB 2135	DAF
VKHB 2136	DAF
VKHB 2180	Renault-RVI
VKHB 2183	Renault-RVI
VKHB 2223	Volvo



## **INDEX OF MANUFACTURERS**

### ***Truck manufacturers***

CITROËN . . . . .	13
DAF . . . . .	17
FIAT-IVECO . . . . .	25
FORD . . . . .	57
MAN . . . . .	61
MERCEDES-BENZ (corresponding to models and axle type) . . . . .	69
MERCEDES-BENZ (corresponding to axle designation "Baumuster") . . . . .	116
PEUGEOT . . . . .	141
RENAULT-RVI . . . . .	145
SCANIA . . . . .	187
VOLKSWAGEN . . . . .	205
VOLVO . . . . .	209

### ***Bus manufacturers***

FIAT-IVECO . . . . .	228
KÄSSBOHRER/SETRA . . . . .	230
MAN . . . . .	231
MERCEDES-BENZ (corresponding to models and axle type) . . . . .	233
MERCEDES-BENZ (corresponding to axle designation "Baumuster") . . . . .	238
RENAULT-RVI . . . . .	242
SCANIA . . . . .	245
VOLVO . . . . .	250

### ***Trailer/semi-trailer axle manufacturers***

ARVIN MERITOR (ROR) . . . . .	256
BPW . . . . .	256
FRUEHAUF . . . . .	257
KÄSSBOHRER . . . . .	259
MERCEDES-BENZ DISCOS . . . . .	260
MONTENEGRO . . . . .	260
SAF . . . . .	260
SMB . . . . .	261
TRAILOR . . . . .	262







## CITROËN

C - Ser. ....	14
Jumper .....	15



C 25 - 1000

- 
- 
- 
- 
- 
- 
- 
- 
- 
- 

VKBA 844  
  
VKBA 1444  
  
VKBA 845  
  
VKBA 846  
  
VKBA 1445  
  
VKBA 1446

- 
- 
- 
- 
- 
- 
- 
- 
- 
- 

VKHB 2275  
VKHB 2275  
  
VKHB 2275  
VKHB 2275  
  
VKHB 2266  
VKHB 2267  
  
VKHB 2266  
VKHB 2267  
  
VKHB 2266  
VKHB 2267  
  
VKHB 2266  
VKHB 2267

32010 X/OCL7CVB026  
32010 X/OCL7CVB026  
  
32010 X/OCL7CVB026  
32010 X/OCL7CVB026  
  
XAA 32008 X  
32006 X/Q  
  
XAA 32008 X  
32006 X/Q  
  
XAA 32008 X  
32006 X/Q  
  
XAA 32008 X  
32006 X/Q

-  
-  
  
-  
-  
  
-  
-  
  
-  
-  
  
-  
-

4)  
  
5)  
  
6)  
  
7)  
  
8)  
  
9)

C 25 - 1300

- 
- 
- 
- 
- 
- 
- 
- 

VKBA 844  
  
VKBA 845  
  
VKBA 846  
  
VKBA 1445  
  
VKBA 1446

- 
- 
- 
- 
- 
- 
- 
- 

VKHB 2275  
VKHB 2275  
  
VKHB 2266  
VKHB 2267  
  
VKHB 2266  
VKHB 2267  
  
VKHB 2266  
VKHB 2267  
  
VKHB 2266  
VKHB 2267

32010 X/OCL7CVB026  
32010 X/OCL7CVB026  
  
XAA 32008 X  
32006 X/Q  
  
XAA 32008 X  
32006 X/Q  
  
XAA 32008 X  
32006 X/Q  
  
XAA 32008 X  
32006 X/Q

-  
-  
  
-  
-  
  
-  
-  
  
-  
-

10)  
  
11)  
  
12)  
  
13)  
  
14)

C 25 - 1400

- 
- 
- 
- 
- 
- 
- 
- 

VKBA 844  
  
VKBA 1444  
  
VKBA 1445  
  
VKBA 1446

- 
- 
- 
- 
- 
- 
- 
- 

VKHB 2275  
VKHB 2275  
  
VKHB 2275  
VKHB 2275  
  
VKHB 2266  
VKHB 2267  
  
VKHB 2266  
VKHB 2267

32010 X/OCL7CVB026  
32010 X/OCL7CVB026  
  
32010 X/OCL7CVB026  
32010 X/OCL7CVB026  
  
XAA 32008 X  
32006 X/Q  
  
XAA 32008 X  
32006 X/Q

-  
-  
  
-  
-  
  
-  
-  
  
-  
-

15)  
  
16)  
  
17)  
  
18)

C 25 - 1800

- 
- 
- 
- 
- 
- 
- 
- 

VKBA 1444  
  
VKBA 844  
  
VKBA 1462  
  
VKBA 1463

- 
- 
- 
- 
- 
- 
- 
- 

VKHB 2275  
VKHB 2275  
  
VKHB 2275  
VKHB 2275  
  
VKHB 2268  
VKHB 2016  
  
VKHB 2268  
VKHB 2016

32010 X/OCL7CVB026  
32010 X/OCL7CVB026  
  
32010 X/OCL7CVB026  
32010 X/OCL7CVB026  
  
10R 33108 A  
32206 J2/Q  
  
10R 33108 A  
32206 J2/Q

-  
-  
  
-  
-  
  
-  
-  
  
-  
-

16)  
  
19)  
  
24)  
  
25)

C 25 4x4

- 
- 
- 
- 
- 
- 

VKBA 1444  
  
VKBA 844  
  
VKBA 1312

- 
- 
- 
- 
- 
- 

VKHB 2275  
VKHB 2275  
  
VKHB 2275  
VKHB 2275  
  
-  
-

32010 X/OCL7CVB026  
32010 X/OCL7CVB026  
  
32010 X/OCL7CVB026  
32010 X/OCL7CVB026  
  
-  
-

-  
-  
  
-  
-  
  
-  
-

16)  
  
19)  
  
20)



C 32	•		VKBA 813	•	-	-	-	21)
	•			•	-	-	-	
		○	VKBA 814	•	-	-	-	21)
		○		•	-	-	-	
C 35	•		VKBA 813	•	-	-	-	22)
	•			•	-	-	-	
		○	VKBA 814	•	-	-	-	22)
		○		•	-	-	-	
Jumper 1000/1400	•		VKBA 1444	•	VKHB 2275	32010 X/QCL7CVB026	-	
	•			•	VKHB 2275	32010 X/QCL7CVB026	-	
		○	VKBA 3429	•	VKHB 2266	XAA 32008 X	-	
		○		•	VKHB 2267	32006 X/Q	-	
Jumper 1800 kg	•		VKBA 3428	•	VKHB 2302	JXC 25678 CA	-	
	•			•	VKHB 2302	JXC 25678 CA	-	
		○	VKBA 3430	•	VKHB 2268	10R 33108 A	-	
		○		•	VKHB 2016	32206 J2/Q	-	





## DAF

Sherpa .....	18
F - Ser. ....	18
N - Ser. ....	21
LF - Ser. ....	21
CF - Ser. ....	22
XF - Ser. ....	23



Sherpa 285, 300, 310, 350	•		VKBA 5240	•	VKHB 2237	L 68149/110/Q	VKS 6102	
	•		VKBA 5248	•	VKHB 2238	07087 X/K-07210 X	-	
		○	-	•	-	-	VKS 6293	1), 22)
		○	-	•	VKHB 2246	18790/18720/Q	-	2), 22)
		○	-	•	VKHB 2239	18690/18620/Q	-	
Sherpa 285, 310, 350 (MT 210)	•		VKBA 5240	•	VKHB 2237	L 68149/110/Q	VKS 6102	19), 21)
	•		-	•	VKHB 2238	07087 X/K-07210 X	-	
		○	-	•	VKHB 2246	18790/18720/Q	-	2), 18)
		○	-	•	VKHB 2239	18690/18620/Q	-	
F 400 Ser.	•	28 N	VKBA 5240	•	VKHB 2237	L 68149/110/Q	VKS 6102	
	•		VKBA 5248	•	VKHB 2238	07087 X/K-07210 X	-	
		206	-	•	-	-	VKS 6293	1)
		○	VKBA 5241	•	VKHB 2246	18790/18720/Q	VKS 6120	2)
		○	-	•	VKHB 2239	18690/18620/Q	-	
F 600 Ser.	•	60 N	VKBA 5242	•	VKHB 2067	33209/Q	VKS 6266	
	•		VKBA 5243	•	VKHB 2016	32206 J2/Q	-	
		○	-	•	VKHB 2034	394 A/395 S	VKS 6267	
		○	-	•	-	-	-	
F 800 Ser.	•	60 N	VKBA 5242	•	VKHB 2067	33209/Q	VKS 6266	
	•		VKBA 5243	•	VKHB 2016	32206 J2/Q	-	
		○	-	•	VKHB 2034	394 A/395 S	VKS 6267	
		○	-	•	-	-	-	
F 1000 Ser.	•	84 N	VKBA 5244	•	VKHB 2241	45291/TIM.45220	VKS 6290	
	•		VKBA 5245	•	VKHB 2242	3490/TIM.3420	-	
		○	-	•	VKHB 2137	JM 714249/210/Q	VKS 6289	
		○	-	•	VKHB 2243	JM 511946/Q/JM 511910/Q	-	
F 1300 Ser.		1835	-	•	-	-	VKS 6168	
		○	-	•	VKHB 2140	33016/Q	VKS 6170	
F 1600 Ser.	•	N 100	-	•	-	-	VKS 6167	
	•		-	•	VKHB 2131	3782/3720	-	
	•	N 142	VKBA 5008	•	VKHB 2132	331933/Q	VKS 6169	
	•		-	•	VKHB 2070	32310 J2/Q	-	
		1635	-	•	VKHB 2141	681 A/672	VKS 6171	3)
	○	-	•	VKHB 2142	47687/47620/Q	VKS 6170		
	○	1635	-	•	VKHB 2083	CK-598 A/K-592 A	VKS 6168	4)
	○	-	•	VKHB 2142	47687/47620/Q	VKS 6170		
F 1700 Ser.	•	122 N	-	•	-	-	-	
	•		-	•	VKHB 2004	32309 J2/Q	-	
		○	-	•	-	-	-	
		○	-	•	VKHB 2140	33016/Q	-	



F 1900 Ser.

- 
- 
- 
- 
- 
- 

122 N  
131 N  
924

-  
-  
-

- 
- 
- 

VKHB 2236  
VKHB 2236  
VKHB 2140

-  
32309 BJ2/QCL7C  
-  
32309 BJ2/QCL7C  
-  
33016/Q

-  
-  
-  
-

F 2000/2005 Ser.

- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 

N 100  
N 122  
N 142  
N 142  
1635  
2255  
Trailing axle

-  
-  
-  
VKBA 5014  
-  
VKBA 5011  
VKBA 5011

- 
- 
- 
- 
- 
- 
- 
- 
- 
- 

VKHB 2131  
VKHB 2131  
VKHB 2132  
VKHB 2068  
VKHB 2132  
VKHB 2070  
VKHB 2141  
VKHB 2142  
VKHB 2141  
VKHB 2043  
VKHB 2141  
VKHB 2043

-  
3782/3720  
-  
3782/3720  
331933/Q  
33210/Q  
331933/Q  
32310 J2/Q  
681 A/672  
47687/47620/Q  
681 A/672  
663/653/Q  
681 A/672  
663/653/Q

VKS 6167  
-  
VKS 6166  
-  
VKS 6164  
-  
VKS 6164  
-  
VKS 6171  
VKS 6170  
VKS 6171  
VKS 6170  
VKS 6171  
VKS 6170

5)  
6)

F 2100/2105 Ser.

- 
- 
- 
- 
- 
- 
- 
- 

N 142  
N 142  
N 142  
2255  
Trailing axle

-  
VKBA 5014  
VKBA 5008  
VKBA 5011  
VKBA 5011

- 
- 
- 
- 
- 
- 
- 
- 

VKHB 2132  
VKHB 2068  
VKHB 2132  
VKHB 2070  
VKHB 2132  
VKHB 2070  
VKHB 2141  
VKHB 2043  
VKHB 2141  
VKHB 2043

331933/Q  
33210/Q  
331933/Q  
32310 J2/Q  
331933/Q  
32310 J2/Q  
681 A/672  
663/653/Q  
681 A/672  
663/653/Q

VKS 6164  
-  
VKS 6164  
-  
VKS 6169  
-  
VKS 6171  
VKS 6170  
VKS 6171  
VKS 6170

5)  
7)  
8)

F 2300/2305 Ser.

- 
- 
- 
- 
- 
- 
- 
- 
- 

N 142  
N 142  
N 142  
2255  
2699  
Trailing axle

-  
VKBA 5014  
VKBA 5008  
VKBA 5011  
VKBA 5015  
VKBA 5011

- 
- 
- 
- 
- 
- 
- 
- 
- 

VKHB 2132  
VKHB 2068  
VKHB 2132  
VKHB 2070  
VKHB 2132  
VKHB 2070  
VKHB 2141  
VKHB 2043  
VKHB 2143  
VKHB 2144  
VKHB 2141  
VKHB 2043

331933/Q  
33210/Q  
331933/Q  
32310 J2/Q  
331933/Q  
32310 J2/Q  
681 A/672  
663/653/Q  
687/672  
48393/48320  
681 A/672  
663/653/Q

VKS 6164  
-  
VKS 6164  
-  
VKS 6169  
-  
VKS 6171  
VKS 6170  
VKS 6165  
VKS 6165  
VKS 6171  
VKS 6170

5)  
7)  
8)  
9)





F 2500/2503/2505 Ser.	•	N 142	VKBA 5008	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6169 -		
	•			•					
		○	2255	-	•	VKHB 2141 VKHB 2043	681 A/672 663/653/Q	VKS 6171 -	10)
		○	2255	VKBA 5011	•	VKHB 2141 VKHB 2043	681 A/672 663/653/Q	VKS 6171 VKS 6170	11)
		○	2699	VKBA 5229	•	VKHB 2146 VKHB 2147	33021/QVB091 T2EE 100	VKS 6180 -	12)
		○	2699	VKBA 5015	•	VKHB 2143 VKHB 2144	687/672 48393/48320	VKS 6165 VKS 6165	13)
		○	Trailing axle	VKBA 5011	•	VKHB 2141 VKHB 2043	681 A/672 663/653/Q	VKS 6171 VKS 6170	
F 2700 Ser.	•	N 142	VKBA 5008	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6169 -		
	•	1346	VKBA 5020	•	VKHB 2145 VKHB 2082	33020/QVB091 33019/Q	VKS 6140 -		
F 2800 Ser.	•	N 140	-	•	VKHB 2132 VKHB 2068	331933/Q 33210/Q	VKS 6164 -	14)	
	•	N 140	-	•	VKHB 2132 VKHB 2068	331933/Q 33210/Q	VKS 6169 -	15)	
	•	N 140	VKBA 5014	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6164 -	7)	
	•	N 140	VKBA 5008	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6169 -	8)	
	•	N 142	VKBA 5014	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6164 -	16)	
	•	N 142	VKBA 5008	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6169 -	17)	
		○	2255	VKBA 5011	•	VKHB 2141 VKHB 2043	681 A/672 663/653/Q	VKS 6171 VKS 6170	
		○	2699	VKBA 5015	•	VKHB 2143 VKHB 2144	687/672 48393/48320	VKS 6165 VKS 6165	
		○	Trailing axle	VKBA 5011	•	VKHB 2141 VKHB 2043	681 A/672 663/653/Q	VKS 6171 VKS 6170	
	F 2900 Ser.	•	N 142	VKBA 5014	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6164 -	16)
•		N 142	VKBA 5008	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6169 -	17)	
		○	1346	VKBA 5020	•	VKHB 2145 VKHB 2082	33020/QVB091 33019/Q	VKS 6140 -	
		○	1354	VKBA 5229	•	VKHB 2146 VKHB 2147	33021/QVB091 T2EE 100	VKS 6180 -	9)
		○	1355	VKBA 5229	•	VKHB 2146 VKHB 2147	33021/QVB091 T2EE 100	VKS 6180 -	9)
		○			•				



F 3200 Ser.	•	○	N 142	VKBA 5008	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6169 -	9)
	•		1354	VKBA 5229	•	VKHB 2146 VKHB 2147	33021/QVB091 T2EE 100	VKS 6180 -	
	•		Trailing axle	VKBA 5011	•	VKHB 2141 VKHB 2043	681 A/672 663/653/Q	VKS 6171 VKS 6170	
F 3300/3305 Ser.	•	○	N 142	VKBA 5008	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6169 -	
	•		2699	VKBA 5015	•	VKHB 2143 VKHB 2144	687/672 48393/48320	VKS 6165 VKS 6165	
	•		Trailing axle	VKBA 5011	•	VKHB 2141 VKHB 2043	681 A/672 663/653/Q	VKS 6171 VKS 6170	
F 3600 Ser.	•	○	N 142	VKBA 5008	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6169 -	
	•		1346	VKBA 5020	•	VKHB 2145 VKHB 2082	33020/QVB091 33019/Q	VKS 6140 -	
	•		1355	VKBA 5229	•	VKHB 2146 VKHB 2147	33021/QVB091 T2EE 100	VKS 6180 -	
	•		2699	VKBA 5229	•	VKHB 2146 VKHB 2147	33021/QVB091 T2EE 100	VKS 6180 -	
F 95 Ser.	•	○	132 N	-	•	- VKHB 2236	- 32309 BJ2/QCL7C	- -	23)
	•		152 N	VKBA 5230	•	VKHB 2232 VKHB 2070	33216/QVB091 32310 J2/Q	VKS 6333 -	22)
	•		172 N	VKBA 5227	•	VKHB 2231 VKHB 2002	T3FE 075/QVB481 32311 J2	VKS 6333 -	22)
	•		1346	VKBA 5020	•	VKHB 2145 VKHB 2082	33020/QVB091 33019/Q	VKS 6140 -	23)
	•		1354	VKBA 5229	•	VKHB 2146 VKHB 2147	33021/QVB091 T2EE 100	VKS 6180 -	23),9)
	•		1355	VKBA 5229	•	VKHB 2146 VKHB 2147	33021/QVB091 T2EE 100	VKS 6180 -	23),9)
	•		Trailing axle	VKBA 5011	•	VKHB 2141 VKHB 2043	681 A/672 663/653/Q	VKS 6171 VKS 6170	23)
	•								
N 2800 Ser.	•	○	N 142	VKBA 5014	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6164 -	16)
	•		N 142	VKBA 5008	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6169 -	17)
	•		2699	VKBA 5015	•	VKHB 2143 VKHB 2144	687/672 48393/48320	VKS 6165 VKS 6165	
LF 45	•	○	F 36	-	•	VKHB 2241 VKHB 2242	45291/45220 3490/3420	VKS 6290 -	
	•		SR 5.12	-	•	VKHB 2157 VKHB 2074	32016 X/Q 3984/3920	VKS 6357 -	



LF 55	•	F60	-	•	VKHB 2332	H 212749/H 212710	VKS 6358	
	•			•	VKHB 2067	33209/Q	-	
	○	SR 10.20	-	•	VKHB 2161	32019 X/Q	VKS 6140	
	○			•	VKHB 2333	495/493	-	
65 CF	•	N 150, 152	-	•	VKHB 2232	33216/QVB091	VKS 6333	24)
	•			•	VKHB 2070	32310 J2/Q	-	
	•	172 N	-	•	VKHB 2231	T3FE 075/QVB481	VKS 6333	24)
	•			•	VKHB 2002	32311 J2	-	
	•	182 N	-	•	VKHB 2232	33216/QVB091	VKS 6333	24)
	•			•	VKHB 2070	32310 J2/Q	-	
	○	AAS 1347	-	•	VKHB 2145	33020/QVB091	VKS 6180	24)
○			•	VKHB 2082	33019/Q	-		
	○	AAS 1354, 1355	-	•	VKHB 2146	33021/QVB091	VKS 6180	24)
	○			•	VKHB 2147	T2EE 100	-	
	○	Trailing axle	-	•	VKHB 2141	681 A/672	VKS 6171	
	○			•	VKHB 2043	663/653/Q	-	
75 CF	•	N 150, 152	-	•	VKHB 2232	33216/QVB091	VKS 6333	24)
	•			•	VKHB 2070	32310 J2/Q	-	
	•	172 N	-	•	VKHB 2231	T3FE 075/QVB481	VKS 6333	24)
	•			•	VKHB 2002	32311 J2	-	
	○	AAS 1132	-	•	VKHB 2145	33020/QVB091	VKS 6180	24)
	○			•	VKHB 2082	33019/Q	-	
	○	AAS 1339	-	•	VKHB 2145	33020/QVB091	VKS 6180	24)
○			•	VKHB 2082	33019/Q	-		
	○	AAS 1354, 1355	-	•	VKHB 2146	33021/QVB091	VKS 6180	24) 9)
	○			•	VKHB 2147	T2EE 100	-	
	○	Trailing axle	-	•	VKHB 2141	681 A/672	VKS 6171	
	○			•	VKHB 2043	663/653/Q	-	
85 CF	•	172 N	-	•	VKHB 2231	T3FE 075/QVB481	VKS 6333	24)
	•			•	VKHB 2002	32311 J2	-	
	•	182 N	-	•	VKHB 2232	33216/QVB091	VKS 6333	24)
	•			•	VKHB 2070	32310 J2/Q	-	
	○	AAS 1347	-	•	VKHB 2145	33020/QVB091	VKS 6180	24)
	○			•	VKHB 2082	33019/Q	-	
	○	AAS 1354, 1355	-	•	VKHB 2146	33021/QVB091	VKS 6180	24) 9)
○			•	VKHB 2147	T2EE 100	-		
	○	Trailing axle	-	•	VKHB 2141	681 A/672	VKS 6171	
	○			•	VKHB 2043	663/653/Q	-	



95 XF	•		N 150, 152	-	•	VKHB 2232	33216/QVB091	VKS 6333	24)
	•				•	VKHB 2070	32310 J2/Q	-	
	•		172 N	-	•	VKHB 2231	T3FE 075/QVB481	VKS 6333	24)
	•				•	VKHB 2002	32311 J2	-	
	○		AAS 1347	-	•	VKHB 2145	33020/QVB091	VKS 6180	24)
	○				•	VKHB 2082	33019/Q	-	
95 XF.530	○	AAS 1354, 1355	-	•	VKHB 2146	33021/QVB091	VKS 6180	24) 9)	
	○			•	VKHB 2147	T2EE 100	-		
	○	Trailing axle	-	•	VKHB 2141	681 A/672	VKS 6171		
	○			•	VKHB 2043	663/653/Q	-		
	•	182 N	-	•	VKHB 2232	33216/QVB091	VKS 6333	24)	
•				•	VKHB 2070	32310 J2/Q	-		
95 XF.530	○	AAS 1347	-	•	VKHB 2145	33020/QVB091	VKS 6180	24)	
	○			•	VKHB 2082	33019/Q	-		
	○	AAS 1354, 1355	-	•	VKHB 2146	33021/QVB091	VKS 6180	24)	
	○			•	VKHB 2147	T2EE 100	-		
95 XF.530	○	Trailing axle	-	•	VKHB 2141	681 A/672	VKS 6171		
	○			•	VKHB 2043	663/653/Q	-		





## FIAT-IVECO

238 .....	26	40-10 .....	48-49
242 .....	26	410E../Eurotrakker/Cursor .....	49
Talento .....	26	440E../Eurotech/Trakker/Star/Cursor .....	49-51
Ducato .....	26	50-9/Zeta, 50-10 Zeta .....	51
Daily .....	27	55-.. .....	51
Grinta .....	31	60-(E)../Turbozeta/Eurocargo .....	51
100(E)-15, 18, 21/Eurocargo .....	33	619 T 1P, 619 N 1P CKD .....	51
109-14 .....	34	65(E)../Export/Eurocargo .....	51-52
110-13A, 110-16 .....	34	70-10, 12, 14/Zeta .....	52
115-14, 17 .....	34	720E31/Eurotrakker .....	52
120(E)../Eurocargo .....	34	75(E)../Eurocargo .....	52
130(E)../Eurocargo .....	35	79-../Turbozeta .....	53
135(E)-14, 17, 18, 23 .....	35	80(E)../Eurocargo .....	53
140-14, 20 .....	35	85E../Eurocargo .....	53
145-17 (II-Serie) .....	35	90-13, 14, 16, 17/A 90-13 .....	53-54
150(E)-.. .....	35	95(E)-14/ Zeta/Eurocargo .....	54
159-17, 20 .....	35	A 135-14, 17 .....	54
160-16, 17, 23, 26, 30 .....	36	A175-24, 175-17, 24 .....	54
165-24 (II-Serie) .....	36	Z 220/T H/Z 220 Stripped chass. ....	54
170(E)-15, 18, 23, 25, 27, 34 .....	36	Z Range: 50, 60, 65, 75, 79 .....	54-55
170/190-20, 170/190-26, 35 .....	37		
175-17, 24 .....	37		
180(E)../Eurocargo/Tech, Star .....	37-38		
190(E)../Turbotech/Star/Trakker .....	38-40		
220-../T/Range/Turbotech .....	41-42		
230-35 WM (6x6) .....	42		
240(E)../Euro/TurbotechT/Star .....	42-43		
260(E)../Euro../Turbo.. .....	43-45		
280E23 Eurocargo .....	46		
300-30 AH (8x4) .....	46		
320(E,D)../Eurocargo .....	46		
325E27 Eurotech .....	46		
330-../Eurotrakker .....	46		
340E../Eurotakker/Cursor .....	47		
380E../Eurotrakker/Cursor .....	47		
400E../Eurotech/Trakker/Star .....	48		



238	• •		-	• •	- -	- -	- -	
242	• •		VKBA 813	• •	- -	- -	- -	
		○ ○	VKBA 814	• •	- -	- -	- -	
Talento	• •		VKBA 1444	• •	VKHB 2275 VKHB 2275	32010 X/OCL7CVB026 32010 X/OCL7CVB026	- -	36)
		○ ○	VKBA 1445	• •	VKHB 2266 VKHB 2267	XAA 32008 X 32006 X/Q	- -	37)
		○ ○	VKBA 1446	• •	VKHB 2266 VKHB 2267	XAA 32008 X 32006 X/Q	- -	38)
Ducato 13	• •		VKBA 844	• •	VKHB 2275 VKHB 2275	32010 X/OCL7CVB026 32010 X/OCL7CVB026	- -	24)
		○ ○	VKBA 845	• •	VKHB 2266 VKHB 2267	XAA 32008 X 32006 X/Q	- -	20)
		○ ○	VKBA 846	• •	VKHB 2266 VKHB 2267	XAA 32008 X 32006 X/Q	- -	21)
		○ ○	VKBA 1445	• •	VKHB 2266 VKHB 2267	XAA 32008 X 32006 X/Q	- -	22)
		○ ○	VKBA 1446	• •	VKHB 2266 VKHB 2267	XAA 32008 X 32006 X/Q	- -	23)
Ducato I 10	• • • •		VKBA 844	• •	VKHB 2275 VKHB 2275	32010 X/OCL7CVB026 32010 X/OCL7CVB026	- -	18)
			VKBA 1444	• •	VKHB 2275 VKHB 2275	32010 X/OCL7CVB026 32010 X/OCL7CVB026	- -	19)
		○ ○	VKBA 845	• •	VKHB 2266 VKHB 2267	XAA 32008 X 32006 X/Q	- -	20)
		○ ○	VKBA 846	• •	VKHB 2266 VKHB 2267	XAA 32008 X 32006 X/Q	- -	21)
		○ ○	VKBA 1445	• •	VKHB 2266 VKHB 2267	XAA 32008 X 32006 X/Q	- -	22)
		○ ○	VKBA 1446	• •	VKHB 2266 VKHB 2267	XAA 32008 X 32006 X/Q	- -	23)
Ducato I 14	• • • •		VKBA 844	• •	VKHB 2275 VKHB 2275	32010 X/OCL7CVB026 32010 X/OCL7CVB026	- -	25)
			VKBA 1444	• •	VKHB 2275 VKHB 2275	32010 X/OCL7CVB026 32010 X/OCL7CVB026	- -	19)
		○ ○	VKBA 1445	• •	VKHB 2266 VKHB 2267	XAA 32008 X 32006 X/Q	- -	26)
		○ ○	VKBA 1446	• •	VKHB 2266 VKHB 2267	XAA 32008 X 32006 X/Q	- -	27)



Ducato I Maxi 18	•		VKBA 844	•	VKHB 2275	32010 X/QCL7CVB026	-	25)
	•			•	VKHB 2275	32010 X/QCL7CVB026	-	
	•		VKBA 1444	•	VKHB 2275	32010 X/QCL7CVB026	-	19)
	•			•	VKHB 2275	32010 X/QCL7CVB026	-	
	○		VKBA 1462	•	VKHB 2268	10R 33108 A	-	26)
	○			•	VKHB 2016	32206 J2/Q	-	
	○		VKBA 1463	•	VKHB 2268	10R 33108 A	-	27)
	○			•	VKHB 2016	32206 J2/Q	-	
Ducato II 10 4x2	•		VKBA 1444	•	VKHB 2275	32010 X/QCL7CVB026	-	83)
	•			•	VKHB 2275	32010 X/QCL7CVB026	-	
	○		VKBA 3429	•	VKHB 2266	XAA 32008 X	-	83)
	○			•	VKHB 2267	32006 X/Q	-	
Ducato II 10 4x4	•		VKBA 1444	•	VKHB 2275	32010 X/QCL7CVB026	-	84)
	•			•	VKHB 2275	32010 X/QCL7CVB026	-	
	○		VKBA 1444	•	VKHB 2275	32010 X/QCL7CVB026	-	84)
	○			•	VKHB 2275	32010 X/QCL7CVB026	-	
Ducato II 14 4x2	•		VKBA 1444	•	VKHB 2275	32010 X/QCL7CVB026	-	83)
	•			•	VKHB 2275	32010 X/QCL7CVB026	-	
	○		VKBA 3429	•	VKHB 2266	XAA 32008 X	-	83)
	○			•	VKHB 2267	32006 X/Q	-	
Ducato II 14 4x4	•		VKBA 1444	•	VKHB 2275	32010 X/QCL7CVB026	-	84)
	•			•	VKHB 2275	32010 X/QCL7CVB026	-	
	○		VKBA 1444	•	VKHB 2275	32010 X/QCL7CVB026	-	84)
	○			•	VKHB 2275	32010 X/QCL7CVB026	-	
Ducato II 18 4x2	•		VKBA 3428	•	VKHB 2302	JXC 25678 CA	-	83)
	•			•	VKHB 2302	JXC 25678 CA	-	
	○		VKBA 3430	•	VKHB 2268	10R 33108 A	-	83)
	○			•	VKHB 2016	32206 J2/Q	-	
Ducato II 18 4x4	•		VKBA 3428	•	VKHB 2302	JXC 25678 CA	-	84)
	•			•	VKHB 2302	JXC 25678 CA	-	
	○		VKBA 1444	•	VKHB 2275	32010 X/QCL7CVB026	-	84)
	○			•	VKHB 2275	32010 X/QCL7CVB026	-	
Daily: 28-8	•		-	•	-	-	-	6)
	•			•	VKHB 2262	30305 J2	-	
	•		-	•	-	-	-	7)
	•			•	VKHB 2262	30305 J2	-	
	•		VKBA 1386	•	VKHB 2020	32208 J2/Q	-	8)
	•			•	VKHB 2262	30305 J2	-	
•		VKBA 1385	•	VKHB 2020	32208 J2/Q	-	9)	
•			•	VKHB 2262	30305 J2	-		
	○	Salisbury 1	VKBA 821	•	VKHB 2246	18790/18720/Q	-	10)
	○			•	VKHB 2239	18690/18620/Q	-	





Daily: 30-8

•			-	•	-	-	-	6)
•				•	VKHB 2262	30305 J2	-	
•			-	•	-	-	-	7)
•				•	VKHB 2262	30305 J2	-	
•		Iveco	VKBA 1386	•	VKHB 2020	32208 J2/Q	-	60)
•				•	VKHB 2262	30305 J2	-	
•		Iveco	VKBA 1385	•	VKHB 2020	32208 J2/Q	-	61)
•				•	VKHB 2262	30305 J2	-	
•		Salisbury	-	•	VKHB 2258	368 A/362 A/Q	-	13)
•				•	VKHB 2239	18690/18620/Q	-	
○		Salisbury 1	VKBA 1391	•	VKHB 2258	368 A/362 A/Q	-	10)
○				•	VKHB 2239	18690/18620/Q	-	
○		Iveco	VKBA 1393	•	VKHB 2060	32011 X/Q	-	62)
○				•	VKHB 2060	32011 X/Q	-	

Daily: 30-9

•		Iveco	VKBA 1386	•	VKHB 2020	32208 J2/Q	-	63)
•				•	VKHB 2262	30305 J2	-	
•		Iveco	VKBA 1385	•	VKHB 2020	32208 J2/Q	-	64)
•				•	VKHB 2262	30305 J2	-	
•		Salisbury	-	•	VKHB 2258	368 A/362 A/Q	-	13)
•				•	VKHB 2239	18690/18620/Q	-	
○		Salisbury 1	VKBA 821	•	VKHB 2246	18790/18720/Q	-	13)
○				•	VKHB 2239	18690/18620/Q	-	
○		Iveco	VKBA 1393	•	VKHB 2060	32011 X/Q	-	16)
○				•	VKHB 2060	32011 X/Q	-	

Daily: 32-8

•			-	•	-	-	-	6)
•				•	VKHB 2262	30305 J2	-	
•			-	•	-	-	-	7)
•				•	VKHB 2262	30305 J2	-	
•			VKBA 1386	•	VKHB 2020	32208 J2/Q	-	8)
•				•	VKHB 2262	30305 J2	-	
•			VKBA 1385	•	VKHB 2020	32208 J2/Q	-	9)
•				•	VKHB 2262	30305 J2	-	
○		Salisbury 1	VKBA 1391	•	VKHB 2258	368 A/362 A/Q	-	10)
○				•	VKHB 2239	18690/18620/Q	-	

Daily: 35-8

•			-	•	-	-	-	6)
•				•	VKHB 2262	30305 J2	-	
•			-	•	-	-	-	7)
•				•	VKHB 2262	30305 J2	-	
•		Iveco	VKBA 1386	•	VKHB 2020	32208 J2/Q	-	67)
•				•	VKHB 2262	30305 J2	-	
•		Iveco	VKBA 1385	•	VKHB 2020	32208 J2/Q	-	68)
•				•	VKHB 2262	30305 J2	-	
•		Salisbury	-	•	VKHB 2258	368 A/362 A/Q	-	13)
•				•	VKHB 2239	18690/18620/Q	-	
○		Salisbury 1	VKBA 821	•	VKHB 2246	18790/18720/Q	-	69)
○				•	VKHB 2239	18690/18620/Q	-	



Daily: 35-8 .../...	○ ○	Salisbury 2	-	• •	VKHB 2276 VKHB 2258	K-387 A/K-382 368 A/362 A/Q	- -	10)	
		○ ○	Iveco	VKBA 1393	• •	VKHB 2060 VKHB 2060	32011 X/Q 32011 X/Q	- -	65)
			○ ○	Iveco	VKBA 1394	• •	VKHB 2059 VKHB 2060	33111/Q 32011 X/Q	- -
		○ ○		Iveco	VKBA 1393	• •	VKHB 2060 VKHB 2060	32011 X/Q 32011 X/Q	- -
			○ ○	Iveco	VKBA 3552	• •	- -	- -	- -
Daily: 35-8 H. DUTY	• •	Iveco	VKBA 1386	• •	VKHB 2020 VKHB 2262	32208 J2/Q 30305 J2	- -	4)	
		• •	Iveco	VKBA 1385	• •	VKHB 2020 VKHB 2262	32208 J2/Q 30305 J2	- -	5)
	○ ○		Iveco	VKBA 1393	• •	VKHB 2060 VKHB 2060	32011 X/Q 32011 X/Q	- -	
Daily: 35-9	• •	Iveco	VKBA 1386	• •	VKHB 2020 VKHB 2262	32208 J2/Q 30305 J2	- -	11)	
		• •	Iveco	VKBA 1385	• •	VKHB 2020 VKHB 2262	32208 J2/Q 30305 J2	- -	12)
	○ ○		Iveco	VKBA 1393	• •	VKHB 2060 VKHB 2060	32011 X/Q 32011 X/Q	- -	13)
		○ ○	Salisbury 1	VKBA 821	• •	VKHB 2246 VKHB 2239	18790/18720/Q 18690/18620/Q	- -	13)
Daily: 35-10	• •		VKBA 1386	• •	VKHB 2020 VKHB 2262	32208 J2/Q 30305 J2	- -	4)	
		• •		VKBA 1385	• •	VKHB 2020 VKHB 2262	32208 J2/Q 30305 J2	- -	5)
	○ ○			VKBA 1393	• •	VKHB 2060 VKHB 2060	32011 X/Q 32011 X/Q	- -	70)
		○ ○		VKBA 1394	• •	VKHB 2059 VKHB 2060	33111/Q 32011 X/Q	- -	71)
Daily: 35-10 Turbodaily	• •		VKBA 3551	• •	- -	- -	- -		
		○ ○		VKBA 1393	• •	VKHB 2060 VKHB 2060	32011 X/Q 32011 X/Q	- -	85)
	○ ○			VKBA 3552	• •	- -	- -	- -	86)
Daily: 35-12 Turbodaily	• •		VKBA 3509	• •	VKHB 2065 VKHB 2179	33208/Q 33206/Q	- -	72)	
		• •		VKBA 3508	• •	VKHB 2065 VKHB 2179	33208/Q 33206/Q	- -	73)
	• •			VKBA 3551	• •	- -	- -	- -	82)
		○ ○		VKBA 1393	• •	VKHB 2060 VKHB 2060	32011 X/Q 32011 X/Q	- -	81)



Daily: 35-12 Turbodayly..../...	•	○	VKBA 1393	•	VKHB 2060	32011 X/Q	-	85,82)
				•	VKHB 2060	32011 X/Q	-	
	•	○	VKBA 3552	•	-	-	-	86),82)
				•	-	-	-	
Daily: 40-8	•		-	•	-	-	-	6)
				•	VKHB 2262	30305 J2	-	
	•		-	•	-	-	-	7)
				•	VKHB 2262	30305 J2	-	
	•	Iveco	VKBA 1386	•	VKHB 2020	32208 J2/Q	-	67)
				•	VKHB 2262	30305 J2	-	
	•	Iveco	VKBA 1385	•	VKHB 2020	32208 J2/Q	-	68)
				•	VKHB 2262	30305 J2	-	
	•	Salisbury	-	•	VKHB 2258	368 A/362 A/Q	-	13)
				•	VKHB 2239	18690/18620/Q	-	
•	Salisbury 2	-	•	VKHB 2276	K-387 A/K-382	-	10)	
			•	VKHB 2258	368 A/362 A/Q	-		
•	Salisbury 1	VKBA 821	•	VKHB 2246	18790/18720/Q	-	13)	
			•	VKHB 2239	18690/18620/Q	-		
•	Iveco	VKBA 1393	•	VKHB 2060	32011 X/Q	-	74)	
			•	VKHB 2060	32011 X/Q	-		
Daily: 40-8 H. DUTY	•		VKBA 1386	•	VKHB 2020	32208 J2/Q	-	4)
				•	VKHB 2262	30305 J2	-	
	•		VKBA 1385	•	VKHB 2020	32208 J2/Q	-	5)
			•	VKHB 2262	30305 J2	-		
•		VKBA 1393	•	VKHB 2060	32011 X/Q	-		
			•	VKHB 2060	32011 X/Q	-		
Daily: 45-10	•		VKBA 3509	•	VKHB 2065	33208/Q	-	4)
				•	VKHB 2179	33206/Q	-	
	•		VKBA 3508	•	VKHB 2065	33208/Q	-	5)
				•	VKHB 2179	33206/Q	-	
•		VKBA 1393	•	VKHB 2060	32011 X/Q	-	75)	
			•	VKHB 2060	32011 X/Q	-		
•		VKBA 1394	•	VKHB 2059	33111/Q	-	76)	
			•	VKHB 2060	32011 X/Q	-		
Daily: 49-10	•		VKBA 3509	•	VKHB 2065	33208/Q	-	4)
				•	VKHB 2179	33206/Q	-	
	•		VKBA 3508	•	VKHB 2065	33208/Q	-	5)
				•	VKHB 2179	33206/Q	-	
•		VKBA 1393	•	VKHB 2060	32011 X/Q	-	77)	
			•	VKHB 2060	32011 X/Q	-		
•		VKBA 1394	•	VKHB 2059	33111/Q	-	39)	
			•	VKHB 2060	32011 X/Q	-		
Daily: 49-10 Turbodayly	•		VKBA 3551	•	-	-	-	
				•	-	-	-	
	•		VKBA 3552	•	-	-	-	
				•	-	-	-	



Daily: 49-12 Turbodayly	•		VKBA 3508	•	VKHB 2065	33208/Q	-	73)	
	•			•	VKHB 2179	33206/Q	-		
	•		VKBA 3509	•	VKHB 2065	33208/Q	-	72)	
	•			•	VKHB 2179	33206/Q	-		
	•		VKBA 3551	•	-	-	-	82)	
	○		VKBA 1394	•	VKHB 2059	33111/Q	-	74)	
	○			•	VKHB 2060	32011 X/Q	-		
	○		VKBA 3552	•	-	-	-	82)	
	○			•	-	-	-		
Daily: 59-12 Turbodayly	•		VKBA 3553	•	-	-	-		
	•			•	-	-	-		
		○	VKBA 5274	•	VKHB 2209	RBT1B 329138/QVQ276/ 34478/2/QVQ276	VKS 6326		
	○			•	VKHB 2209	RBT1B 329138/QVQ276/ 34478/2/QVQ276	-		
Grinta: 28-8	•		-	•	-	-	-	6)	
	•			•	VKHB 2262	30305 J2	-		
	•		-	•	-	-	-	7)	
	•			•	VKHB 2262	30305 J2	-		
	•		VKBA 1386	•	VKHB 2020	32208 J2/Q	-	8)	
	•			•	VKHB 2262	30305 J2	-		
	•		VKBA 1385	•	VKHB 2020	32208 J2/Q	-	9)	
	○	Salisbury 1	VKBA 821	•	VKHB 2246	18790/18720/Q	-	10)	
	○			•	VKHB 2239	18690/18620/Q	-		
Grinta: 30-8	•		-	•	-	-	-	6)	
	•			•	VKHB 2262	30305 J2	-		
	•		-	•	-	-	-	7)	
	•			•	VKHB 2262	30305 J2	-		
	•		VKBA 1386	•	VKHB 2020	32208 J2/Q	-	8)	
	•			•	VKHB 2262	30305 J2	-		
	•		VKBA 1385	•	VKHB 2020	32208 J2/Q	-	9)	
	•			•	VKHB 2262	30305 J2	-		
	•		Iveco	VKBA 1386	•	VKHB 2020	32208 J2/Q	-	11)
	•			•	VKHB 2262	30305 J2	-		
	•		Iveco	VKBA 1385	•	VKHB 2020	32208 J2/Q	-	12)
	•			•	VKHB 2262	30305 J2	-		
	•		Salisbury	-	•	VKHB 2258	368 A/362 A/Q	-	13)
	○			•	VKHB 2239	18690/18620/Q	-		
	○	Salisbury 1	VKBA 1391	•	VKHB 2258	368 A/362 A/Q	-	10)	
	○			•	VKHB 2239	18690/18620/Q	-		
	○	Iveco	VKBA 1393	•	VKHB 2060	32011 X/Q	-	13)	
	○			•	VKHB 2060	32011 X/Q	-		

# FIAT-IVECO



Grinta: 30-9



Iveco

**VKBA 1386**



**VKHB 2020**  
**VKHB 2262**

32208 J2/Q  
30305 J2

-

11)



Iveco

**VKBA 1385**



**VKHB 2020**  
**VKHB 2262**

32208 J2/Q  
30305 J2

-

12)



Salisbury

-



**VKHB 2258**  
**VKHB 2239**

368 A/362 A/Q  
18690/18620/Q

-

13)



Salisbury 1

**VKBA 821**



**VKHB 2246**  
**VKHB 2239**

18790/18720/Q  
18690/18620/Q

-

13)

Grinta: 32-8



-



-

-  
30305 J2

-

6)



-



-

-  
30305 J2

-

7)



**VKBA 1386**



**VKHB 2020**  
**VKHB 2262**

32208 J2/Q  
30305 J2

-

8)



**VKBA 1385**



**VKHB 2020**  
**VKHB 2262**

32208 J2/Q  
30305 J2

-

9)



Salisbury 1

**VKBA 1391**



**VKHB 2258**  
**VKHB 2239**

368 A/362 A/Q  
18690/18620/Q

-

10)

Grinta: 35-8



-



-

-  
30305 J2

-

6)



-



-

-  
30305 J2

-

7)



**VKBA 1386**



**VKHB 2020**  
**VKHB 2262**

32208 J2/Q  
30305 J2

-

8)



**VKBA 1385**



**VKHB 2020**  
**VKHB 2262**

32208 J2/Q  
30305 J2

-

9)



Iveco

**VKBA 1386**



**VKHB 2020**  
**VKHB 2262**

32208 J2/Q  
30305 J2

-

11)



Iveco

**VKBA 1385**



**VKHB 2020**  
**VKHB 2262**

32208 J2/Q  
30305 J2

-

12)



Salisbury

-



**VKHB 2258**  
**VKHB 2239**

368 A/362 A/Q  
18690/18620/Q

-

13)



Salisbury 1

**VKBA 821**



**VKHB 2246**  
**VKHB 2239**

18790/18720/Q  
18690/18620/Q

-

10)



Salisbury 2

-



**VKHB 2276**  
**VKHB 2258**

K-387 A/K-382  
368 A/362 A/Q

-

10)



Salisbury 1

**VKBA 821**



**VKHB 2246**  
**VKHB 2239**

18790/18720/Q  
18690/18620/Q

-

13)

Grinta: 35-9



Iveco

**VKBA 1386**



**VKHB 2020**  
**VKHB 2262**

32208 J2/Q  
30305 J2

-

11)



Iveco

**VKBA 1385**



**VKHB 2020**  
**VKHB 2262**

32208 J2/Q  
30305 J2

-

12)



Iveco

**VKBA 1393**



**VKHB 2060**  
**VKHB 2060**

32011 X/Q  
32011 X/Q

-

13)



Salisbury 1

**VKBA 821**



**VKHB 2246**  
**VKHB 2239**

18790/18720/Q  
18690/18620/Q

-

13)



Grinta: 40-8

	•		-	•	-	-	-	6)
	•			•	VKHB 2262	30305 J2	-	
	•		-	•	-	-	-	7)
	•			•	VKHB 2262	30305 J2	-	
	•		VKBA 1386	•	VKHB 2020	32208 J2/Q	-	8)
	•			•	VKHB 2262	30305 J2	-	
	•		VKBA 1385	•	VKHB 2020	32208 J2/Q	-	9)
	•			•	VKHB 2262	30305 J2	-	
	•	Iveco	VKBA 1386	•	VKHB 2020	32208 J2/Q	-	11)
	•			•	VKHB 2262	30305 J2	-	
•	Iveco	VKBA 1385	•	VKHB 2020	32208 J2/Q	-	12)	
•			•	VKHB 2262	30305 J2	-		
•	Salisbury	-	•	VKHB 2258	368 A/362 A/Q	-	13)	
•			•	VKHB 2239	18690/18620/Q	-		
•	Salisbury 2	-	•	VKHB 2276	K-387 A/K-382	-	10)	
•			•	VKHB 2258	368 A/362 A/Q	-		
•	Salisbury 1	VKBA 821	•	VKHB 2246	18790/18720/Q	-	13)	
•			•	VKHB 2239	18690/18620/Q	-		

Grinta Ser S: 30-9, 35-8, 35-10, 40-8, 40-10

	•	Iveco	VKBA 1386	•	VKHB 2020	32208 J2/Q	-	14)
	•			•	VKHB 2262	30305 J2	-	
	•	Iveco	VKBA 1385	•	VKHB 2020	32208 J2/Q	-	15)
•				•	VKHB 2262	30305 J2	-	
•	Salisbury	-	•	VKHB 2258	368 A/362 A/Q	-	13)	
•			•	VKHB 2239	18690/18620/Q	-		
•	Salisbury 2	-	•	VKHB 2276	K-387 A/K-382	-	10)	
•			•	VKHB 2258	368 A/362 A/Q	-		
•	Salisbury 1	VKBA 821	•	VKHB 2246	18790/18720/Q	-	13)	
•			•	VKHB 2239	18690/18620/Q	-		

Grinta Ser S Turbo: 45-10, 49-10










	•		VKBA 3509	•	VKHB 2065	33208/Q	-	78)
	•			•	VKHB 2179	33206/Q	-	
	•		VKBA 3508	•	VKHB 2065	33208/Q	-	79)
•				•	VKHB 2179	33206/Q	-	
•	Iveco 4512	VKBA 1394	•	VKHB 2059	33111/Q	-	17)	
•			•	VKHB 2060	32011 X/Q	-		

100E15, 100E18, 100E21 Eurocargo

	•	Iveco 5833	VKBA 5278	•	VKHB 2249	R 33209/QCLNVB323/ L 33209/QCLNVQ276	VKS 6316	
	•			•	VKHB 2250	JXC 25370CA/JXC 25370DA	-	
	•	Iveco 4517	VKBA 5274	•	VKHB 2209	RBT1B 329138/QVQ276/ 34478/2/QVQ276	VKS 6326	31)
	•			•	VKHB 2209	RBT1B 329138/QVQ276/ 34478/2/QVQ276	-	
	•	Iveco 4521	VKBA 5349	•	VKHB 2253	JXC 25716 C/JXC 25716 D	VKS 6326	
	•			•	VKHB 2253	JXC 25716 C/JXC 25716 D	-	
	•	Rockwell, F120-F125	VKBA 5276	•	VKHB 2208	567/563	VKS 6247	
	•			•	VKHB 2074	3984/3920	-	












109-14, 109-14 CKD,	• •		VKBA 5288	• •	VKHB 2255 VKHB 2182	T2ED 050/Q 33207/Q	VKS 6227 -	33)
	• •	Iveco 5830	VKBA 5171	• •	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -	
	○ ○	Rockwell, H 140 E	VKBA 5180	• •	VKHB 2211 VKHB 2137	R 32217 J2/QVB128/L 32217/Q JM 714249/210/Q	VKS 6210 VKS 6211	34)
109-14 Zeta	• •		VKBA 5171	• •	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -	39)
	○ ○	Rockwell, H 140 E	VKBA 5180	• •	VKHB 2211 VKHB 2137	R 32217 J2/QVB128/L 32217/Q JM 714249/210/Q	VKS 6210 VKS 6211	
110-13A	• •		-	• •	VKHB 2019 VKHB 2020	32211 J2/Q 32208 J2/Q	VKS 6239 -	
	○ ○		-	• •	VKHB 2204 VKHB 2033	30216 J2/Q 32215 J2/Q	VKS 6204	
110-16 A, 110-16 AH	• •	Iveco VA 43	-	• •	VKHB 2019 VKHB 2020	32211 J2/Q 32208 J2/Q	VKS 6239 -	
	○ ○	Iveco 4540	-	• •	VKHB 2204 VKHB 2033	30216 J2/Q 32215 J2/Q	VKS 6204 -	
115-14 (I-II-Serie), 115-17 (I-II-Serie), 115-17 H (I-II-Serie)	• •	Iveco 5844 M	-	• •	VKHB 2173 VKHB 2061	33212/Q 33211/Q	VKS 6221 -	
	○ ○	Rockwell, H 140 E	VKBA 5180	• •	VKHB 2211 VKHB 2137	R 32217 J2/QVB128/L 32217/Q JM 714249/210/Q	VKS 6210 VKS 6211	
115-17 (II-Serie)	○ ○	Rockwell, H125-P130	VKBA 5281	• •	VKHB 2211 VKHB 2137	R 32217 J2/QVB128/L 32217/Q JM 714249/210/Q	VKS 6245 -	
120-13 (II-Serie), 120-14 (II-Serie)	• •	Iveco 5850	-	• •	VKHB 2003 VKHB 2198	32312 J2/Q 30311 J2/Q	VKS 6220 -	
	○ ○	Iveco 4528/2	-	• •	- VKHB 2080	- 32217 J2/Q	VKS 6210 VKS 6211	
120-17 ANW	• •		-	• •	VKHB 2204 VKHB 2168	30216 J2/Q 30215 J2/Q	VKS 6361 -	
	○ ○		-	• •	VKHB 2248 VKHB 2215	30218 J2 30221 J2	VKS 6362 VKS 6336	
120E15, 120E15H, 120E18, 120E18H, 120 E23 Eurocargo	• •	Iveco 5842, Iveco 5851	-	• •	- -	- -	VKS 6248 -	
	○ ○	Rockwell, H125-P130	VKBA 5350	• •	VKHB 2211 VKHB 2137	R 32217 J2/QVB128/L 32217/Q JM 714249/210/Q	VKS 6330 -	
130-13 A, 130-13 AH, 130-16 A, 130-16 AH	• •	Iveco VA 43	-	• •	VKHB 2019 VKHB 2020	32211 J2/Q 32208 J2/Q	VKS 6239 -	
	○ ○		-	• •	VKHB 2204 VKHB 2033	30216 J2/Q 32215 J2/Q	VKS 6204 -	

									
130-M7 FAL CKD	• •	○ ○	Iveco 5918, (AVA 36)  Iveco 7899, (HA 72)	-  -	•  •	VKHB 2200 VKHB 2169  VKHB 2200 VKHB 2169	CK-47487/SK-47420/Q 32017 X/Q  CK-47487/SK-47420/Q 32017 X/Q	VKS 6217 -  VKS 6217 -	
130E15, 130E18, 130E23 Eurocargo	• •	○ ○	Iveco 5842, Iveco 5851  Rockwell, H125-P130	-  VKBA 5350	•  •	-  VKHB 2211 VKHB 2137	-  R 32217 J2/QVB128/L 32217/Q JM 714249/210/Q	VKS 6248 -  VKS 6330 -	
135-14 H, 135-14 (H) CKD, 135-14 H CKD, 135-17 (H), 135-17 T, 135-17 H, 135-17 (HO CKD), 135-17 H CKD	• •	○ ○	Iveco 5844 M  Rockwell, H 140 E	-  VKBA 5180	•  •	VKHB 2173 VKHB 2061  VKHB 2211 VKHB 2137	33212/Q 33211/Q  R 32217 J2/QVB128/L 32217/Q JM 714249/210/Q	VKS 6221 -  VKS 6210 VKS 6211	34)  34)
135-17 (I-Serie), 135-17 (II-Serie), A 135-17 (II-Serie)	• •	○ ○	Iveco 5844 M  Rockwell, H 140 E	-  VKBA 5180	•  •	VKHB 2173 VKHB 2061  VKHB 2211 VKHB 2137	33212/Q 33211/Q  R 32217 J2/QVB128/L 32217/Q JM 714249/210/Q	VKS 6221 -  VKS 6210 VKS 6211	
135E18 (4x4), 135E23 (4x4) Eurocargo	• •	○ ○		VKBA 5404  VKBA 5399	•  •	VKHB 2082 VKHB 2160  VKHB 2248 VKHB 2215	33019/Q 32021 X/Q  30218 J2 30221 J2	VKS 6335 -  VKS 6336 -	
140-14 (II-Serie), 140-20 (II-Serie)	• •	○ ○	Iveco 5850  Iveco 4542	-  -	•  •	VKHB 2003 VKHB 2198  VKHB 2031 VKHB 2080	32312 J2/Q 30311 J2/Q  32219 J2 32217 J2/Q	VKS 6220 -  VKS 6212 VKS 6223	
145-17 (II-Serie)	• •	○ ○	Iveco 5844 M  Rockwell, S 180 E	-  -	•  •	VKHB 2173 VKHB 2061  VKHB 2210 VKHB 2211	33212/Q 33211/Q  32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6221 -  VKS 6213 VKS 6223	
150-14 (II-Serie), 150-16 A (II-Serie), 150-17 (I-Serie), 150-17 (II-Serie)	• •	○ ○	Iveco 5850  Iveco 4542	-  -	•  •	VKHB 2003 VKHB 2198  VKHB 2031 VKHB 2080	32312 J2/Q 30311 J2/Q  32219 J2 32217 J2/Q	VKS 6220 -  VKS 6212 VKS 6223	
150E15, 150E18, 150E23, 150E27 Eurocargo	• •	○ ○	Iveco 5842, Iveco 5851  Rockwell, R130-S180	-  VKBA 5326	•  •	-  VKHB 2210 VKHB 2211	-  32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6248 -  VKS 6324 -	
150E15 H, 150E18 H, 150E21 H, 150E23 H Eurocargo	• •	○ ○		VKBA 5343  VKBA 5399	•  •	VKHB 2251 VKHB 2252  VKHB 2248 VKHB 2215	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276 30218 J2 30221 J2	VKS 6326 -  VKS 6336 -	
159-17 (I-Serie), 159-17 B (II-Serie), 159-20 (I-Serie)	• •	○ ○	Iveco 5860  Iveco 4542	VKBA 5188  -	•  •	VKHB 2013 VKHB 2303  VKHB 2031 VKHB 2080	6386/K-6320/Q 32310 TN9  32219 J2 32217 J2/Q	VKS 6215 -  VKS 6212 VKS 6223	














160-16 A (II-Serie)	• •	○ ○	Iveco 5860	VKBA 5188	• •	VKHB 2013 VKHB 2303	6386/K-6320/Q 32310 TN9	VKS 6215 -	
			Iveco 4542	-	• •	VKHB 2031 VKHB 2080	32219 J2 32217 J2/Q	VKS 6212 VKS 6223	
160-17-AN-ANW	• • • •	○ ○		-	• •	VKHB 2082 VKHB 2697	33019/Q 30217 J2/Q	VKS 6214 -	89)
				-	• •	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6360 -	90)
				-	• •	VKHB 2248 VKHB 2215	30218 J2 30221 J2	VKS 6362 VKS 6336	
160-23 AH	• •	○ ○	Iveco 5875	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	
			Iveco 4590	VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225	
160-23 ANW (4x4), 160-23 AHW (4x4)	• •	○ ○	Iveco 5965, Iveco 5975	VKBA 5190	• •	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6214 -	
			Iveco 4590	VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225	
160-26	• •	○ ○	Iveco 5865	VKBA 5188	• •	VKHB 2013 VKHB 2303	6386/K-6320/Q 32310 TN9	VKS 6215 -	
			Iveco 4560	-	• •	VKHB 2212 VKHB 2213	32221 J2 6581 X/6535	VKS 6224 VKS 6222	
160-30 AHW	• •	○ ○	Iveco 5965, Iveco 5975	VKBA 5190	• •	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6214 -	
			Iveco 4590	VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225	
165-24 (II-Serie)	• •	○ ○	Iveco 5860	VKBA 5188	• •	VKHB 2013 VKHB 2303	6386/K-6320/Q 32310 TN9	VKS 6215 -	
			Iveco 4542	-	• •	VKHB 2031 VKHB 2080	32219 J2 32217 J2/Q	VKS 6212 VKS 6223	
170E15, 170E18, 170E23, 170E27 Eurocargo	• •	○ ○		VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -	
				VKBA 5326	• •	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6324 -	
170-23AH-AHW	• • • •	○ ○		-	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	90)
				-	• •	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6214 -	89)
				-	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6225 VKS 6363	

									
170-25AH-AHW	• •		-	•	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	90)	
	• •		-	•	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6214 -	89)	
		○ ○	-	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6225 VKS 6363		
170-34AH-AHW	• •		-	•	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	90)	
	• •		-	•	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6214 -	89)	
		○ ○	-	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6225 VKS 6363		
170/190-20, 170/190-26, 170/190-35	• •		Iveco 5865	VKBA 5188	• •	VKHB 2013 VKHB 2303	6386/K-6320/Q 32310 TN9	VKS 6215 -	
		○ ○	Iveco 4590	VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225	
175-17	• •		-	•	VKHB 2013 VKHB 2070	6386/K-6320/Q 32310 J2/Q	VKS 6215 -		
		○ ○	-	•	VKHB 2210 VKHB 2211	32219 J2/VB 129 R 32217 J2/QVB128/L 32217/Q	VKS 6225 VKS 6213		
175-24	• •		-	•	VKHB 2013 VKHB 2070	6386/K-6320/Q 32310 J2/Q	VKS 6215 -		
		○ ○	-	•	VKHB 2210 VKHB 2211	32219 J2/VB 129 R 32217 J2/QVB128/L 32217/Q	VKS 6223 VKS 6213		
		○ ○	-	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6225 VKS 6363		
180E21 Eurocargo	• •		Iveco 5833	VKBA 5278	• •	VKHB 2249 VKHB 2250	R 33209/QCLNVB323/ L 33209/QCLNVQ276 JXC 25370CA/JXC 25370DA	VKS 6316 -	
		○ ○	Iveco 4521	VKBA 5349	• •	VKHB 2253 VKHB 2253	JXC 25716 C/JXC 25716 D JXC 25716 C/JXC 25716 D	VKS 6326 -	
180E24, 180E27, 180E30, 180E34 "MP", 180E34 "MT" Eurotech	• •			VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -	
		○ ○		VKBA 5326	• •	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6324 -	
180E25 (4x4) Eurotrakker	• •			VKBA 5398	• •	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6335 -	
		○ ○		VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	
180E27	• •		-	•	VKHB 2251 VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326 -		
		○ ○	-	•	VKHB 2210 VKHB 2211	32219 J2/VB 129 R 32217 J2/QVB128/L 32217/Q	VKS 6324		

# FIAT-IVECO



180E38 Eurostar	• •	○ ○		VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -	
				VKBA 5326	• •	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6324 -	
180E38 Eurotech	• •	○ ○ ○ ○		VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 - -	48)
				-	• •	- -	- -	- -	
				VKBA 5326	• •	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6324 -	51)
180E42 Eurotech	• •	○ ○		VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -	
				VKBA 5326	• •	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6324 -	
190-24 Turbotech	• •	○ ○		VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	
				VKBA 5192	• •	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	
190-24 T.R.U. (-06/88), 190-30 T.R.U. (-01/85), 190-30 G.V. (-06/88), 190-36 T-Range UNIF (-04/87), 190-38 (-01/85), 190-38 T.R.U. (-01/85)	• •	○ ○	Iveco 5875  Rockwell, U 180 E	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	
				VKBA 5192	• •	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	
190-24, 190-26 Turbotech, 190-30, 190-32 Turbotech, 190-36/38 Turbotech, 190-32 Turbotech G.V., 190-36 Turbotech G.V., 190-36/38 Turbostar, 190-42/48 Turbostar	• •	○ ○	Iveco 5875  Rockwell, "U" Series	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	
				VKBA 5192	• •	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	
190-25 ANW (4x4)	• •	○ ○	Iveco 5965, Iveco 5975  Iveco 4590	VKBA 5190	• •	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6214 -	
				VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225	
190-25 AN, 190-25 ANT, 190-25 AN CKD, 190-25 AN (TAM), 190-26 H CKD, 190-26 H, 190-26 HT, 190-26 N (C.B.5), 190-26 NT (C.B.5), 190-26 N CKD, 190-25 AHT	• •	○ ○	Iveco 5875  Iveco 4590	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	
				VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225	
190-25 (256 M19), 190-29 (290 M19), 190-32 (320 M19), 190-36 (360 M19)	• •	○ ○	Iveco 5875  Iveco 4590	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	
				VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225	

									
190-26 HW (4x4), 190-30 HW	• •	○ ○	Iveco 5965, Iveco 5975	VKBA 5190	• •	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6214 -	
		○ ○	Iveco 4590	VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225	
190-26 Turbotech	• •	○ ○	Iveco 4590	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	
		○ ○	Rockwell, "U" Series	VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225	
		○ ○	Rockwell, "U" Series	VKBA 5192	• •	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	
190-30 H CKD	• •	○ ○	Iveco 5830	VKBA 5171	• •	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -	
		○ ○	Iveco 4519	-	• •	VKHB 2214 VKHB 2214	33113/Q 33113/Q	VKS 6221 -	
190-30 N, 190-30 NT	• •	○ ○	Iveco 5875	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	
		○ ○	Iveco 4590	VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225	
190-30 PT GR. VOL., 190-30 T T/Range, 190-30 T EKO (T-UN), 190-30 P T/Range, 190-30 PT T/Range, 190-30 PT GR. VOL.T	• •	○ ○	Iveco 5875	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	
		○ ○	Rockwell, U 180 E	VKBA 5192	• •	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	
190E31 (4x2), 190E42 (4x2) Eurotrakker	• •	○ ○		VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -	
		○ ○		VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	
190E31 (4x4), 190E42 (4x4) Eurotrakker	• •	○ ○		VKBA 5398	• •	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6335 -	
		○ ○		VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	
190-32 P GR. VOL., 190-32 PT GR. VOL.	• •	○ ○	Iveco 5875	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	
		○ ○	Rockwell, U 180 E	VKBA 5192	• •	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	
190-35	• •	○ ○	Iveco 5865	VKBA 5188	• •	VKHB 2013 VKHB 2303	6386/K-6320/Q 32310 TN9	VKS 6215 -	
		○ ○	Iveco 4560	-	• •	VKHB 2212 VKHB 2213	32221 J2 6581 X/6535	VKS 6224 VKS 6222	
190-36 T T/Star, 190-36 P T/Star, 190-36 T T/Range, 190-38 (T-UN), 190-38 T (T-UN)	• •	○ ○	Iveco 5875	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	
		○ ○	Rockwell, U 180 E	VKBA 5192	• •	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	

# FIAT-IVECO



190-36 T/Range, 190-36 PT T/Star, 190-36 P T/Range, 190-36 PT T/Range, 190-36 T/Star,	•	○	Iveco 5875	VKBA 5174	•	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	
	•		Rockwell, U 180 E	VKBA 5192	•	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	
190-42, 190-42 T, 190-42 P H	•	○	Iveco 5875	VKBA 5174	•	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -	
	•		Rockwell, U 180 E	VKBA 5192	•	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	
190E24, 190E27, 190E30 Eurotech	•	○		VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•			VKBA 5192	•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
	•			VKBA 5348	•	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	58)
190E24, 190E31 Eurotech/Cursor	•	○		VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•		Meritor U 177 E	VKBA 5397	•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276 BTH-0025	- - -	
190E30 "MP" Eurotech	•	○		VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•			VKBA 5347	•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
190E30 "MT", 190E34 Eurotech	•	○		VKBA 5343	•	VKHB 2297 VKHB 2031	32220 J2 32219 J2	VKS 6331 -	
	•			VKBA 5192	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
190E30, 190E34 Eurotrækker	•	○		VKBA 5343	•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
	•			VKBA 5344	•	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	58)
190E30, 190E34 Eurotrækker	•	○		VKBA 5343	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	
	•			VKBA 5344	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
190E35 Eurotech/Cursor	•	○		VKBA 5343	•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
	•		Meritor U 177 E	VKBA 5397	•	-	BTH-0025	-	46)
	•			VKBA 5344	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	47)



190E37 Eurotrakker	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•					VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○		VKBA 5344	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322	40)
		○		VKBA 5351	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322	41)
		○						-	
190E38 Eurostar	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•					VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○		VKBA 5347	•	VKHB 2297 VKHB 2031	32220 J2 32219 J2	VKS 6331	48)
		○		VKBA 5192	•	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	49)
	○		VKBA 5348	•	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6322	50)	
	○						-		
190E38 Eurotech	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•					VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○		-	•	-	-	-	
		○			•	-	-	-	
190E42 Eurotech	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•					VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○		VKBA 5192	•	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	58)
	○		VKBA 5348	•	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6322	59)	
	○						-		
190E42, 190E47, 190E52 Eurostar	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•					VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○		VKBA 5192	•	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	49)
	○		VKBA 5348	•	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6322	50)	
	○						-		
220-30 PT (6x2)(T-UN), 220-36 P (6x2) T/Range, 220-36 PT (6x2) T/Range	•		Iveco 5875	VKBA 5174	•	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216	
	•							-	
		○	Rockwell, U 180 E	VKBA 5192	•	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	
		○							
220-30 T.R.U. (-01/85), 220-36 (-04/87), 220-38 T.R.U. (-01/85) -	•		Iveco 5875	VKBA 5174	•	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216	
	•							-	
		○	Rockwell, U 180 E	VKBA 5192	•	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	
		○							



220-32 AHT	• •	○	Iveco 5875	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -
			Iveco 4590	VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225
220-32 Turbotech, 220-36/38 Turbotech G.V.	• •	○ ○ ○ ○	Iveco 5875	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -
			Rockwell, "U" Series	VKBA 5192	• •	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225
			Trailing axle	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -
220-36 (360 M22), 220-38	• •	○ ○	Iveco 5875	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -
			Iveco 4590	VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225
230-35 WM (6x6)	• • • •	○ ○	Iveco 5965	VKBA 5190	• •	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6214 -
			Iveco 5975	VKBA 5190	• •	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6214 -
			Iveco 4590	VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225
240-26 Turbotech, 240-36/38 Turbotech, 240-32 Turbotech G.V., 240-36 Turbotech G.V., 240-48 Turbostar	• •	○ ○ ○ ○	Iveco 5875	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -
			Rockwell, "U" Series	VKBA 5192	• •	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225
			Trailing axle	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -
240-26 T.R.U. (-06/88), 240-30 (-01/85), 240-30 T.R.U. (01/85), 240-36 (-04/87), 240-36 T.S. (-06/88)	• •	○ ○	Iveco 5875	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -
			Rockwell, U 180 E	VKBA 5192	• •	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225
240-26, 240-30 P (6x2) (T-UN), 240-36, 240-36 T/Star, 240-36 P (6x2) T/Range, 240-42 T/Star	• •	○ ○	Iveco 5875	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -
			Rockwell, U 180 E	VKBA 5192	• •	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225
240-30, 240-38	• •	○ ○	Iveco 5875	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -
			Iveco 4590	VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225
240E30 Eurotech	• •	○ ○ ○ ○		VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -
				VKBA 5347	• •	VKHB 2297 VKHB 2031	32220 J2 32219 J2	VKS 6331 -
			Trailing axle	VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -



240E34 Eurotech	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•					VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○		VKBA 5326	•	VKHB 2210	32219 J2/VB129	VKS 6324	
		○	Trailing axle	VKBA 5343	•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	-	
240E38 Eurostar		○		VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•					VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○		VKBA 5347	•	VKHB 2297	32220 J2	VKS 6331	48)
		○	Trailing axle	VKBA 5326	•	VKHB 2031	32219 J2	-	
240E42, 240E47, 240E52 Eurostar		○		VKBA 5326	•	VKHB 2210	32219 J2/VB129	VKS 6324	52)
	•					VKHB 2211	R 32217 J2/QVB128/L 32217/Q	-	
		○		VKBA 5192	•	VKHB 2212	32221 J2	VKS 6218	53)
		○	Trailing axle	VKBA 5348	•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	VKS 6225	54)
260-25 AH (6x4), 260-30 AH (6x6), 260-32 AH Army, 260-35 HM (6x4), 260-35 HM (6x6)		○	Iveco 5875	VKBA 5174	•	VKHB 2203	JH 415647/JH 415610	VKS 6216	
	•					VKHB 2002	32311 J2	-	
		○	Iveco 4590	VKBA 5189	•	VKHB 2215	30221 J2	VKS 6218	
		○				VKHB 2216	32024 X	VKS 6225	
260-25 AHW (6x6), 260-26 NW (6x6), 260-35 HWM (6x6), 260-35 WM (6x6)		○	Iveco 5965	VKBA 5190	•	VKHB 2082	33019/Q	VKS 6214	
	•					VKHB 2160	32021 X/Q	-	
		○	Iveco 5975	VKBA 5190	•	VKHB 2082	33019/Q	VKS 6214	
	•					VKHB 2160	32021 X/Q	-	
		○	Iveco 4590	VKBA 5189	•	VKHB 2215	30221 J2	VKS 6218	
		○				VKHB 2216	32024 X	VKS 6225	



# FIAT-IVECO



260-32 Turbotech, 260-36/38 Turbotech, 260-36/38 Turbostar, 260-48 Turbostar	•	Iveco 5875	VKBA 5174	•	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -		
	•		Rockwell, "U" Series	VKBA 5192	•	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	
	○		Rockwell, R130-S180	VKBA 5282	•	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6213 -	
	○		Calabrese	VKBA 5283	•	VKHB 2178 VKHB 2051	33118 TN9/QVT621 33213/Q	VKS 6246 -	
260-36 T/Star, 260-36 T T/Star, 260-42 T/Star, 260-42 T T/Star	•	Iveco 5875	VKBA 5174	•	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -		
	•		Rockwell, U 180 E	VKBA 5192	•	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6218 VKS 6225	
260E23 Eurocargo	•	Iveco 5842, Iveco 5851	-	•	-	-	VKS 6248 -		
	•		Rockwell, H125-P130	VKBA 5281	•	VKHB 2211 VKHB 2137	R 32217 J2/QVB128/L 32217/Q JM 714249/210/Q	VKS 6245 -	
260E24 (6x2), 260E31 (6x2), 260 E35 (6x2) Eurotech/Cursor	•	Meritor U 177 E	VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326		
	•		VKBA 5397	•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276 BTH-0025	- - -		
	○		Trailing axle	VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	88)
	○				•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
	○		Trailing axle	VKBA 5326	•	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6324 -	87)
	○				•				
260E30 (6x4), 260E34 (6x4) Eurotrakker	•	Forward rear	VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326		
	•		VKBA 5344	•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-		
	○			VKBA 5344	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	
	○		Rear rear	VKBA 5344	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322	42)
	○				•			-	
	○		Rear rear	VKBA 5353	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	43)
260E31 (6x4), 260E35 (6x4) Eurotrakker/Cursor	•	Forward rear	VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326		
	•		VKBA 5344	•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-		
	○			VKBA 5344	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	
	○		Rear rear	VKBA 5344	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	












260E37 (6x4) Eurotrakker	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○	Forward rear	VKBA 5344	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322	40)
		○	Forward rear	VKBA 5351	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322	41)
		○	Rear rear	VKBA 5344	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322	44)
		○	Rear rear	VKBA 5353	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322	45)
		○	Rear rear	VKBA 5351	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322	41)
260E38, 260E42 Eurotech	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○		VKBA 5326	•	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6324	
260E42, 260E47, 260E52 Eurostar	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○		VKBA 5326	•	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6324	
260E42 (6x4) Eurotrakker	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○	Forward rear	VKBA 5344	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322	
	○	Rear rear	VKBA 5344	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322		
260E42 (6x6) Eurotrakker	•			VKBA 5398	•	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6335	
	•				•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322	
		○	Forward rear	VKBA 5344	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322	
	○	Rear rear	VKBA 5344	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322		
260E47 (6x4) Eurotrakker	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○	Forward rear	VKBA 5344	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322	
	○	Rear rear	VKBA 5344	•	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322		

# FIAT-IVECO












280E23 Eurocargo	• •	• •	Iveco 5842, Iveco 5851	-	• •	- -	- -	VKS 6248 -
		• •	Rockwell, R130-S180	VKBA 5326	• •	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6324 -
300-30 AH (8x4)	• •	• •	Iveco 5875	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -
		• •	Iveco 4590	VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225
320 D 26 AK CKD	• •	• •	Iveco 5830	-	• •	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6221 -
		• •	Iveco 4519	-	• •	VKHB 2214 VKHB 2214	33113/Q 33113/Q	VKS 6221 -
320-45 HWM T (6x6),	• •	• •	Iveco 5965, Iveco 5975	VKBA 5190	• •	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6214 -
		• •	Iveco 4590	VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225
320E27 Eurocargo	• •	• •	Iveco 5842, Iveco 5851	-	• •	- -	- -	VKS 6248 -
		• •	Rockwell, R130-S180	VKBA 5326	• •	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6324 -
325E27 Eurotech	• •	• •		VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -
		• •		VKBA 5326	• •	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6324 -
330-25 AN (TAM), 330-26 H (6x4), 330-26 HT (6x4), 330-30 H (6x4), 330-30 HT (6x4), 330-30 H CKD, 330-30 HT (6x4) CKD, 330-30 H (6x4) CKD, 330-30 N, 330-35 H (6x4), 330-35 H (6x4) CKD, 330-35 HT (6x4)	• •	• •	Iveco 5875	VKBA 5174	• •	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6216 -
		• •	Iveco 4590	VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225
330-26 HW (6x6), 330-26 HWT (6x6), 330-30 HW (6x6), 330-30 NW (6x6), 330-30 ANW (6x6), 330-32 ANW (6x6), 330-35 HW (6x6), 330-35 HW (6x6) CKD	• •	• •	Iveco 5965, Iveco 5975	VKBA 5190	• •	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6214 -
		• •	Iveco 4590	VKBA 5189	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6218 VKS 6225
330E34 (6x4), 330E37 (6x4) Eurotrakker	• •	• •		VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -
		• •		VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -

									
340E34 (8x4), 340E37 (8x4), 340E42 (8x4) Eurotrakker	• • • •		Forward front	VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
			Rear front	VKBA 5343	•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
			Forward rear	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	
					•	VKHB 2216	32024 X	-	
			Rear rear	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	
		•	VKHB 2216	32024 X	-				
340E35 (6x4) Eurotrakker/Cursor	• •		Forward rear	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	
					•	VKHB 2216	32024 X	-	
			Rear	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	
		•	VKHB 2216	32024 X	-				
340E42 (6x6) Eurotrakker	• •		Forward rear	VKBA 5344	•	VKHB 2082	33019/Q	VKS 6335	
					•	VKHB 2160	32021 X/Q	-	
			Rear rear	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	
		•	VKHB 2216	32024 X	-				
380E31 (6x4), 380E37 (6x4), 380E42 (6x4), 380E47 (6x4) Eurotrakker	• •		Forward rear	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	
					•	VKHB 2216	32024 X	-	
			Rear rear	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	
		•	VKHB 2216	32024 X	-				
380E31 (6x6), 380E37 (6x6), 380E42 (6x6) Eurotrakker	• •		Forward rear	VKBA 5344	•	VKHB 2082	33019/Q	VKS 6335	
					•	VKHB 2160	32021 X/Q	-	
			Rear rear	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	
		•	VKHB 2216	32024 X	-				
380E34 (6x4), 380E42 (6x4) Eurotrakker	• •		Forward rear	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	
					•	VKHB 2216	32024 X	-	
380E35 (6x4) Eurotrakker/Cursor	• •		Forward rear	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	
					•	VKHB 2216	32024 X	-	
			Rear	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	
		•	VKHB 2216	32024 X	-				



400E30, 400E34 "MP" 400E34 "MT" Eurotech	•		VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○	VKBA 5326	•	VKHB 2210	32219 J2/VB129	VKS 6324	
		○		•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	-	
400E31 (4x2), 400E34 (4x2), 400E37 (4x2), 400E42 (4x2) Eurotrakker	•		VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	
		○		•	VKHB 2216	32024 X	-	
400E31 (4x4), 400E37 (4x4) Eurotrakker	•		VKBA 5398	•	VKHB 2082	33019/Q	VKS 6335	
	•				VKHB 2160	32021 X/Q	-	
		○	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	
		○		•	VKHB 2216	32024 X	-	
400E34 Eurotrakker	•		VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	
		○		•	VKHB 2216	32024 X	-	
400E38 Eurostar	•		VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○	VKBA 5326	•	VKHB 2210	32219 J2/VB129	VKS 6324	52)
		○		•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	-	
		○	VKBA 5347	•	VKHB 2297	32220 J2	VKS 6331	57)
		○		•	VKHB 2031	32219 J2	-	
400E38 Eurotech	•		VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○	-	•	-	-	-	48)
		○		•	-	-	-	
		○	VKBA 5326	•	VKHB 2210	32219 J2/VB129	VKS 6324	51)
		○		•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	-	
400E42 Eurotech	•		VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○	VKBA 5326	•	VKHB 2210	32219 J2/VB129	VKS 6324	
		○		•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	-	
400E42, 400E52 Eurostar	•		VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○	VKBA 5326	•	VKHB 2210	32219 J2/VB129	VKS 6324	
		○		•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	-	
40-10 W S, 40-10 W (4x4), 40-10 W V, 40-10 W C, 40-10 W D	•	Iveco 5912	-	•	VKHB 2060	32011 X/Q	VKS 6163	
	•			+	VKHB 2060	32011 X/Q	VKS 6163	
		Iveco 4512	-	•	VKHB 2059	33111/Q	VKS 6221	
				•	VKHB 2060	32011 X/Q	-	

									
40-10 WM (4x4)	• •		Iveco 5913	-	• •	VKHB 2199 VKHB 2199	32013 X/Q 32013 X/Q	- -	
		○ ○	Iveco 4512	-	• •	VKHB 2059 VKHB 2060	33111/Q 32011 X/Q	VKS 6221 -	
410E35 (6x4) Eurotrakker/Cursor	• •			VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -	
		○ ○	Forward rear	VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	
		○ ○	Rear rear	VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	
410E37 (8x4), 410E42 (8x4) Eurotrakker	• • • •		Forward front	VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -	
			Rear front	VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -	
		○ ○	Forward rear	VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	
		○ ○	Rear rear	VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	
410E42 (6x6) Eurotrakker	• •			VKBA 5398	• •	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6335 -	
		○ ○	Forward rear	VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	
		○ ○	Rear rear	VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	
440E31, 440E35 Eurotech/Cursor	• •			VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -	
		○ ○	Meritor U 177 E	VKBA 5397	• •	- -	BTH-0025 -	- -	
440E34 Eurotech	• •			VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -	
		○ ○		VKBA 5192	• •	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/OVB128/L 32217/Q	VKS 6218 VKS 6225	58)
		○ ○		VKBA 5348	• •	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/OVB128/L 32217/Q	VKS 6322 -	59)
440E34 (6x4), 440E42 (6x4) Eurotrakker	• •			VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -	
		○ ○	Forward rear	VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	
		○ ○	Rear rear	VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -	



440E37 (6x4) Eurotrakker	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○	Forward rear	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	
		○			•	VKHB 2216	32024 X	-	
	○	Rear rear	VKBA 5353	•	VKHB 2215	30221 J2	VKS 6322	46)	
	○			•	VKHB 2216	32024 X	-		
	○	Rear rear	VKBA 5344	•	VKHB 2215	30221 J2	VKS 6322	47)	
	○			•	VKHB 2216	32024 X	-		
440E38 Eurostar	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○		VKBA 5347	•	VKHB 2297	32220 J2	VKS 6331	48)
		○			•	VKHB 2031	32219 J2	-	
	○		VKBA 5192	•	VKHB 2212	32221 J2	VKS 6218	49)	
	○			•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	VKS 6225		
	○		VKBA 5348	•	VKHB 2212	32221 J2	VKS 6322	50)	
	○			•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	-		
440E39, 440E43 Eurotech/Cursor	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○	Meritor U 177 E	VKBA 5397	•	-	BTH-0025	-	
		○			•	-	-	-	
440E42 (4x2) Eurotech	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○		VKBA 5192	•	VKHB 2212	32221 J2	VKS 6218	58)
		○			•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	VKS 6225	
	○		VKBA 5348	•	VKHB 2212	32221 J2	VKS 6322	59)	
	○			•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	-		
440E42 (4x2), 440E47 (4x2), 440E52 (4x2) Eurostar	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○		VKBA 5192	•	VKHB 2212	32221 J2	VKS 6218	58)
		○			•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	VKS 6225	
	○		VKBA 5348	•	VKHB 2212	32221 J2	VKS 6322	59)	
	○			•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	-		
440E42 (6x2) Eurotech	•			VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326	
	•				•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-	
		○		VKBA 5326	•	VKHB 2210	32219 J2/VB129	VKS 6324	48)
		○			•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	-	
		○		VKBA 5192	•	VKHB 2212	32221 J2	VKS 6218	49)
		○			•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	VKS 6225	
	○		VKBA 5348	•	VKHB 2212	32221 J2	VKS 6322	50)	
	○			•	VKHB 2211	R 32217 J2/QVB128/L 32217/Q	-		
	○	Trailing axle	VKBA 5343	•	VKHB 2251	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN	VKS 6326		
	○			•	VKHB 2252	L 33114/QCLNVQ276/ R 33114/QCLNVQ276	-		












440E42 (6x4) Eurotech	• •	○ ○	VKBA 5343  VKBA 5326	•  • •	VKHB 2251 VKHB 2252 VKHB 2210 VKHB 2211	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276 32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6326 - VKS 6324 -	
440E42 (6x4), 440E52 (6x4) Eurostar	• •	○ ○	VKBA 5343  VKBA 5326	•  • •	VKHB 2251 VKHB 2252 VKHB 2210 VKHB 2211	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276 32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6326 - VKS 6324 -	
50-9	• •	○ ○ ○ ○	Iveco 5822  Iveco 4516 HD  Iveco 4419	VKBA 5171  -  -  • •	VKHB 2201 VKHB 2202  VKHB 2154 VKHB 2154  VKHB 2214 VKHB 2214	30309 J2/Q 30307 J2/Q  32014 X/Q 32014 X/Q  33113/Q 33113/Q	VKS 6227 - VKS 6221 - VKS 6221 -	28)  29)  30)
50-9 Zeta, 50-10 Zeta	• •	○ ○	VKBA 5171  -	•  • •	VKHB 2201 VKHB 2202  VKHB 2154 VKHB 2154	30309 J2/Q 30307 J2/Q  32014 X/Q 32014 X/Q	VKS 6227 - VKS 6221 -	
55-8 (I-Serie), 55-9 (I-Serie), 55-10 (I-Serie), A 55-10 (I-II-Serie)	• •	○ ○	Iveco 5822 Iveco 5830  Iveco 4516	VKBA 5171  -  • •	VKHB 2201 VKHB 2202  VKHB 2214 VKHB 2214	30309 J2/Q 30307 J2/Q  33113/Q 33113/Q	VKS 6227 - VKS 6221 -	
60-11 Turbozeta	• •	○ ○	VKBA 5171  -	•  • •	VKHB 2201 VKHB 2202  VKHB 2154 VKHB 2154	30309 J2/Q 30307 J2/Q  32014 X/Q 32014 X/Q	VKS 6227 - VKS 6221 -	
60-8 (III-Serie), 60-10 (I-II-Serie), A 60-10 (I-II-Serie)	• •	○ ○	Iveco 5822, Iveco 5830  Iveco 4516	VKBA 5171  -  • •	VKHB 2201 VKHB 2202  VKHB 2214 VKHB 2214	30309 J2/Q 30307 J2/Q  33113/Q 33113/Q	VKS 6227 - VKS 6221 -	
60E10, 60E12, 60E14, Eurocargo	• •	○ ○	Iveco 5827  Iveco 4517	VKBA 5277  VKBA 5274	VKHB 2250 VKHB 2250  VKHB 2209 VKHB 2209	JXC 25370CA/JXC 25370DA JXC 25370CA/JXC 25370DA  RBT1B 329138/QVQ276/ 34478/2/QVQ276 RBT1B 329138/QVQ276/ 34478/2/QVQ276	VKS 6316 - VKS 6326 -	
619 T 1P, 619 N 1P CKD	• •	○ ○	Iveco 5875  Iveco 4560	VKBA 5174  -	VKHB 2203 VKHB 2002  VKHB 2212 VKHB 2213	JH 415647/JH 415610 32311 J2  32221 J2 6581 X/6535	VKS 6216 - VKS 6201 -	
65-9, 65-9 Export CKD, 65-12, 65-12 H, 65-12 V, 65-12 D	• •	○ ○	Iveco 5830  Iveco 4519	VKBA 5171  -	VKHB 2201 VKHB 2202  VKHB 2214 VKHB 2214	30309 J2/Q 30307 J2/Q  33113/Q 33113/Q	VKS 6227 - VKS 6221 -	



# FIAT-IVECO



65E10, 65E12, 65E12H 65E14 Eurocargo	• •	○ ○	Iveco 5827	VKBA 5277	• •	VKHB 2250 VKHB 2250	JXC 25370CA/JXC 25370DA JXC 25370CA/JXC 25370DA	VKS 6316 -
			Iveco 4517	VKBA 5274	• •	VKHB 2209 VKHB 2209	RBT1B 329138/QVQ276/ 34478/2/QVQ276 RBT1B 329138/QVQ276/ 34478/2/QVQ276	VKS 6326 -
70-10 (I-Serie), A 70-12 (II-Serie), A 70-14	• •	○ ○	Iveco 5830	VKBA 5171	• •	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -
			Iveco 4519	-	• •	VKHB 2214 VKHB 2214	33113/Q 33113/Q	VKS 6221 -
70-14 Zeta	• •	○ ○		VKBA 5171	• •	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -
				-	• •	VKHB 2214 VKHB 2214	33113/Q 33113/Q	VKS 6221 -
720E31 (6x4), 720E37 (6x4), 720E42 (6x4), 720E47 (6x4) Eurotrakker	• •	○ ○ ○ ○		VKBA 5343	• •	VKHB 2251 VKHB 2252	RT2ED 070/QCLNVB061/ LT2ED 070/QCLN L 33114/QCLNVQ276/ R 33114/QCLNVQ276	VKS 6326 -
			Forward rear	VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -
			Rear rear	VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -
720E31 (6x6), 720E37 (6x6), 720E42 (6x6) Eurotrakker	• •	○ ○ ○ ○		VKBA 5398	• •	VKHB 2082 VKHB 2160	33019/Q 32021 X/Q	VKS 6335 -
			Forward rear	VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -
			Rear rear	VKBA 5344	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 -
75-13 AW, 75-16 AW	• •	○ ○	Iveco 5918, (AVA 36)	-	• •	VKHB 2200 VKHB 2169	CK-47487/SK-47420/Q 32017 X/Q	VKS 6217 -
			Iveco 7899, (HA 72)	-	• •	VKHB 2200 VKHB 2169	CK-47487/SK-47420/Q 32017 X/Q	VKS 6217 -
75-13 WM (4x4), 75-14 WM	• •	○ ○	Iveco 5918, (AVA 36)	-	• •	VKHB 2200 VKHB 2169	CK-47487/SK-47420/Q 32017 X/Q	VKS 6217 -
			Iveco 4518	-	• •	VKHB 2200 VKHB 2169	CK-47487/SK-47420/Q 32017 X/Q	VKS 6217 -
75E12, 75E14, 75E15 Eurocargo	• • • •	○ ○ ○ ○ ○	Iveco 5827	VKBA 5277	• •	VKHB 2250 VKHB 2250	JXC 25370CA/JXC 25370DA JXC 25370CA/JXC 25370DA	VKS 6316 -
			Iveco 5833	VKBA 5278	• •	VKHB 2249 VKHB 2250	R 33209/QCLNVB323/ L 33209/QCLNVQ276 JXC 25370CA/JXC 25370DA	VKS 6316 -
			Iveco 4517	VKBA 5274	• •	VKHB 2209 VKHB 2209	RBT1B 329138/QVQ276/34478/2/ QVQ276 RBT1B 329138/QVQ276/34478/2/ QVQ276	VKS 6326 -
			Iveco 4521	VKBA 5349	• •	VKHB 2253 VKHB 2253	JXC 25716 C/JXC 25716 D JXC 25716 C/JXC 25716 D	VKS 6326 -

								
79-11, 79-12 D, 79-12 V, 79-14, 79-14 D, 79-14 V, 79-12 CKD	•		Iveco 5830	VKBA 5171	•	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -
	•	○	Iveco 4519	-	•	VKHB 2214 VKHB 2214	33113/Q 33113/Q	VKS 6221 -
79-12 Turbozeta	•			VKBA 5171	•	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -
	•	○		-	•	VKHB 2214 VKHB 2214	33113/Q 33113/Q	VKS 6221 -
80-13 AW (4x4), 80-16 AW (4x4)	•		Iveco 5918, (AVA 36)	-	•	- VKHB 2067	- 33209/Q	VKS 6217 -
	•	○	Iveco 7899, (HA 72)	-	•	VKHB 2200 VKHB 2169	CK-47487/SK-47420/Q 32017 X/Q	VKS 6217 -
80-13 A, 80-13 AH, 80-13 AT, 80-16 A	•		Iveco 5822, Iveco 5830	VKBA 5171	•	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -
	•	○	Rockwell, 125 E	-	•	VKHB 2208 VKHB 2074	567/563 3984/3920	VKS 6211 VKS 6208
80-13 (I-Serie)	•		Iveco 5822, Iveco 5830	VKBA 5171	•	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -
	•	○	Iveco 4528/OX	-	•	- -	- -	VKS 6209 VKS 6226
80-14 W, 80-17 W	•		Iveco 5918, (AVA 36)	-	•	VKHB 2200 VKHB 2169	CK-47487/SK-47420/Q 32017 X/Q	VKS 6217 -
	•	○	Iveco 4518	-	•	VKHB 2200 VKHB 2169	CK-47487/SK-47420/Q 32017 X/Q	VKS 6217 -
80E15, 80E18, 80E21, Eurocargo	•		Iveco 5833	VKBA 5278	•	VKHB 2249 VKHB 2250	R 33209/QCLNVB323/ L 33209/QCLNVQ276 JXC 25370CA/JXC 25370DA	VKS 6316 -
	•	○	Iveco 4521	VKBA 5349	•	VKHB 2253 VKHB 2253	JXC 25716 C/JXC 25716 D JXC 25716 C/JXC 25716 D	VKS 6326 -
85E15, 85E18, 85E18H Eurocargo	•			VKBA 5278	•	VKHB 2249 VKHB 2250	R 33209/QCLNVB323/ L 33209/QCLNVQ276 JXC 25370CA/JXC 25370DA	VKS 6316 -
	•	○		VKBA 5349	•	VKHB 2253 VKHB 2253	JXC 25716 C/JXC 25716 D JXC 25716 C/JXC 25716 D	VKS 6326 -
90-13 A (01/85-), 90-13 AH (01/85-), A 90-14 (III-IV-Serie)	•		Iveco 5822, Iveco 5830	VKBA 5171	•	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -
	•	○	Rockwell, 125 E	-	•	VKHB 2208 VKHB 2074	567/563 3984/3920	VKS 6211 VKS 6208
90-13 (I-II-Serie), A 90-13 (I-II-Serie)	•		Iveco 5822, Iveco 5830	VKBA 5171	•	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -
	•	○	Iveco 4528/OX	-	•	- -	- -	VKS 6209 VKS 6226
90-14 WM (4x4), 90-17 WM	•		Iveco 5918, (AVA 36)	-	•	VKHB 2200 VKHB 2169	CK-47487/SK-47420/Q 32017 X/Q	VKS 6217 -
	•	○	Iveco 4518	-	•	VKHB 2200 VKHB 2169	CK-47487/SK-47420/Q 32017 X/Q	VKS 6217 -



90-16 AW	• •	○ ○	Iveco 5918, (AVA 36)	-	• •	VKHB 2200 VKHB 2169	CK-47487/SK-47420/Q 32017 X/Q	VKS 6217 -	
			Iveco 7899, (HA 72)	-	• •	VKHB 2200 VKHB 2169	CK-47487/SK-47420/Q 32017 X/Q	VKS 6217 -	
95-14 Zeta	• •	○ ○		VKBA 5171	• •	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -	
			Rockwell, F 125 E	-	• •	VKHB 2208 VKHB 2074	567/563 3984/3920	VKS 6211 VKS 6208	
95-14 (III-IV-Serie)	• •	○ ○	Iveco 5822, Iveco 5830	VKBA 5171	• •	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -	
			Rockwell, 125 E	-	• •	VKHB 2208 VKHB 2074	567/563 3984/3920	VKS 6211 VKS 6208	
95E15 (4x4), 95E21 (4x4) Eurocargo	• •	○ ○		VKBA 5405	• •	VKHB 2082 VKHB 2170	33019/Q 32018 X/Q	VKS 6337 -	
				-	• •	VKHB 2168 VKHB 2331	30215 J2/Q 33118/Q	- -	
95E18 Eurocargo	• •	○ ○		VKBA 5278	• •	VKHB 2249 VKHB 2250	R 33209/QCLNVB323/L 33209/ QCLNVQ276 JXC 25370CA/JXC 25370DA	VKS 6316 -	
				VKBA 5349	• •	VKHB 2253 VKHB 2253	JXC 25716 C/JXC 25716 D JXC 25716 C/JXC 25716 D	VKS 6326 -	
A 135-14 (5000), A 135-14 (5000) CKD, A 135-17 (4400) CKD, A 135-17 (5000)	• •	○ ○	Iveco 5844 M	-	• •	VKHB 2173 VKHB 2061	33212/Q 33211/Q	VKS 6221 -	34)
			Rockwell, H 140 E	VKBA 5180	• •	VKHB 2211 VKHB 2137	R 32217 J2/QVB128/L 32217/Q JM 714249/210/Q	VKS 6210 VKS 6211	34)
A175-24 175-17, 175-24, 175-24 T, 175-24 Nett. URB., 175-24 CKD	• • • •	○ ○ ○ ○	Iveco 5860	VKBA 5188	• •	VKHB 2013 VKHB 2303	6386/K-6320/Q 32310 TN9	VKS 6215 -	
			Iveco 5865	VKBA 5284	• •	VKHB 2013 VKHB 2303	6386/K-6320/Q 32310 TN9	VKS 6215 -	
			Rockwell, R130-S180	VKBA 5282	• •	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6213 -	
			Rockwell, S 160 E	-	• •	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6213 VKS 6223	
Z 220, Z 220 Stripped chass., Z 220 T H	• •	○ ○	Iveco 5830	VKBA 5171	• •	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -	
			Iveco 4519	-	• •	VKHB 2214 VKHB 2214	33113/Q 33113/Q	VKS 6221 -	
Z Range: 65-10	• •	○ ○		VKBA 5171	• •	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -	
				-	• •	VKHB 2214 VKHB 2214	33113/Q 33113/Q	VKS 6221 -	
Z Range:50-8	• •	○ ○		VKBA 5171	• •	VKHB 2201 VKHB 2202	30309 J2/Q 30307 J2/Q	VKS 6227 -	
				-	• •	VKHB 2154 VKHB 2154	32014 X/Q 32014 X/Q	VKS 6221 -	



Z Range:60-10

- 
- 

- 
- 

VKBA 5171

- 
- 

VKHB 2201  
VKHB 2202

30309 J2/Q  
30307 J2/Q

VKS 6227

-

-

- 
- 

VKHB 2214  
VKHB 2214

33113/Q  
33113/Q

VKS 6221

-

Z Range:75-10

- 
- 

- 
- 

VKBA 5171

- 
- 

VKHB 2201  
VKHB 2202

30309 J2/Q  
30307 J2/Q

VKS 6227

-

-

- 
- 

VKHB 2214  
VKHB 2214

33113/Q  
33113/Q

VKS 6221

-

Z Range:79-10

- 
- 

- 
- 

VKBA 5171

- 
- 

VKHB 2201  
VKHB 2202

30309 J2/Q  
30307 J2/Q

VKS 6227

-

-

- 
- 

VKHB 2214  
VKHB 2214

33113/Q  
33113/Q

VKS 6221

-

Z Range:79-14

- 
- 

- 
- 

VKBA 5171

- 
- 

VKHB 2201  
VKHB 2202

30309 J2/Q  
30307 J2/Q

VKS 6227

-

-

- 
- 

VKHB 2214  
VKHB 2214

33113/Q  
33113/Q

VKS 6221

-





## FORD

Transit FT .....	58
CARGO .....	59

# FORD



Transit FT 60-80 (GB)	•			VKBA 523	•	-	-	-	1)
	•				•	-	-	-	
		○	34	VKBA 922	•	-	-	-	2)
		○			•	-	-	-	
Transit FT 60-120 (D)	•			VKBA 523	•	-	-	-	1)
	•				•	-	-	-	
		○	32	VKBA 921	•	-	-	-	5)
		○			•	-	-	-	
Transit FT 80-120	•			VKBA 523	•	-	-	-	1)
	•				•	-	-	-	
	•			VKBA 1465	•	-	-	-	11)
	•				•	-	-	-	
		○	34	VKBA 922	•	-	-	-	7)
		○			•	-	-	-	
		○	32	VKBA 921	•	-	-	-	7)
		○			•	-	-	-	
	○	34	VKBA 958	•	-	-	-	8)	
	○			•	-	-	-		
	○	34	VKBA 957	•	-	-	-	9)	
	○			•	-	-	-		
	○	34	VKBA 1466	•	-	-	-	11)	
	○			•	-	-	-		
Transit FT 90-120 (GB)	•			VKBA 523	•	-	-	-	1)
	•				•	-	-	-	
		○	34	VKBA 922	•	-	-	-	3)
		○			•	-	-	-	
Transit FT 100L (D)	•			VKBA 523	•	-	-	-	1)
	•				•	-	-	-	
		○	34	VKBA 922	•	-	-	-	6)
		○			•	-	-	-	
Transit FT 100L, Transit FT 130-190	•			VKBA 523	•	-	-	-	1)
	•				•	-	-	-	
		○	34	VKBA 922	•	-	-	-	7)
	○			•	-	-	-		
	○			VKBA 959	•	VKHB 2246	18790/18720/Q	-	10)
	○				•	VKHB 2277	387 A/382 A/Q	-	
Transit FT 120-190	•			VKBA 523	•	-	-	-	1)
	•				•	-	-	-	
		○	51, 52, 53	VKBA 923	•	-	-	-	7)
		○			•	-	-	-	



Transit FT 125-190	•			VKBA 523	•	-	-	-	1)	
	•				•	-	-	-		
		○	51, 52, 53	VKBA 923	•	-	-	-	3)	
		○			•	-	-	-		
Transit FT 130-190	•			VKBA 1465	•	-	-	-	11)	
	•				•	-	-	-		
		○	53	VKBA 959	•	VKHB 2246	18790/18720/Q	-	11)	
		○			•	VKHB 2277	387 A/382 A/Q	-		
Transit FT 130-150, 190 L	•			VKBA 1465	•	-	-	-	11)	
	•				•	-	-	-		
		○	51	VKBA 1467	•	-	-	-	11)	
		○			•	-	-	-		
CARGO	•		30	-	•	VKHB 2309	25590/Q/25520/Q	-	12)	
	•				•	VKHB 2151	LM 48548/510/Q	-		
	•		30	-	•	VKHB 2309	25590/Q/25520/Q	-	13)	
	•				•	VKHB 2151	LM 48548/510/Q	-		
	•		50 N, 50 W	-	•	VKHB 2088	39581/39520/Q	-		
	•				•	VKHB 2089	3585/Q/3525/Q	-		
	•		65, 71	-	•	VKHB 2050	HM 215249/HM 215210	-		
	•				•	VKHB 2310	3780/Q/3720/Q	-		
			○	130,15	-	•	VKHB 2311	33287/Q/33462/Q	-	
			○			•	VKHB 2074	3984/3920	-	
			○	168	-	•	VKHB 2312	495 AX/493	-	
			○			•	VKHB 2074	3984/3920	-	
		○	195	-	•	VKHB 2313	47686/47620/Q	-		
		○			•	VKHB 2175	39590/39520/Q	-		
		○	225	-	•	VKHB 2040	594/592 A/Q	-		
		○			•	VKHB 2041	580/572/Q	-		







## MAN

6/8 T, 4x2 F .....	62
8/9 T, 4x2 FOC .....	62
10 T, 4x2 F .....	62
12 T, 4x4 FA .....	62
12/13 T, 4x2 F, FL .....	62
14/15 T 4x2 F, FL .....	62–63
16/19 T, 4x2 F, FL, FLL, U .....	63
17/18 T, 4x2 FL .....	64
19 T 4x2 F, FL .....	64
22/24/25/26 T, 6x2 FNL, FNLL .....	64
22/24/25/26 T, 6x2/4 FVL, UNL .....	64–65
24 T, 6x2/4 FNL, FVL .....	65
26 T, 4x2 FNLL .....	65
26/27/28/30/32/33 T, 6x6 DFA .....	66
26/27/28/32/33 T, 6x4 DF .....	66
32/35/41 T, 8x8/4-8x6/4, 8x4/4 .....	66–67
38/40 T, 6x6 DFA .....	67
40 T 6x4 DF .....	67
41 T 8x8/4, 8x6/4 VFA .....	67
L, M, F 2000 Ser. ....	67–68



6/8 T 4x2 F, (Type L01)

•  
•

V7-36 L

VKBA 5265

•  
•

VKHB 2240  
VKHB 2018

BT1B 328251/Q  
32207 J2/Q

VKS 6296  
-

○  
○

VW 6.1 T

VKBA 5150

•  
•

VKHB 2174  
VKHB 2175

547518  
39590/39520/Q

VKS 6192  
-

○  
○

VW 6.8 T

VKBA 5150

•  
•

VKHB 2174  
VKHB 2175

547518  
39590/39520/Q

VKS 6192  
-

8/9 T 4x2 FOC, (Type L05)

•  
•

V7-36 L

VKBA 5265

•  
•

VKHB 2240  
VKHB 2018

BT1B 328251/Q  
32207 J2/Q

VKS 6296  
-

○  
○

VW 6.1 T

VKBA 5150

•  
•

VKHB 2174  
VKHB 2175

547518  
39590/39520/Q

VKS 6192  
-

○  
○

VW 6.8 T

VKBA 5150

•  
•

VKHB 2174  
VKHB 2175

547518  
39590/39520/Q

VKS 6192  
-

10 T, 4x2 F, (Type L04)

•  
•

V7-36 L

VKBA 5265

•  
•

VKHB 2240  
VKHB 2018

BT1B 328251/Q  
32207 J2/Q

VKS 6296  
-

○  
○

VW 6.8 T

VKBA 5150

•  
•

VKHB 2174  
VKHB 2175

547518  
39590/39520/Q

VKS 6192  
-

12 T 4x4 FA, (Type M07)

•  
•

VA7-0540

VKBA 5361

•  
•

VKHB 2169  
VKHB 2282

32017 X/Q  
32015 X/Q

VKS 6186  
-

○  
○

HY-0955

VKBA 5331

•  
•

VKHB 2248  
VKHB 2222

30218 J2  
33115/Q

VKS 6328  
-

○  
○

H7-0870

VKBA 5307

•  
•

VKHB 2170  
VKHB 2033

32018 X/Q  
32215 J2/Q

VKS 6138  
-

12/13 T, 4x2 F, (Type M01)

•  
•

V7-42 L

-

•  
•

-  
VKHB 2020

-  
32208 J2/Q

VKS 6327  
-

•  
•

V7-52 L

-

•  
•

-  
VKHB 2067

-  
33209/Q

VKS 6302  
-

○  
○

HY-1175

VKBA 5331

•  
•

VKHB 2248  
VKHB 2222

30218 J2  
33115/Q

VKS 6328  
-

○  
○

HY-0955

VKBA 5331

•  
•

VKHB 2248  
VKHB 2222

30218 J2  
33115/Q

VKS 6328  
-

12/13 T, 4x2 FL, (Type M02)

•  
•

V7-42 L

-

•  
•

-  
VKHB 2020

-  
32208 J2/Q

VKS 6327  
-

•  
•

V7-52 L

-

•  
•

-  
VKHB 2067

-  
33209/Q

VKS 6302  
-

○  
○

HY-0955

VKBA 5331

•  
•

VKHB 2248  
VKHB 2222

30218 J2  
33115/Q

VKS 6328  
-

○  
○

HY-1175

VKBA 5331

•  
•

VKHB 2248  
VKHB 2222

30218 J2  
33115/Q

VKS 6328  
-

14/15 T, 4x2 F, (Type M03)

•  
•

V7-52 L

-

•  
•

-  
VKHB 2067

-  
33209/Q

VKS 6302  
-

○  
○

HY-1175

VKBA 5331

•  
•

VKHB 2248  
VKHB 2222

30218 J2  
33115/Q

VKS 6328  
-

○  
○

HY-0955

VKBA 5331

•  
•

VKHB 2248  
VKHB 2222

30218 J2  
33115/Q

VKS 6328  
-



14/15 T, 4x2 FL, (Type M04)	•		V7-52 L	-	•	-	-	VKS 6302	
	•				•	VKHB 2067	33209/Q	-	
		○	HY-1175	VKBA 5331	•	VKHB 2248	30218 J2	VKS 6328	
		○			•	VKHB 2222	33115/Q	-	
		○	HY-0955	VKBA 5331	•	VKHB 2248	30218 J2	VKS 6328	
		○			•	VKHB 2222	33115/Q	-	
16/19 T, 4x2 F, (Type F01)	•		V9-75 L	VKBA 5162	•	VKHB 2132	331933/Q	VKS 6182	
	•				•	VKHB 2070	32310 J2/Q	-	
		○	HY-13110	VKBA 5163	•	VKHB 2146	33021/QVB091	VKS 6189	
		○			•	VKHB 2082	33019/Q	-	
		○	H9-16120	-	•	VKHB 2163	33022	VKS 6183	
		○			•	-	-	VKS 6181	
		○	H9-13120	-	•	VKHB 2163	33022	VKS 6183	4)
	○			•	-	-	VKS 6181		
	○	H9-13120	VKBA 5160	•	VKHB 2163	33022	VKS 6183	3)	
	○			•	VKHB 2164	30220 J2	VKS 6181		
	○	H9-10120	VKBA 5153	•	VKHB 2162	33021/Q	VKS 6183		
	○			•	VKHB 2161	32019 X/Q	VKS 6181		
16/19 T, 4x2 FL, (Type F02)	•		V9-75 L	VKBA 5162	•	VKHB 2132	331933/Q	VKS 6182	
	•				•	VKHB 2070	32310 J2/Q	-	
		○	H9-10120	VKBA 5153	•	VKHB 2162	33021/Q	VKS 6183	
		○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HY-13110	VKBA 5163	•	VKHB 2146	33021/QVB091	VKS 6189		
	○			•	VKHB 2082	33019/Q	-		
	○	H9-13120	VKBA 5160	•	VKHB 2163	33022	VKS 6183		
	○			•	VKHB 2164	30220 J2	VKS 6181		
16/19 T, 4x2 FLL, (Type F03)	•		V9-75 L	VKBA 5162	•	VKHB 2132	331933/Q	VKS 6182	
	•				•	VKHB 2070	32310 J2/Q	-	
	•		V9-65 L	VKBA 5162	•	VKHB 2132	331933/Q	VKS 6182	
	•				•	VKHB 2070	32310 J2/Q	-	
		○	H9-13120	VKBA 5160	•	VKHB 2163	33022	VKS 6183	
	○			•	VKHB 2164	30220 J2	VKS 6181		
	○	HY-13110	VKBA 5163	•	VKHB 2146	33021/QVB091	VKS 6189		
	○			•	VKHB 2082	33019/Q	-		
16/19 T, 4x2 U (Type U01)	•		V9-75 L	VKBA 5162	•	VKHB 2132	331933/Q	VKS 6182	
	•				•	VKHB 2070	32310 J2/Q	-	
		○	H9-10120	VKBA 5153	•	VKHB 2162	33021/Q	VKS 6183	
		○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	H9-13120	VKBA 5160	•	VKHB 2163	33022	VKS 6183		
	○			•	VKHB 2164	30220 J2	VKS 6181		
	○	HY-13110	VKBA 5163	•	VKHB 2146	33021/QVB091	VKS 6189		
	○			•	VKHB 2082	33019/Q	-		



17/18 T, 4x2 FL, (Type M06)	•	V7-65 L	VKBA 5340	•	VKHB 2293 VKHB 2004	BT1B 328286/Q 32309 J2/Q	VKS 6329 -																									
	•			V7-80 L					VKBA 5162	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6182 -																			
	•									HY-0955					VKBA 5331	•	VKHB 2248 VKHB 2222	30218 J2 33115/Q	VKS 6328 -													
	•															HY-1175					VKBA 5163	•	VKHB 2146 VKHB 2082	33021/QVB091 33019/Q	VKS 6189 -	7)						
	•																					H7-1080, H7-1180					VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	6)
	•																											H7-1080, H7-1180				
•																																
19 T 4x2 F, (Type F21)	•	V9-75 L	VKBA 5162	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6182 -																									
	•			H9-13120					VKBA 5160	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181																			
	•									HY-13110					VKBA 5163	•	VKHB 2146 VKHB 2082	33021/QVB091 33019/Q	VKS 6189 -													
•																																
19 T 4x2 FL, (Type F22)	•	V9-75 L	VKBA 5162	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6182 -																									
	•			H9-13120					VKBA 5160	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181																			
	•									HY-13110					VKBA 5163	•	VKHB 2146 VKHB 2082	33021/QVB091 33019/Q	VKS 6189 -													
•																																
22/24/25/26 T, 6x2 FNL, (Type F25)	•	V9-75 L	VKBA 5162	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6182 -																									
	•			HN9-75					VKBA 5162	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6182 -																			
	•									H9-13120					VKBA 5160	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	5)												
	•															H9-13120					VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	6)						
	•																					HY-13110					VKBA 5163	•	VKHB 2146 VKHB 2082	33021/QVB091 33019/Q	VKS 6189 -	
•																																
22/24/25/26 T, 6x2 FNLL, (Type F06)	•	V9-75 L	VKBA 5162	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6182 -																									
	•			HN9-75					VKBA 5162	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6182 -																			
	•									HY-13110					VKBA 5163	•	VKHB 2146 VKHB 2082	33021/QVB091 33019/Q	VKS 6189 -													
	•															H9-13120					VKBA 5160	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181							
•																																



22/24/25/26 T, 6x2/4 FVL,  
(Type F07)

- 
- 

- 
- 

V9-75 L

VKBA 5162

- 
- 

VKHB 2132  
VKHB 2070

331933/Q  
32310 J2/Q

VKS 6182  
-

- 
- 

HY-13110

VKBA 5163

- 
- 

VKHB 2146  
VKHB 2082

33021/QVB091  
33019/Q

VKS 6189  
-

- 
- 

H9-13120

VKBA 5160

- 
- 

VKHB 2163  
VKHB 2164

33022  
30220 J2

VKS 6183  
VKS 6181

22/24/25/26 T, 6x2 UNL,  
(Type U15)

- 
- 

- 
- 

V9-75 L

VKBA 5162

- 
- 

VKHB 2132  
VKHB 2070

331933/Q  
32310 J2/Q

VKS 6182  
-

- 
- 

HY-13110

VKBA 5163

- 
- 

VKHB 2146  
VKHB 2082

33021/QVB091  
33019/Q

VKS 6189  
-

- 
- 

H9-13120

VKBA 5160

- 
- 

VKHB 2163  
VKHB 2164

33022  
30220 J2

VKS 6183  
VKS 6181

- 
- 

HN9-75

VKBA 5162

- 
- 

VKHB 2132  
VKHB 2070

331933/Q  
32310 J2/Q

VKS 6182  
-

24 T 6x2 FNL, (Type M09)

- 
- 

- 
- 

V7-65 L

VKBA 5340

- 
- 

VKHB 2293  
VKHB 2004

BT1B 328286/Q  
32309 J2/Q

VKS 6329  
-

- 
- 

V7-80 L

VKBA 5162

- 
- 

VKHB 2132  
VKHB 2070

331933/Q  
32310 J2/Q

VKS 6182  
-

- 
- 

HY-1175

VKBA 5163

- 
- 

VKHB 2146  
VKHB 2082

33021/QVB091  
33019/Q

VKS 6189  
-

- 
- 

H7-1080

VKBA 5302

- 
- 

VKHB 2146  
VKHB 2161

33021/QVB091  
32019 X/Q

VKS 6334  
-

6)

- 
- 

H7-1080

VKBA 5300

- 
- 

VKHB 2146  
VKHB 2161

33021/QVB091  
32019 X/Q

VKS 6183  
VKS 6181

5)

- 
- 

HN7-67

VKBA 5340

- 
- 

VKHB 2293  
VKHB 2004

BT1B 328286/Q  
32309 J2/Q

VKS 6329  
-

- 
- 

H9-1180

VKBA 5302

- 
- 

VKHB 2146  
VKHB 2161

33021/QVB091  
32019 X/Q

VKS 6334  
-

24 T, 6x2/4 FVL, (Type M10)

- 
- 

- 
- 

V7-80 L

VKBA 5162

- 
- 

VKHB 2132  
VKHB 2070

331933/Q  
32310 J2/Q

VKS 6182  
-

- 
- 

H7-1080/1180

VKBA 5302

- 
- 

VKHB 2146  
VKHB 2161

33021/QVB091  
32019 X/Q

VKS 6334  
-

6)

- 
- 

HY-1175

VKBA 5163

- 
- 

VKHB 2146  
VKHB 2082

33021/QVB091  
33019/Q

VKS 6189  
-

- 
- 

H9-1180

VKBA 5302

- 
- 

VKHB 2146  
VKHB 2161

33021/QVB091  
32019 X/Q

VKS 6334  
-

- 
- 

H7-1080/1180

VKBA 5300

- 
- 

VKHB 2146  
VKHB 2161

33021/QVB091  
32019 X/Q

VKS 6183  
VKS 6181

5)

26 T, 4x2 FNLL, (Type F19)

- 
- 

- 
- 

V9-75 L

VKBA 5162

- 
- 

VKHB 2132  
VKHB 2070

331933/Q  
32310 J2/Q

VKS 6182  
-

- 
- 

HY-13110

VKBA 5163

- 
- 

VKHB 2146  
VKHB 2082

33021/QVB091  
33019/Q

VKS 6189  
-

- 
- 

H9-13120

VKBA 5160

- 
- 

VKHB 2163  
VKHB 2164

33022  
30220 J2

VKS 6183  
VKS 6181

- 
- 

HN9-75

VKBA 5162

- 
- 

VKHB 2132  
VKHB 2070

331933/Q  
32310 J2/Q

VKS 6182  
-



26/27/28/30/32/33 T,  
6x6 DFA, (Type F10)

•  
•

VA9-0950

VKBA 5166

•  
•

VKHB 2172  
VKHB 2161

331974 A/Q  
32019 X/Q

VKS 6197  
VKS 6194

○

H9-1080/1180

VKBA 5302

•

VKHB 2146

33021/QVB091

VKS 6334

6)

○

H9-1080/1180

VKBA 5300

•

VKHB 2146

33021/QVB091

VKS 6183

5)

○

HD9-16120

-

•

VKHB 2163

33022

VKS 6183

○

HD9-1380

-

•

VKHB 2163

33022

VKS 6183

8)

○

HD9-1080/1180

VKBA 5300

•

VKHB 2146

33021/QVB091

VKS 6183

○

HD9-1380

VKBA 5160

•

VKHB 2163

33022  
30220 J2

VKS 6183

11)

○

HD9-13120

VKBA 5160

•

VKHB 2163

33022  
30220 J2

VKS 6183

9)

○

HD9-13120

-

•

VKHB 2163

33022

VKS 6183

8)

○

HD9-13120

-

•

VKHB 2165

33220

VKS 6181

26/27/28/32/33 T, )  
6x4 DF, (Type F09)

•  
•

V9-75 L

VKBA 5162

•  
•

VKHB 2132  
VKHB 2070

331933/Q  
32310 J2/Q

VKS 6182  
-

•  
•

V9-90 L

VKBA 5166

•  
•

VKHB 2172  
VKHB 2161

331974 A/Q  
32019 X/Q

VKS 6197  
VKS 6194

○

HD7-1380

-

•

VKHB 2163

33022

VKS 6191

13)

○

HD9-1080/1180

VKBA 5300

•

VKHB 2146

33021/QVB091

VKS 6183

○

HD9-16120

-

•

VKHB 2163

33022

VKS 6183

○

HD9-1380

VKBA 5160

•

VKHB 2163

33022  
30220 J2

VKS 6183

9)

○

HD9-1380

VKBA 5160

•

VKHB 2163

33022  
30220 J2

VKS 6183

10)

○

HD9-1380

-

•

VKHB 2163

33022

VKS 6183

8)

○

HD9-13120

VKBA 5160

•

VKHB 2163

33022  
30220 J2

VKS 6183

9)

○

HD9-13120

-

•

VKHB 2163

33022

VKS 6183

8)

32/35/41 T, 8x8/4-8x6/4,  
8x4/4, (Type E15)

•  
•

VA9-0950

VKBA 5166

•  
•

VKHB 2172  
VKHB 2161

331974 A/Q  
32019 X/Q

VKS 6197  
VKS 6194

•  
•

V9-90 L

VKBA 5166

•  
•

VKHB 2172  
VKHB 2161

331974 A/Q  
32019 X/Q

VKS 6197  
VKS 6194

○

HD9-1080/1180

VKBA 5300

•

VKHB 2146

33021/QVB091

VKS 6183

5)

○

HD9-1380

VKBA 5160

•

VKHB 2163

33022  
30220 J2

VKS 6183

5)



	○	HD9-1080/1180	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	6)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HD9-13120	VKBA 5341	•	VKHB 2163	33022	VKS 6334	6)
	○			•	VKHB 2164	30220 J2	-	
	○	HD9-13120	VKBA 5160	•	VKHB 2163	33022	VKS 6183	5)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HD9-1380	VKBA 5341	•	VKHB 2163	33022	VKS 6334	6)
	○			•	VKHB 2164	30220 J2	-	
38/40 T, 6x6 DFA, (Type F12)	•	VA9-0950	VKBA 5166	•	VKHB 2172	331974 A/Q	VKS 6197	
	•			•	VKHB 2161	32019 X/Q	VKS 6194	
	○	HD9-16120	-	•	VKHB 2163	33022	VKS 6183	
	○			•	VKHB 2165	33220	VKS 6181	
40 T 6x4 DF, (Type F11)	•	V9-90 L	VKBA 5166	•	VKHB 2172	331974 A/Q	VKS 6197	
	•			•	VKHB 2161	32019 X/Q	VKS 6194	
	○	HD9-16120	-	•	VKHB 2163	33022	VKS 6183	
	○			•	VKHB 2165	33220	VKS 6181	
41 T 8x8/4, 8x6/4 VFA, (Type E15)	•	V9-90 L	VKBA 5166	•	VKHB 2172	331974 A/Q	VKS 6197	
	•			•	VKHB 2161	32019 X/Q	VKS 6194	
	○	HD9-1380/ H9-1380	VKBA 5160	•	VKHB 2163	33022	VKS 6183	
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HD9-1080/ H9-1080	VKBA 5300	•	VKHB 2146	33021/QVB091	VKS 6183	
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HD9-13120/ H9-13120	VKBA 5160	•	VKHB 2163	33022	VKS 6183	
	○			•	VKHB 2164	30220 J2	VKS 6181	
L, M, F 2000 Ser.	•	V9-32 L	VKBA 5378	•	VKHB 2314	580486	-	14)
	•			•	VKHB 2179	33206/Q	-	
	•	V9-32 L	VKBA 5379	•	VKHB 2314	580486	VKS 6341	15)
	•			•	VKHB 2179	33206/Q	-	
	•	V9-34 L	VKBA 5265	•	VKHB 2240	BT1B 328251/Q	VKS 6296	14)
	•			•	VKHB 2018	32207 J2/Q	-	
	•	V9-34 L	VKBA 5380	•	VKHB 2240	BT1B 328251/Q	VKS 6342	15)
	•			•	VKHB 2018	32207 J2/Q	-	
	•	V9-40 L	VKBA 5265	•	VKHB 2240	BT1B 328251/Q	VKS 6296	14)
	•			•	VKHB 2018	32207 J2/Q	-	
	•	V9-40 L	VKBA 5380	•	VKHB 2240	BT1B 328251/Q	VKS 6342	15)
	•			•	VKHB 2018	32207 J2/Q	-	
	•	V9-42 L	VKBA 5380	•	VKHB 2240	BT1B 328251/Q	VKS 6342	15)
	•			•	VKHB 2018	32207 J2/Q	-	
	•	V9-50 L, V9-60 L	VKBA 5381	•	VKHB 2293	BT1B 328286/Q	VKS 6329	16)
	•			•	VKHB 2067	33209/Q	-	
	•	V9-50 L, V9-60 L	VKBA 5383	•	VKHB 2293	BT1B 328286/Q	VKS 6343	17)
	•			•	VKHB 2067	33209/Q	-	
	•	V9-50 L, V9-60 L	VKBA 5384	•	VKHB 2293	BT1B 328286/Q	VKS 6344	18)
	•			•	VKHB 2067	33209/Q	-	
	•	V9-67 L	VKBA 5340	•	VKHB 2293	BT1B 328286/Q	VKS 6329	
	•			•	VKHB 2004	32309 J2/Q	-	





L, M, F 2000 Ser. .../...

- 
- 
- 
- 
- 
- 

V9-75 L, V9-80 L

VKBA 5162

- 
- 

VKHB 2132  
VKHB 2070

331933/Q  
32310 J2/Q

VKS 6182  
-

V9-82 L

VKBA 5377

- 
- 

-  
-

BTF-0021 A  
-

-  
-

VA9-0540

VKBA 5361

- 
- 

VKHB 2169  
VKHB 2282

32017 X/Q  
32015 X/Q

VKS 6186  
-

VA9-0950

VKBA 5166

- 
- 

VKHB 2172  
VKHB 2161

331974 A/Q  
32019 X/Q

VKS 6197  
VKS 6194

○ HY-0645, HY-0745

VKBA 5150

- 
- 

VKHB 2174  
VKHB 2175

547518  
39590/39520/Q

VKS 6192  
-

○ HY-0855

-

- 
- 

-  
VKHB 2046

-  
33015/Q

VKS 6345  
-

○ HY-0955, HY-1175

VKBA 5331

- 
- 

VKHB 2248  
VKHB 2222

30218 J2  
33115/Q

VKS 6328  
-

○ HY-13110

VKBA 5163

- 
- 

VKHB 2146  
VKHB 2082

33021/QVB091  
33019/Q

VKS 6189  
-

○ HN9-75

VKBA 5162

- 
- 

VKHB 2132  
VKHB 2070

331933/Q  
32310 J2/Q

VKS 6182  
-

○ H9-0670

VKBA 5361

- 
- 

VKHB 2169  
VKHB 2282

32017 X/Q  
32015 X/Q

VKS 6186  
-

○ H9-1180

VKBA 5302

- 
- 

VKHB 2146  
VKHB 2161

33021/QVB091  
32019 X/Q

VKS 6334  
-

○ H9-1380/13120

VKBA 5160

- 
- 

VKHB 2163  
VKHB 2164

33022  
30220 J2

VKS 6183  
VKS 6181

○ HD9-1180

VKBA 5302

- 
- 

VKHB 2146  
VKHB 2161

33021/QVB091  
32019 X/Q

VKS 6334  
-

○ HD9-1380/13120

VKBA 5160

- 
- 

VKHB 2163  
VKHB 2164

33022  
30220 J2

VKS 6183  
VKS 6181

○ HD9-16120

-

- 
- 

VKHB 2163  
VKHB 2165

33022  
33220

VKS 6183  
VKS 6181



## MERCEDES-BENZ

207 D - 215 Ser. ....	70
307 D - 315 Ser. ....	70
406 - 415 Ser. ....	70
500 Ser. ....	70-71
V - Class .....	71
VITO .....	71
SPRINTER .....	71
T2 - Ser. ....	71-72
LK - Ser. ....	72-78
SK - Ser. ....	78-106
ATEGO .....	106-110
ACTROS .....	110-115
MERCEDES-BENZ "Baumuster" .....	116-139

# MERCEDES-BENZ



207 D, 208, 208 D, 209 D, 210, 210 D, 212, 214, 215	•	VL 0/1 C-1,3,	VKBA 596	•	-	-	-	
	•	VL 0/2 C-1,5		•	-	-	-	
	•	VL 0/6 CE-1,6,	VKBA 3434	•	-	-	-	
	•	VL 0/7 CE-1,6		•	-	-	-	
	○	HL 0/1-1,7,	VKBA 1470	•	-	-	-	
	○	HL 0/2-2,2		•	-	-	-	
307 D, 308, 308 D, 309, 309 D, 310, 310 D, 312, 314, 315	•	VL 0/11 CE-1,75	VKBA 3434	•	-	-	-	
	•			•	-	-	-	
	•	VL 0/2 C-1,5	VKBA 596	•	-	-	-	
	•			•	-	-	-	
	•	VL 0/3 C-1,7,	VKBA 3434	•	-	-	-	
	•	VL 0/7 CE-1,6		•	-	-	-	
	•	VL 1/3-2,1	VKBA 5024	•	VKHB 2054	2789/2720/QCL7C	VKS 6152	4)
•			•	VKHB 2055	1380/Q/1328/Q	-		
•	VL 1/3-2,1	VKBA 5025	•	VKHB 2056	33109/Q	VKS 6299	5)	
•			•	VKHB 2057	33205/QVQ077	-		
	○	HL 0/2-2,2	VKBA 1470	•	-	-	-	
	○			•	-	-	-	
406, 406 D, 407, 407D, 408, 408 D, 408 G, 409, 409D, 410, 410 D, 412, 414, 415	•	VL 0/12 CE-1,75	VKBA 3434	•	-	-	-	
	•			•	-	-	-	
	•	VL 0/2 C-1,5	VKBA 596	•	-	-	-	
	•			•	-	-	-	
	•	VL 0/3 C-1,7,	VKBA 3434	•	-	-	-	
	•	VL 0/8 CE-1,75		•	-	-	-	
	•	VL 1/3-2,1	VKBA 5024	•	VKHB 2054	2789/2720/QCL7C	VKS 6152	4)
	•			•	VKHB 2055	1380/Q/1328/Q	-	
	•	VL 1/3-2,1	VKBA 5025	•	VKHB 2056	33109/Q	VKS 6299	5)
	•			•	VKHB 2057	33205/QVQ077	-	
	•	VL 1/4-1,6	VKBA 5023	•	VKHB 2058	32304 J2/Q	VKS 6149	6)
•			•	VKHB 2018	32207 J2/Q	-		
•	VL 1/4-1,6	VKBA 5024	•	VKHB 2054	2789/2720/QCL7C	VKS 6152	7)	
•			•	VKHB 2055	1380/Q/1328/Q	-		
•	VL 1/4-1,6	VKBA 5025	•	VKHB 2056	33109/Q	VKS 6299	8)	
•			•	VKHB 2057	33205/QVQ077	-		
	○	HL 0/3-3,3	VKBA 5040	•	VKHB 2060	32011 X/Q	VKS 6159	
	○			•	VKHB 2017	32210 J2/Q	-	
	○	HL 1/2-3,3	VKBA 5041	•	VKHB 2019	32211 J2/Q	VKS 6143	9)
	○			•	VKHB 2017	32210 J2/Q	-	
500 Ser.	•	VL 0/5 C-1,7,	VKBA 3434	•	-	-	-	
	•	VL 0/9 DC-1,8		•	-	-	-	
	•	VL 1/3-2,1	VKBA 5024	•	VKHB 2054	2789/2720/QCL7C	VKS 6152	4)
•			•	VKHB 2055	1380/Q/1328/Q	-		
•	VL 1/3-2,1	VKBA 5025	•	VKHB 2056	33109/Q	VKS 6299	5)	
•			•	VKHB 2057	33205/QVQ077	-		



	• •	VL 1/6-2,3, VL 1/7-2,6, VL 1/9 C-2,3	VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	
	○ ○	HL 0/6-3,9	VKBA 5234	• •	VKHB 2234 VKHB 2017	32012 X/QCL7C 32210 J2/Q	VKS 6288 -	
	○ ○	HL 0/7-3,2	VKBA 5040	• •	VKHB 2060 VKHB 2017	32011 X/Q 32210 J2/Q	VKS 6159 -	
	○ ○	HL 1/2-3,3	VKBA 5041	• •	VKHB 2019 VKHB 2017	32211 J2/Q 32210 J2/Q	VKS 6143 -	9)
	○ ○	HL 1/3-4,5, HL 2/5-4,5, HL 2/9-4,7	VKBA 5043	• •	VKHB 2074 VKHB 2075	3984/3920 33822/Q/33895/Q	VKS 6147 -	
V-CLASS, V 200, V 230, V 230 Turbodiesel, V 280	• •		VKBA 3486	• •	- -	- -	- -	
	○ ○		VKBA 3486	• •	- -	- -	- -	
VITO, 108 D, 110 D, 113, 114	• •		VKBA 3486	• •	- -	- -	- -	
	○ ○		VKBA 3486	• •	- -	- -	- -	
SPRINTER, 208 D, 212 D, 214, 308 D, 312 D, 314, 408 D, 412 D, 414	• •		VKBA 3434	• •	- -	- -	- -	35)
SPRINTER, 208 D, 212 D, 214, 308 D, 312 D, 314, 408 D, 412 D, 414	○ ○		VKBA 3435	• •	- -	- -	- -	35)
SPRINTER, 408 D, 412 D, 414	○ ○		VKBA 3475	• •	- -	- -	- -	34), 36)
T2, 600 Ser.	• •	VL 1/3-2,1	VKBA 5024	• •	VKHB 2054 VKHB 2055	2789/2720/QCL7C 1380/Q/1328/Q	VKS 6152 -	4)
	• •	VL 1/3-2,1	VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	5)
	• •	VL 1/5-2,3, VL 1/6-2,3, VL 1/7-2,6, VL 1/9 C-2,3	VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	
	• •	VL 2/5-2,2	-	• •	VKHB 2060 VKHB 2016	32011 X/Q 32206 J2/Q	VKS 6159 -	
	• •	VL 2/6-3,1	VKBA 5026	• •	VKHB 2059 VKHB 2007	33111/Q 32306 J2/Q	VKS 6159 -	
	○ ○	HL 0/6-3,9	VKBA 5234	• •	VKHB 2234 VKHB 2017	32012 X/QCL7C 32210 J2/Q	VKS 6288 -	
	○ ○	HL 1/3-4,5	VKBA 5043	• •	VKHB 2074 VKHB 2075	3984/3920 33822/Q/33895/Q	VKS 6147 -	
	○ ○	HL 1/8-4,7	VKBA 5047	• •	VKHB 2154 VKHB 2060	32014 X/Q 32011 X/Q	VKS 6173 -	

# MERCEDES-BENZ



T2, 600 Ser. .../...	○	HL 2/15-5,8	VKBA 5048	•	VKHB 2155	331293/Q	VKS 6172
				•	VKHB 2156	33011/Q	-
	○	HL 2/2 L-4,8,	VKBA 5043	•	VKHB 2074	3984/3920	VKS 6147
		HL 2/2-4,8, HL 2/5-4,5, HL 2/9-4,7		•	VKHB 2075	33822/Q/33895/Q	-
LK, 700 Ser.	•	VL 1/10 C-2,5, VL 1/8 D-2,5, VL 1/9 C-2,3	VKBA 5025	•	VKHB 2056	33109/Q	VKS 6299
				•	VKHB 2057	33205/QVQ077	-
	•	VL 2/5-2,2	-	•	VKHB 2060	32011 X/Q	VKS 6159
				•	VKHB 2016	32206 J2/Q	-
	○	HL 1/8-4,7	VKBA 5047	•	VKHB 2154	32014 X/Q	VKS 6173
				•	VKHB 2060	32011 X/Q	-
	○	HL 1/9-5,6	VKBA 5048	•	VKHB 2155	331293/Q	VKS 6172
				•	VKHB 2156	33011/Q	-
	○	HL 2/12 D-4,5	VKBA 5047	•	VKHB 2154	32014 X/Q	VKS 6173
				•	VKHB 2060	32011 X/Q	-
○	HL 2/13 D-6,4	VKBA 5233	•	VKHB 2137	JM 714249/210/Q	VKS 6174	
			•	VKHB 2233	33112/QVB259	-	
○	HL 2/15-5,8	VKBA 5048	•	VKHB 2155	331293/Q	VKS 6172	
			•	VKHB 2156	33011/Q	-	
○	HL 2/2 L-4,8,	VKBA 5043	•	VKHB 2074	3984/3920	VKS 6147	
	HL 2/2-4,8		•	VKHB 2075	33822/Q/33895/Q	-	
LK, 800 Ser.	•	VL 1/10 C-2,5	VKBA 5025	•	VKHB 2056	33109/Q	VKS 6299
				•	VKHB 2057	33205/QVQ077	-
	•	VL 2/10 D-3,5	VKBA 5028	•	VKHB 2061	33211/Q	VKS 6148
				•	VKHB 2007	32306 J2/Q	-
	•	VL 2/12 D-3,8	VKBA 5029	•	VKHB 2061	33211/Q	VKS 6148
				•	VKHB 2064	529656	-
	•	VL 2/4-3,4, VL 2/6-3,1	VKBA 5026	•	VKHB 2059	33111/Q	VKS 6159
				•	VKHB 2007	32306 J2/Q	-
	•	VL 2/8-3,2	VKBA 5028	•	VKHB 2061	33211/Q	VKS 6148
				•	VKHB 2007	32306 J2/Q	-
	•	VL 2/9 D-3,1	VKBA 5026	•	VKHB 2059	33111/Q	VKS 6159
				•	VKHB 2007	32306 J2/Q	-
	•	VL 3/11 D-4,4	VKBA 5032	•	VKHB 2051	33213/Q	VKS 6157
				•	VKHB 2065	33208/Q	-
	○	HL 1/9-5,6, HL 2/11 D-5,8	VKBA 5048	•	VKHB 2155	331293/Q	VKS 6172
			•	VKHB 2156	33011/Q	-	
○	HL 2/12 D-4,5	VKBA 5047	•	VKHB 2154	32014 X/Q	VKS 6173	
			•	VKHB 2060	32011 X/Q	-	
○	HL 2/13 D-6,4	VKBA 5233	•	VKHB 2137	JM 714249/210/Q	VKS 6174	
			•	VKHB 2233	33112/QVB259	-	
○	HL 2/15 S-5,8, HL 2/15-5,8	VKBA 5048	•	VKHB 2155	331293/Q	VKS 6172	
			•	VKHB 2156	33011/Q	-	
○	HL 2/3-5,7	-	•	VKHB 2076	47490/47420	VKS 6153	
			•	VKHB 2059	33111/Q	-	



	<ul style="list-style-type: none"> <li>○ HL 2/4 L-6,4,</li> <li>○ HL 2/4-6,4</li> </ul>	VKBA 5232	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2137</li> <li>VKHB 2233</li> </ul>	<ul style="list-style-type: none"> <li>JM 714249/210/Q</li> <li>33112/QVB259</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6155</li> <li>-</li> </ul>	
	<ul style="list-style-type: none"> <li>○ HL 4/1-7,6</li> </ul>	-	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2026</li> <li>VKHB 2079</li> </ul>	<ul style="list-style-type: none"> <li>32216 J2/Q</li> <li>330356 A/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6144</li> <li>-</li> </ul>	
	<ul style="list-style-type: none"> <li>○ HL 4/23-7,7,</li> <li>○ HL 4/28 D-7,8</li> </ul>	VKBA 5046	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2041</li> <li>VKHB 2079</li> </ul>	<ul style="list-style-type: none"> <li>580/572/Q</li> <li>330356 A/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6178</li> <li>-</li> </ul>	
	<ul style="list-style-type: none"> <li>○ HL 4/29 D-9,2</li> </ul>	-	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2158</li> <li>VKHB 2081</li> </ul>	<ul style="list-style-type: none"> <li>33117/Q</li> <li>331074/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6178</li> <li>-</li> </ul>	
	<ul style="list-style-type: none"> <li>○ HL 4/30 DS-6,4,</li> <li>○ HL 4/30 D-6,4,</li> <li>○ HL 4/35 D-6,4</li> </ul>	-	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2157</li> <li>VKHB 2159</li> </ul>	<ul style="list-style-type: none"> <li>32016 X/Q</li> <li>33113/QVB022</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6175</li> <li>-</li> </ul>	
	<ul style="list-style-type: none"> <li>○ HL 4/4-8,8</li> </ul>	-	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2080</li> <li>VKHB 2081</li> </ul>	<ul style="list-style-type: none"> <li>32217 J2/Q</li> <li>331074/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6151</li> <li>-</li> </ul>	
LK, 900 Ser.	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VL 2/10 D-3,5	VKBA 5028	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2061</li> <li>VKHB 2007</li> </ul>	<ul style="list-style-type: none"> <li>33211/Q</li> <li>32306 J2/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6148</li> <li>-</li> </ul>
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VL 2/11 D-3,8, VL 2/12 D-3,8, VL 2/12 D-3,8	VKBA 5029	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2061</li> <li>VKHB 2064</li> </ul>	<ul style="list-style-type: none"> <li>33211/Q</li> <li>529656</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6148</li> <li>-</li> </ul>
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VL 2/4-3,4, VL 2/6-3,1	VKBA 5026	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2059</li> <li>VKHB 2007</li> </ul>	<ul style="list-style-type: none"> <li>33111/Q</li> <li>32306 J2/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6159</li> <li>-</li> </ul>
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VL 3/11 D-4,4	VKBA 5032	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2051</li> <li>VKHB 2065</li> </ul>	<ul style="list-style-type: none"> <li>33213/Q</li> <li>33208/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6157</li> <li>-</li> </ul>
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VL 3/1-3,8	-	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>-</li> <li>VKHB 2064</li> </ul>	<ul style="list-style-type: none"> <li>-</li> <li>529656</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6157</li> <li>-</li> </ul>
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HL 2/13 D-6,4	VKBA 5233	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2137</li> <li>VKHB 2233</li> </ul>	<ul style="list-style-type: none"> <li>JM 714249/210/Q</li> <li>33112/QVB259</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6174</li> <li>-</li> </ul>
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HL 2/4 L-6,4, HL 2/4-6,4	VKBA 5232	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2137</li> <li>VKHB 2233</li> </ul>	<ul style="list-style-type: none"> <li>JM 714249/210/Q</li> <li>33112/QVB259</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6155</li> <li>-</li> </ul>
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HL 4/1-7,6	-	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2026</li> <li>VKHB 2079</li> </ul>	<ul style="list-style-type: none"> <li>32216 J2/Q</li> <li>330356 A/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6144</li> <li>-</li> </ul>
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HL 4/23 L-7,7, HL 4/23-7,7, HL 4/28 D-7,8	VKBA 5046	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2041</li> <li>VKHB 2079</li> </ul>	<ul style="list-style-type: none"> <li>580/572/Q</li> <li>330356 A/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6178</li> <li>-</li> </ul>
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HL 4/29 D-9,2	-	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2158</li> <li>VKHB 2081</li> </ul>	<ul style="list-style-type: none"> <li>33117/Q</li> <li>331074/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6178</li> <li>-</li> </ul>
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HL 4/30 DS-6,4, HL 4/30 D-6,4	-	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2157</li> <li>VKHB 2159</li> </ul>	<ul style="list-style-type: none"> <li>32016 X/Q</li> <li>33113/QVB022</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6175</li> <li>-</li> </ul>
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HL 4/31 DS-7,0	-	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2158</li> <li>VKHB 2081</li> </ul>	<ul style="list-style-type: none"> <li>33117/Q</li> <li>331074/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6178</li> <li>-</li> </ul>
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HL 4/35 D-6,4	-	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2157</li> <li>VKHB 2159</li> </ul>	<ul style="list-style-type: none"> <li>32016 X/Q</li> <li>33113/QVB022</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6175</li> <li>-</li> </ul>
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HL 4/4-8,8	-	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2080</li> <li>VKHB 2081</li> </ul>	<ul style="list-style-type: none"> <li>32217 J2/Q</li> <li>331074/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6151</li> <li>-</li> </ul>

# MERCEDES-BENZ



LK, 1000 Ser.

- 
- 
- 
- 
- 
- 

VL 2/6-3,1

VKBA 5026

- 
- 

VKHB 2059  
VKHB 2007

33111/Q  
32306 J2/Q

VKS 6159  
-

VL 2/7-3,6

VKBA 5028

- 
- 

VKHB 2061  
VKHB 2007

33211/Q  
32306 J2/Q

VKS 6148  
-

VL 3/1-3,8,  
VL 3/4-5

-

- 
- 

-  
VKHB 2064

-  
529656

VKS 6157  
-

VL 3/6-4,1,  
VL 3/7-5

VKBA 5032

- 
- 

VKHB 2051  
VKHB 2065

33213/Q  
33208/Q

VKS 6157  
-

HL 2/4 L-6,4

VKBA 5232

- 
- 

VKHB 2137  
VKHB 2233

JM 714249/210/Q  
33112/QVB259

VKS 6155  
-

HL 2/7-7,7

VKBA 5046

- 
- 

VKHB 2041  
VKHB 2079

580/572/Q  
330356 A/Q

VKS 6178  
-

HL 4/01 L-10,  
HL 4/01-10

VKBA 5056

- 
- 

VKHB 2124  
VKHB 2158

33020/Q  
33117/Q

VKS 6176  
-

HL 4/16 L-7,7,  
HL 4/16-7,7

VKBA 5046

- 
- 

VKHB 2041  
VKHB 2079

580/572/Q  
330356 A/Q

VKS 6178  
-

HL 4/17 L-9,2,  
HL 4/17 S-9,2,  
HL 4/17-9,2

-

- 
- 

VKHB 2080  
VKHB 2081

32217 J2/Q  
331074/Q

VKS 6151  
-

HL 4/1-7,6

-

- 
- 

VKHB 2026  
VKHB 2079

32216 J2/Q  
330356 A/Q

VKS 6144  
-

HL 4/23 L-7,7,  
HL 4/23-7,7

VKBA 5046

- 
- 

VKHB 2041  
VKHB 2079

580/572/Q  
330356 A/Q

VKS 6178  
-

HL 4/4-8,8

-

- 
- 

VKHB 2080  
VKHB 2081

32217 J2/Q  
331074/Q

VKS 6151  
-

HL 4/8 L-10,  
HL 4/8-6,3

VKBA 5052

- 
- 

VKHB 2082  
VKHB 2028

33019/Q  
33215/Q

VKS 6154  
-

HL 7/1 S-10

VKBA 5058

- 
- 

VKHB 2162  
VKHB 2161

33021/Q  
32019 X/Q

VKS 6183  
VKS 6181

25)

HL 7/1 S-10

VKBA 5302

- 
- 

VKHB 2146  
VKHB 2161

33021/QVB091  
32019 X/Q

VKS 6334  
-

26)

HL 7/1-10

VKBA 5058

- 
- 

VKHB 2162  
VKHB 2161

33021/Q  
32019 X/Q

VKS 6183  
VKS 6181

25)

HL 7/1-10

VKBA 5302

- 
- 

VKHB 2146  
VKHB 2161

33021/QVB091  
32019 X/Q

VKS 6334  
-

26)

LK, 1100 Ser.

- 
- 
- 
- 
- 
- 

VL 2/11 D-3,8

VKBA 5029

- 
- 

VKHB 2061  
VKHB 2064

33211/Q  
529656

VKS 6148  
-

VL 2/8-3,2

VKBA 5028

- 
- 

VKHB 2061  
VKHB 2007

33211/Q  
32306 J2/Q

VKS 6148  
-

VL 3/11 D-4,4

VKBA 5032

- 
- 

VKHB 2051  
VKHB 2065

33213/Q  
33208/Q

VKS 6157  
-

VL 3/13 D-5,3

VKBA 5033

- 
- 

VKHB 2066  
VKHB 2067

33214/Q  
33209/Q

VKS 6175  
-

VL 3/1-3,8,  
VL 3/4-5

-

- 
- 

-  
VKHB 2064

-  
529656

VKS 6157  
-

HL 4/05 D-9,2,  
HL 4/09 D-9,2

VKBA 5236

- 
- 

VKHB 2082  
VKHB 2028

33019/Q  
33215/Q

VKS 6270  
-



	○	HL 4/1-7,6	-	•	VKHB 2026	32216 J2/Q	VKS 6144	
	○			•	VKHB 2079	330356 A/Q	-	
	○	HL 4/23 L-7,7,	VKBA 5046	•	VKHB 2041	580/572/Q	VKS 6178	
	○	HL 4/23-7,7,		•	VKHB 2079	330356 A/Q	-	
	○	HL 4/28 D-7,8						
	○	HL 4/29 D-9,2,	-	•	VKHB 2158	33117/Q	VKS 6178	
	○	HL 4/31 DS-7,0		•	VKHB 2081	331074/Q	-	
	○	HL 4/4-8,8	-	•	VKHB 2080	32217 J2/Q	VKS 6151	
	○			•	VKHB 2081	331074/Q	-	
	○	HL 5/2 S-6,5	VKBA 5052	•	VKHB 2082	33019/Q	VKS 6154	
	○			•	VKHB 2028	33215/Q	-	
LK, 1200 Ser.	•	VL 3/6 D-4,1,	VKBA 5032	•	VKHB 2051	33213/Q	VKS 6157	
	•	VL 3/6-4,1,		•	VKHB 2065	33208/Q	-	
	•	VL 3/7 D-5,						
	•	VL 3/7-5						
	•	VL 3/8-6	VKBA 5033	•	VKHB 2066	33214/Q	VKS 6175	10)
	•			•	VKHB 2067	33209/Q	-	
	•	VL 3/8-6	VKBA 5034	•	VKHB 2066	33214/Q	VKS 6175	11)
	•			•	VKHB 2068	33210/Q	-	
	•	VL 4/3-6	-	•	VKHB 2066	33214/Q	VKS 6175	
	•			•	VKHB 2067	33209/Q	-	
	○	HL 4/01 DL-10,	VKBA 5056	•	VKHB 2124	33020/Q	VKS 6176	
	○	HL 4/01 D-10,		•	VKHB 2158	33117/Q	-	
		HL 4/01 L-10,						
		HL 4/01-10,						
		HL 4/038 D-10,						
		HL 4/038 D-9,4,						
		HL 4/039 D-10,						
		HL 4/07 D-9,4						
	○	HL 4/16 L-7,7,	VKBA 5046	•	VKHB 2041	580/572/Q	VKS 6178	
	○	HL 4/16-7,7		•	VKHB 2079	330356 A/Q	-	
	○	HL 4/17 D-9,2,	-	•	VKHB 2080	32217 J2/Q	VKS 6151	
	○	HL 4/17 L-9,2,		•	VKHB 2081	331074/Q	-	
	○	HL 4/17-9,2						
	○	HL 4/29 D-9,2	-	•	VKHB 2158	33117/Q	VKS 6178	
	○			•	VKHB 2081	331074/Q	-	
	○	HL 4/4-8,8	-	•	VKHB 2080	32217 J2/Q	VKS 6151	
	○			•	VKHB 2081	331074/Q	-	
	○	HL 4/8 L-10,	VKBA 5052	•	VKHB 2082	33019/Q	VKS 6154	
	○	HL 4/8-10		•	VKHB 2028	33215/Q	-	
	○	HL 5/1 Z-10	-	•	VKHB 2083	CK-598 A/K-592 A	VKS 6145	
	○			•	VKHB 2033	32215 J2/Q	-	
	○	HL 7/024 D-12,3	VKBA 5376	•	VKHB 2162	33021/Q	VKS 6183	
	○			•	VKHB 2082	33019/Q	VKS 6181	
	○	HL 7/1 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/1 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HL 7/1 L-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	



# MERCEDES-BENZ



LK, 1200 Ser. ....

○	HL 7/1 L-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/1 S-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/1 S-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/18 D-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○	HL 7/18 D-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○	HL 7/1-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/1-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/26 DL-12,3	VKBA 5376	•	VKHB 2162 VKHB 2082	33021/Q 33019/Q	VKS 6183 VKS 6181	

LK, 1300 Ser.

•	AL 7/1 D-7	VKBA 5166	•	VKHB 2172 VKHB 2161	331974 A/Q 32019 X/Q	VKS 6197 VKS 6194	
•	VL 2/10 D-3,5	VKBA 5028	•	VKHB 2061 VKHB 2007	33211/Q 32306 J2/Q	VKS 6148 -	
•	VL 2/12 D-3,8	VKBA 5029	•	VKHB 2061 VKHB 2064	33211/Q 529656	VKS 6148 -	
•	VL 3/11 D-4,4, VL 3/12 D-5,3	VKBA 5032	•	VKHB 2051 VKHB 2065	33213/Q 33208/Q	VKS 6157 -	
•	VL 3/13 D-5,3	VKBA 5033	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	
•	VL 3/4-5	-	•	- VKHB 2064	- 529656	VKS 6157 -	
•	VL 4/23 D-6,7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
•	VL 4/3-6	-	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	
○	HL 1/8-4,7	VKBA 5047	•	VKHB 2154 VKHB 2060	32014 X/Q 32011 X/Q	VKS 6173 -	
○	HL 4/05 D-9,2	VKBA 5236	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6270 -	
○	HL 4/29 D-9,2	-	•	VKHB 2158 VKHB 2081	33117/Q 331074/Q	VKS 6178 -	
○	HL 4/32 D-10,6	VKBA 5236	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6270 -	
○	HL 4/4-8,8	-	•	VKHB 2080 VKHB 2081	32217 J2/Q 331074/Q	VKS 6151 -	
○	HL 4/8-10	VKBA 5052	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	
○	HL 5/1 Z-10	-	•	VKHB 2083 VKHB 2033	CK-598 A/K-592 A 32215 J2/Q	VKS 6145 -	



LK, 1400 Ser.

•		VL 3/15 D-6,5	VKBA 5034	•	VKHB 2066	33214/Q	VKS 6175	
•				•	VKHB 2068	33210/Q	-	
•		VL 3/7 D-5,	VKBA 5032	•	VKHB 2051	33213/Q	VKS 6157	
•		VL 3/7-5		•	VKHB 2065	33208/Q	-	
•		VL 3/8 D-6,5	VKBA 5034	•	VKHB 2066	33214/Q	VKS 6175	
•				•	VKHB 2068	33210/Q	-	
•		VL 3/8-6	VKBA 5033	•	VKHB 2066	33214/Q	VKS 6175	10)
•				•	VKHB 2067	33209/Q	-	
•		VL 3/8-6	VKBA 5034	•	VKHB 2066	33214/Q	VKS 6175	11)
•				•	VKHB 2068	33210/Q	-	
•		VL 4/10 DL-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	
•				•	VKHB 2068	33210/Q	VKS 6146	
•		VL 4/10 D-7,	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•		VL 4/24 D-6,7,		•	VKHB 2070	32310 J2/Q	VKS 6146	
•		VL 4/25 DL-6,7,						
•		VL 4/25 DL-7,1						
•		VL 4/29 D-7,5,	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•		VL 4/30 DL-7,5		•	VKHB 2070	32310 J2/Q	-	
•		VL 4/36 D-6,7,	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•		VL 4/36 D-7,1		•	VKHB 2070	32310 J2/Q	VKS 6146	
•		VL 4/3-6	-	•	VKHB 2066	33214/Q	VKS 6175	
•				•	VKHB 2067	33209/Q	-	
○		HH 4/19 D-10	VKBA 5052	•	VKHB 2082	33019/Q	VKS 6154	
○				•	VKHB 2028	33215/Q	-	
○		HL 4/01 DL-10,	VKBA 5056	•	VKHB 2124	33020/Q	VKS 6176	
○		HL 4/01 D-10,		•	VKHB 2158	33117/Q	-	
○		HL 4/01 L-10,						
○		HL 4/01-10,						
○		HL 4/038 D-10,						
○		HL 4/039 D-10						
○		HL 4/17 D-9,2,	-	•	VKHB 2080	32217 J2/Q	VKS 6151	
○		HL 4/17-9,2		•	VKHB 2081	331074/Q	-	
○		HL 4/8 D-10,	VKBA 5052	•	VKHB 2082	33019/Q	VKS 6154	
○		HL 4/8-10,		•	VKHB 2028	33215/Q	-	
○		HL 5/2 Z-10,						
○		HL 5/2-10						
○		HL 7/021 DL-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○				•	VKHB 2161	32019 X/Q	VKS 6181	
○		HL 7/021 DL-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○				•	VKHB 2161	32019 X/Q	-	
○		HL 7/021 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○				•	VKHB 2161	32019 X/Q	VKS 6181	
○		HL 7/021 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○				•	VKHB 2161	32019 X/Q	-	
○		HL 7/024 DL- 12,3,	VKBA 5376	•	VKHB 2162	33021/Q	VKS 6183	
○		HL 7/024 D-12,3		•	VKHB 2082	33019/Q	VKS 6181	
○		HL 7/1 DL-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○				•	VKHB 2161	32019 X/Q	VKS 6181	

# MERCEDES-BENZ



LK, 1400 Ser. ....

○	HL 7/1 DL-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/1 D-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/1 D-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/1 L-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/1 L-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/1-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/1-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	NS 4/10 D-6,7	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	

LK, 1500 Ser.

•	VL 3/13 D-5,3	VKBA 5033	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	
•	VL 3/15 D-6,5	VKBA 5034	•	VKHB 2066 VKHB 2068	33214/Q 33210/Q	VKS 6175 -	
•	VL 3/4-5	-	•	- VKHB 2064	- 529656	VKS 6157 -	
•	VL 4/3-6	-	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	
○	HL 4/035 D-10,6, HL 4/06 D-12	VKBA 5056	•	VKHB 2124 VKHB 2158	33020/Q 33117/Q	VKS 6176 -	
○	HL 4/32 D-10,6	VKBA 5236	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6270 -	
○	HL 4/8-10, HL 5/2 S-10, HL 5/2 ZS-10, HL 5/2-10	VKBA 5052	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	

SK, 1600 Ser.

•	AL 7/1 D-7	VKBA 5166	•	VKHB 2172 VKHB 2161	331974 A/Q 32019 X/Q	VKS 6197 VKS 6194	
•	VD 4/14 DL-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
•	VD 4/20 DL-7,5	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
•	VD 4/20 DL-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
•	VL 3/8 D-6,5	VKBA 5034	•	VKHB 2066 VKHB 2068	33214/Q 33210/Q	VKS 6175 -	
•	VL 3/8-6	VKBA 5033	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	10)
•	VL 3/8-6	VKBA 5034	•	VKHB 2066 VKHB 2068	33214/Q 33210/Q	VKS 6175 -	11)



•	VL 4/10 DL-7,	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	
•	VL 4/10 D-7		•	VKHB 2068	33210/Q	VKS 6146	
•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VL 4/15 D-7,5,	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•	VL 4/16 D-7,5,		•	VKHB 2070	32310 J2/Q	-	
•	VL 4/19 D-7,5						
•	VL 4/2 D-7	-	•	-	-	VKS 6160	
•			•	VKHB 2070	32310 J2/Q	-	
•	VL 4/30 DL-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•			•	VKHB 2070	32310 J2/Q	-	
•	VL 4/7 D-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	13)
•			•	VKHB 2068	33210/Q	VKS 6146	
•	VL 4/7 D-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	28)
•			•	VKHB 2068	33210/Q	VKS 6146	
•	VL 4/7 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VL 4/7 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	14)
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VL 4/7 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	27)
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VL 4/8 D-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	
•			•	VKHB 2068	33210/Q	VKS 6146	
•	VL 4/9 D-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	13)
•			•	VKHB 2068	33210/Q	VKS 6146	
•	VL 4/9 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VL 4/9 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	14)
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VO 4/18 DL-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
○	HD 7/2 DLG-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HD 7/2 DLG-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HH 4/04 D-12,	VKBA 5056	•	VKHB 2124	33020/Q	VKS 6176	
○	HL 4/01 DL-10,		•	VKHB 2158	33117/Q	-	
○	HL 4/01 D-10,						
○	HL 4/01 L-10,						
○	HL 4/01-10,						
○	HL 4/06 DL-12,						
○	HL 4/06 D-12						
○	HL 4/8 D-10,	VKBA 5052	•	VKHB 2082	33019/Q	VKS 6154	
○	HL 4/8 L-10,		•	VKHB 2028	33215/Q	-	
○	HL 4/8-10,						
○	HL 5/2 ZL-10,						
○	HL 5/2 Z-10,						
○	HL 5/2-10						
○	HL 7/013 D-16	-	•	VKHB 2163	33022	VKS 6183	
○			•	VKHB 2165	33220	VKS 6181	



SK, 1600 Ser. .../...

○	HL 7/015 DL-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/015 DL-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/015 DS-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/015 DS-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/015 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/015 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/02 DL-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/02 DL-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/021 DL-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/021 DL-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/021 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/021 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/024 DL-12,3	VKBA 5376	•	VKHB 2162	33021/Q	VKS 6183	
○			•	VKHB 2082	33019/Q	VKS 6181	
○	HL 7/07 DL-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 DL-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 DL-11,5	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 DL-11,5	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 DS-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 DS-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 D-11,5	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 D-11,5	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	



	○	HL 7/1 DL-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/1 DL-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HL 7/1 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/1 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HL 7/1 L-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/1 L-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HL 7/1 S-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/1 S-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HL 7/15 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HL 7/15 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	
	○	HL 7/18 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HL 7/18 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	
	○	HL 7/1-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/1-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HL 7/21 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/21 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HL 7/3 DL-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/3 DL-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HL 7/3 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/3 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
SK, 1700 Ser.	•	AL 7/1 D-7	VKBA 5166	•	VKHB 2172	331974 A/Q	VKS 6197	
	•			•	VKHB 2161	32019 X/Q	VKS 6194	
	•	VD 4/20 DL-7,5, VD 4/26 DL-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
	•			•	VKHB 2070	32310 J2/Q	-	
	•	VL 3/15 D-6,5	VKBA 5034	•	VKHB 2066	33214/Q	VKS 6175	
	•			•	VKHB 2068	33210/Q	-	

# MERCEDES-BENZ



SK, 1700 Ser. .../...

•	VL 4/10 DL-7, VL 4/10 D-7	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
•	VL 4/16 D-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
•	VL 4/23 D-6,7, VL 4/24 D-6,7, VL 4/24 D-7,1, VL 4/25 DL-6,7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
•	VL 4/27 D-7,5, VL 4/28 D-7,5, VL 4/29 D-7,5, VL 4/30 DL-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
•	VL 4/31 DL-7,5	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
•	VL 4/31 DL-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
•	VL 4/8 D-7	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
•	VL 5/2 D-9	VKBA 5237	•	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6270 -	
○	HD 7/016 DG-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○	HD 7/016 DG-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○	HL 4/038 D-12, HL 4/039 D-12, HL 4/06 DL-12, HL 4/06 D-12	VKBA 5056	•	VKHB 2124 VKHB 2158	33020/Q 33117/Q	VKS 6176 -	
○	HL 7/013 D-16	-	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6183 VKS 6181	
○	HL 7/015 DL-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○	HL 7/015 DL-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○	HL 7/015 D-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○	HL 7/015 D-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○	HL 7/024 DL-12,3, HL 7/024 D-12,3, HL 7/025 D-12,3	VKBA 5376	•	VKHB 2162 VKHB 2082	33021/Q 33019/Q	VKS 6183 VKS 6181	
○	HL 7/07 DL-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/07 DL-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/07 DL-11,5	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)



SK, 1700 Ser. .../...

○	HL 7/07 DL-11,5	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 D-11,5	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 D-11,5	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 D-11,5	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 D-11,5	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/18 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/18 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/26 DL-12,3, HL 7/26 D-12,3	VKBA 5376	•	VKHB 2162	33021/Q	VKS 6183	
○			•	VKHB 2082	33019/Q	VKS 6181	
○	HL 7/3 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/3 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	

SK, 1800 Ser.

•	AL 7/1 D-7, AL 7/1 D-7,637, AL 7/1 D-7/5,217	VKBA 5166	•	VKHB 2172	331974 A/Q	VKS 6197	
•			•	VKHB 2161	32019 X/Q	VKS 6194	
•	VD 4/26 DL-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•			•	VKHB 2070	32310 J2/Q	-	
•	VL 3/15 D-6,5	VKBA 5034	•	VKHB 2066	33214/Q	VKS 6175	
•			•	VKHB 2068	33210/Q	-	
•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VL 4/16 D-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•			•	VKHB 2070	32310 J2/Q	-	
•	VL 4/23 D-6,7, VL 4/24 D-6,7, VL 4/24 D-7,1, VL 4/25 DL-6,7, VL 4/25 DL-7,1	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VL 4/27 D-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•			•	VKHB 2070	32310 J2/Q	-	
•	VL 4/27 D-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	24)
•			•	VKHB 2070	32310 J2/Q	-	
•	VL 4/28 D-7,5, VL 4/29 D-7,5, VL 4/30 DL-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•			•	VKHB 2070	32310 J2/Q	-	



# MERCEDES-BENZ



SK, 1800 Ser. .../...

•	VL 4/31 DL-7,5	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VL 4/31 DL-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•			•	VKHB 2070	32310 J2/Q	-	
•	VL 4/36 D-6,7, VL 4/38 D-7,1	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VL 5/1 D-9	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	
•			•	VKHB 2002	32311 J2	-	
•	VL 5/2 D-9	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	
•			•	VKHB 2002	32311 J2	-	
•		VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	
•			•	VKHB 2002	32311 J2	-	
○	HL 4/038 D-12, HL 4/039 D-12, HL 4/06 DL-12, HL 4/06 D-12	VKBA 5056	•	VKHB 2124	33020/Q	VKS 6176	
○			•	VKHB 2158	33117/Q	-	
○	HL 7/013 D-16	-	•	VKHB 2163	33022	VKS 6183	
○			•	VKHB 2165	33220	VKS 6181	
○	HL 7/015 DL-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/015 DL-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/015 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/015 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/024 DL- 12,3, HL 7/024 D-12,3, HL 7/025 D-12,3	VKBA 5376	•	VKHB 2162	33021/Q	VKS 6183	
○			•	VKHB 2082	33019/Q	VKS 6181	
○	HL 7/07 DL-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 DL-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 DL-11,5	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 DL-11,5	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/07 DL-11,5	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 DL-11,5	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/07 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 D-11,5	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	



	○	HL 7/07 D-11,5	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HL 7/07	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○	D-11.5/4.572		•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/07	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○	D-11.5/4.572		•	VKHB 2161	32019 X/Q	-	
	○	HL 7/07 D-11,5	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/07 D-11,5	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HL 7/26 DL-12,3, HL 7/26 D-12,3	VKBA 5376	•	VKHB 2162	33021/Q	VKS 6183	
	○			•	VKHB 2082	33019/Q	VKS 6181	
	○	NR 4/11 DL-7,5	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	○			•	VKHB 2070	32310 J2/Q	VKS 6146	
	○	NR 4/22-8, NS 4/11 D-10	VKBA 5052	•	VKHB 2082	33019/Q	VKS 6154	
	○			•	VKHB 2028	33215/Q	-	
SK, 1900 Ser.	•	AL 7/1 D-7	VKBA 5166	•	VKHB 2172	331974 A/Q	VKS 6197	
	•			•	VKHB 2161	32019 X/Q	VKS 6194	
	•	VD 4/14 DL-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2070	32310 J2/Q	VKS 6146	
	•	VD 4/20 DL-7,5	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2068	33210/Q	VKS 6146	
	•	VD 4/20 DL-7,5, VD 4/26 DL-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
	•			•	VKHB 2070	32310 J2/Q	-	
	•	VL 3/8 D-6,5	VKBA 5034	•	VKHB 2066	33214/Q	VKS 6175	
	•			•	VKHB 2068	33210/Q	-	
	•	VL 3/8-6	VKBA 5033	•	VKHB 2066	33214/Q	VKS 6175	10)
	•			•	VKHB 2067	33209/Q	-	
	•	VL 3/8-6	VKBA 5034	•	VKHB 2066	33214/Q	VKS 6175	11)
	•			•	VKHB 2068	33210/Q	-	
	•	VL 4/10 D-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2068	33210/Q	VKS 6146	
	•	VL 4/10 D-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	13)
	•			•	VKHB 2068	33210/Q	VKS 6146	
	•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2070	32310 J2/Q	VKS 6146	
	•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	14)
	•			•	VKHB 2070	32310 J2/Q	VKS 6146	
	•	VL 4/15 D-7,5, VL 4/16 D-7,5, VL 4/19 D-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
	•			•	VKHB 2070	32310 J2/Q	-	
	•	VL 4/2 D-7	-	•	-	-	VKS 6160	
	•			•	VKHB 2070	32310 J2/Q	-	
	•	VL 4/23 D-6,7, VL 4/24 D-6,7, VL 4/25 DL-6,7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2070	32310 J2/Q	VKS 6146	

# MERCEDES-BENZ



SK, 1900 Ser. .../...

•	VL 4/27 D-7,5, VL 4/28 D-7,5, VL 4/29 D-7,5, VL 4/31 DL-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
•	VL 4/7 D-7	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	13)
•	VL 4/7 D-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
•	VL 4/7 D-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	14)
•	VL 4/8 D-7	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
•	VL 4/9 D-7	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	13)
•	VL 4/9 D-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
•	VL 4/9 D-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	14)
•	VL 5/1 D-9, VL 5/2 D-9	VKBA 5237	•	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6270 -	
○	HD 7/016 DG-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○	HD 7/016 DG-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○	HL 7/013 D-16	-	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6183 VKS 6181	
○	HL 7/015 DL-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○	HL 7/015 DL-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○	HL 7/015 DS-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○	HL 7/015 DS-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○	HL 7/015 D-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○	HL 7/015 D-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○	HL 7/07 DL-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/07 DL-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/07 D-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/07 D-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)



	○	HL 7/15 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HL 7/15 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	
	○	HL 7/18 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HL 7/18 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	
	○	HL 7/1-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/1-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	NS 4/11 D-10	VKBA 5052	•	VKHB 2082	33019/Q	VKS 6154	
	○			•	VKHB 2028	33215/Q	-	
SK, 2000 Ser.	•	AL 7/1 D-7,	VKBA 5166	•	VKHB 2172	331974 A/Q	VKS 6197	
	•	AL 7/1 D-7,637,		•	VKHB 2161	32019 X/Q	VKS 6194	
	•	AL 7/1 D-7,769,						
	•	AL 7/1 D-7/5,217						
	•	VD 4/14 DL-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2070	32310 J2/Q	VKS 6146	
	•	VD 4/20 DL-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
	•			•	VKHB 2070	32310 J2/Q	-	
	•	VL 3/13 D-5,3	VKBA 5033	•	VKHB 2066	33214/Q	VKS 6175	
	•			•	VKHB 2067	33209/Q	-	
	•	VL 4/10 D-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2068	33210/Q	VKS 6146	
	•	VL 4/10 D-7,	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	•	VL 4/14 D-7		•	VKHB 2070	32310 J2/Q	VKS 6146	
	•	VL 4/16 D-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
	•			•	VKHB 2070	32310 J2/Q	-	
	•	VL 4/23 D-6,7,	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	•	VL 4/24 D-6,7,		•	VKHB 2070	32310 J2/Q	VKS 6146	
	•	VL 4/24 D-7,1						
	•	VL 4/27 D-7,5,	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
	•	VL 4/28 D-7,5		•	VKHB 2070	32310 J2/Q	-	
	•	VL 4/9 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2070	32310 J2/Q	VKS 6146	
	•	VL 5/1 D-9	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	
	•			•	VKHB 2002	32311 J2	-	
	•	VL 5/1 D-9	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	
	•			•	VKHB 2002	32311 J2	-	
	•	VL 5/2 D-9	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	
	•			•	VKHB 2002	32311 J2	-	
	○	HD 7/014 DGS-16	-	•	VKHB 2163	33022	VKS 6183	
	○			•	VKHB 2165	33220	VKS 6181	
	○	HD 7/19 DG-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	

# MERCEDES-BENZ



SK, 2000 Ser. .../...

○	HD 7/19 DG-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HD 7/2 DG-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HD 7/2 DG-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 4/01 D-10	VKBA 5056	•	VKHB 2124	33020/Q	VKS 6176	
○			•	VKHB 2158	33117/Q	-	
○	HL 4/32 D-10,6	VKBA 5236	•	VKHB 2082	33019/Q	VKS 6270	
○			•	VKHB 2028	33215/Q	-	
○	HL 7/013 D-16	-	•	VKHB 2163	33022	VKS 6183	
○			•	VKHB 2165	33220	VKS 6181	
○	HL 7/015 DL-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/015 DL-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/015 DS-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/015 DS-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/015 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/015 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/015	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○	D-13/4,572		•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/015	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○	D-13/4,572		•	VKHB 2164	30220 J2	-	
○	HL 7/021 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/021 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 DL-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 DL-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 DS-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 DS-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/1 DL-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	



	○	HL 7/1 DL-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
	○	HL 7/18 D-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
	○	HL 7/18 D-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
SK, 2200 Ser.	•	VD 4/14 DL-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
	•	VD 4/20 DL-7,5	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
	•	VD 4/20 DL-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
	•	VL 3/8 D-6,5	VKBA 5034	•	VKHB 2066 VKHB 2068	33214/Q 33210/Q	VKS 6175 -	
	•	VL 3/8-6	VKBA 5033	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	10)
	•	VL 3/8-6	VKBA 5034	•	VKHB 2066 VKHB 2068	33214/Q 33210/Q	VKS 6175 -	11)
	•	VL 4/10 DL-7, VL 4/10 D-7	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
	•	VL 4/10 D-7	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	13)
	•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
	•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	14)
	•	VL 4/15 D-7,5, VL 4/16 D-7,5, VL 4/28 D-7,5, VL 4/30 DL-7,5, VL 4/30 D-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
	•	VL 4/8 D-7, VL 4/9 D-7	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
	•	VL 4/9 D-7	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	13)
	•	VL 4/9 D-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
	•	VL 4/9 D-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	14)
	○	HD 4/02 DG-10, HD 4/02 GD-10, HD 4/03 D-10, HD 4/2 DG-10	VKBA 5056	•	VKHB 2124 VKHB 2158	33020/Q 33117/Q	VKS 6176 -	
	○	HD 4/21 DG-10, HD 4/21 G-10, HD 4/22 DG-10, HD 4/22 D-10, HD 4/22-10	VKBA 5052	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	



SK, 2200 Ser. .../...

○	HD 7/09 DG-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HD 7/09 DG-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HD 7/11 DG-9	VKBA 5057	•	VKHB 2160	32021 X/Q	VKS 6183	
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HD 7/19 DG-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HD 7/19 DG-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HD 7/2 DG-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HD 7/2 DG-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HD 7/2 DLG-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HD 7/2 DLG-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HD 7/5 DG-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HD 7/5 DG-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 4/01 DL-10, HL 4/01 D-10, HL 4/01-10, HL 4/06 DL-12, HL 4/06 D-12	VKBA 5056	•	VKHB 2124	33020/Q	VKS 6176	
○			•	VKHB 2158	33117/Q	-	
○	HL 5/2 ZL-10	VKBA 5052	•	VKHB 2082	33019/Q	VKS 6154	
○			•	VKHB 2028	33215/Q	-	
○	HL 7/015 DS-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/015 DS-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/015 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/015 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/021 DL-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/021 DL-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/021 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/021 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/024 DL-12,3	VKBA 5376	•	VKHB 2162	33021/Q	VKS 6183	
○			•	VKHB 2082	33019/Q	VKS 6181	



○	HL 7/07 DL-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 DL-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 DS-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 DS-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/1 DL-10	VKBA 5032	•	VKHB 2051	33213/Q	VKS 6157	26)
○			•	VKHB 2065	33208/Q	-	
○	HL 7/1 DL-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/1 DL-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/1 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/1 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/1 L-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/1 L-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/10 D-9	VKBA 5057	•	VKHB 2160	32021 X/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/18 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/18 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/1-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/1-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/3 DL-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/3 DL-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/3 DS-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/3 DS-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/3 D-10	VKBA 5032	•	VKHB 2051	33213/Q	VKS 6157	26)
○			•	VKHB 2065	33208/Q	-	



# MERCEDES-BENZ



SK, 2200 Ser. .../...

○	HL 7/3 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/3 D-10,	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○	HL 7/3 D-10		•	VKHB 2161	32019 X/Q	-	
○	HL 7/4 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/4 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL7/2 DG-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL7/2 DG-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	NR 4/10 DL-6	-	•	-	-	VKS 6160	
○			•	VKHB 2070	32310 J2/Q	-	
○	NR 4/10 DL-6,	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
○	NR 4/11 DL-7,5		•	VKHB 2070	32310 J2/Q	VKS 6146	
○	NS 4/10 D-6	-	•	-	-	VKS 6160	
○			•	VKHB 2070	32310 J2/Q	-	
○	NS 4/10 D-6,7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	
○			•	VKHB 2068	33210/Q	VKS 6146	
○	NS 4/11 D-10	VKBA 5052	•	VKHB 2082	33019/Q	VKS 6154	
○			•	VKHB 2028	33215/Q	-	

SK, 2300 Ser.

•	VD 4/26 DL-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•			•	VKHB 2070	32310 J2/Q	-	
○	HD 7/5 DG-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HD 7/5 DG-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	

SK, 2400 Ser.

•	VD 4/14 DL-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VD 4/20 DL-7,5,	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•	VD 4/26 DL-7,5		•	VKHB 2070	32310 J2/Q	-	
•	VL 4/10 DL-7,	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	
•	VL 4/10 D-7		•	VKHB 2068	33210/Q	VKS 6146	
•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VL 4/15 D-7,5,	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•	VL 4/16 D-7,5		•	VKHB 2070	32310 J2/Q	-	
•	VL 4/23 D-6,7,	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•	VL 4/24 D-6,7,		•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VL 4/24 D-7,1,						
•	VL 4/25 DL-6,7						
•	VL 4/27 D-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•			•	VKHB 2070	32310 J2/Q	-	
•	VL 4/28 D-7,5	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•			•	VKHB 2070	32310 J2/Q	VKS 6146	



•		VL 4/28 D-7,5, VL 4/29 D-7,5, VL 4/30 DL-7,5, VL 4/30 D-7,5, VL 4/31 DL-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
•		VL 4/9 D-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
•		VL 5/2 D-9	VKBA 5237	•	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6270 -	
○		HD 4/21 DG-10, HD 4/22 D-10	VKBA 5052	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	
○		HD 7/016 DG-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○		HD 7/016 DG-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○		HD 7/09 DG-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○		HD 7/09 DG-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○		HD 7/19 DG-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○		HD 7/19 DG-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○		HD 7/2 DG-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○		HD 7/2 DG-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○		HD 7/5 DG-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○		HD 7/5 DG-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○		HL 4/038 D-12, HL 4/039 DL-12, HL 4/039 D-12, HL 4/06 DL-12, HL 4/06 D-12	VKBA 5056	•	VKHB 2124 VKHB 2158	33020/Q 33117/Q	VKS 6176 -	
○		HL 7/015 DL-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○		HL 7/015 DL-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○		HL 7/015 D-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○		HL 7/015 D-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○		HL 7/021 D-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○		HL 7/021 D-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)

# MERCEDES-BENZ



SK, 2400 Ser. .../...

○	HL 7/024 DL- 12,3, HL 7/024 D-12,3, HL 7/025 D-12,3	VKBA 5376	• •	VKHB 2162 VKHB 2082	33021/Q 33019/Q	VKS 6183 VKS 6181	
○	HL 7/07 DL-10	VKBA 5058	• •	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/07 DL-10	VKBA 5302	• •	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/07 DL-11,5	VKBA 5058	• •	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/07 DL-11,5	VKBA 5302	• •	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/07 D-10	VKBA 5058	• •	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/07 D-10	VKBA 5302	• •	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/07 D-11,5	VKBA 5058	• •	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/07 D-11,5	VKBA 5302	• •	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/07 D-11,5	VKBA 5058	• •	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/07 D-11,5	VKBA 5302	• •	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/26 DL-12,3	VKBA 5058	• •	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/26 DL-12,3	VKBA 5302	• •	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/26 DL-12,3, HL 7/26 D-12,3	VKBA 5376	• •	VKHB 2162 VKHB 2082	33021/Q 33019/Q	VKS 6183 VKS 6181	
○	HL 7/3 D-10	VKBA 5058	• •	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/3 D-10	VKBA 5302	• •	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/4 D-10	VKBA 5058	• •	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/4 D-10	VKBA 5302	• •	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	NR 4/11 DL-7,5	VKBA 5038	• •	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
○	NS 4/10 D-6,7	VKBA 5037	• •	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
○	NS 4/11 D-10	VKBA 5052	• •	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	



SK, 2500 Ser.

•		VD 4/26 DL-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•				•	VKHB 2070	32310 J2/Q	-	
•		VL 4/10 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•				•	VKHB 2070	32310 J2/Q	VKS 6146	
•		VL 4/16 D-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•				•	VKHB 2070	32310 J2/Q	-	
•		VL 4/23 D-6,7, VL 4/24 D-6,7, VL 4/25 DL-6,7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•				•	VKHB 2070	32310 J2/Q	VKS 6146	
•		VL 4/27 D-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•				•	VKHB 2070	32310 J2/Q	-	
•		VL 4/28 D-7,5	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•				•	VKHB 2070	32310 J2/Q	VKS 6146	
•		VL 4/28 D-7,5, VL 4/29 D-7,5, VL 4/30 DL-7,5, VL 4/30 D-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•				•	VKHB 2070	32310 J2/Q	-	
•		VL 4/31 DL-7,5	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•				•	VKHB 2070	32310 J2/Q	VKS 6146	
•		VL 4/31 DL-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•				•	VKHB 2070	32310 J2/Q	-	
•		VL 4/36 D-6,7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•				•	VKHB 2070	32310 J2/Q	VKS 6146	
•		VL 5/1 D-9, VL 5/2 D-9	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	
•				•	VKHB 2002	32311 J2	-	
•		VL 5/21 DC-9	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	
•				•	VKHB 2002	32311 J2	-	
○		HD 4/02 GD-10, HD 4/03 D-10	VKBA 5056	•	VKHB 2124	33020/Q	VKS 6176	
○				•	VKHB 2158	33117/Q	-	
○		HD 4/21 DG-10, HD 4/22 D-10	VKBA 5052	•	VKHB 2082	33019/Q	VKS 6154	
○				•	VKHB 2028	33215/Q	-	
○		HD 7/016 DG-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○				•	VKHB 2164	30220 J2	VKS 6181	
○		HD 7/016 DG-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○				•	VKHB 2164	30220 J2	-	
○		HD 7/09 DG-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○				•	VKHB 2161	32019 X/Q	VKS 6181	
○		HD 7/09 DG-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○				•	VKHB 2161	32019 X/Q	-	
○		HD 7/19 DG-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○				•	VKHB 2164	30220 J2	VKS 6181	
○		HD 7/19 DG-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○				•	VKHB 2164	30220 J2	-	
○		HD 7/2 DG-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○				•	VKHB 2161	32019 X/Q	VKS 6181	
○		HD 7/2 DG-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○				•	VKHB 2161	32019 X/Q	-	



SK, 2500 Ser. .../...

○	HD 7/4	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○	D-10/ 3, 978		•	VKHB 2161	32019 X/Q	VKS 6181	
○	HD 7/4	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○	D-10/ 3, 978		•	VKHB 2161	32019 X/Q	-	
○	HD 7/5 DG-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HD 7/5 DG-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HD 7/5	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○	DG-10/ 3, 978		•	VKHB 2161	32019 X/Q	VKS 6181	
○	HD 7/5	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○	DG-10/ 3, 978		•	VKHB 2161	32019 X/Q	-	
○	HL 4/038 D-12,	VKBA 5056	•	VKHB 2124	33020/Q	VKS 6176	
○	HL 4/039 DL-12,		•	VKHB 2158	33117/Q	-	
○	HL 4/039 D-12,						
○	HL 4/06 DL-12,						
○	HL 4/06 D-12						
○	HL 7/015 DL-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/015 DL-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/015 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/015 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/024 DL-12,3,	VKBA 5376	•	VKHB 2162	33021/Q	VKS 6183	
○	HL 7/024 D-12,3,		•	VKHB 2082	33019/Q	VKS 6181	
○	HL 7/025 D-12,3						
○	HL 7/07 DL-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 DL-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 DL-11,5	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 DL-11,5	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/07 DL-11,5	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 DL-11,5	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HL 7/07 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 7/07 D-11.5	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HL 7/07 D-11.5	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	



	○	HL 7/07 D-11,5	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/07 D-11,5	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HL 7/15 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HL 7/15 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	
	○	HL 7/18 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HL 7/18 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	
	○	HL 7/26 DL-12,3, HL 7/26 D-12,3	VKBA 5376	•	VKHB 2162	33021/Q	VKS 6183	
	○			•	VKHB 2082	33019/Q	VKS 6181	
	○	HL 7/3 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/3 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HL 7/4 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/4 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	NR 4/11 DL-7,5	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	○			•	VKHB 2070	32310 J2/Q	VKS 6146	
	○	NS 4/10 D-6,7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	
	○			•	VKHB 2068	33210/Q	VKS 6146	
	○	NS 4/11 D-10	VKBA 5052	•	VKHB 2082	33019/Q	VKS 6154	
	○			•	VKHB 2028	33215/Q	-	
SK, 2600 Ser.	•	AL 7/1 D-7, AL 7/1 D-7,637, AL 7/1 D-7,769, AL 7/1 D-7/5,217	VKBA 5166	•	VKHB 2172	331974 A/Q	VKS 6197	
	•			•	VKHB 2161	32019 X/Q	VKS 6194	
	•	VD 4/14 DL-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2070	32310 J2/Q	VKS 6146	
	•	VD 4/20 DL-7,5, VD 4/26 DL-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
	•			•	VKHB 2070	32310 J2/Q	-	
	•	VL 4/10 D-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2068	33210/Q	VKS 6146	
	•	VL 4/10 D-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	13)
	•			•	VKHB 2068	33210/Q	VKS 6146	
	•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2070	32310 J2/Q	VKS 6146	
	•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	14)
	•			•	VKHB 2070	32310 J2/Q	VKS 6146	
	•	VL 4/15 D-7,5, VL 4/16 D-7,5, VL 4/19 D-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
	•			•	VKHB 2070	32310 J2/Q	-	

# MERCEDES-BENZ



SK, 2600 Ser. .../...

•	VL 4/2 D-7	-	•	-	-	VKS 6160	
•			•	VKHB 2070	32310 J2/Q	-	
•	VL 4/23 D-6,7,	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•	VL 4/24 D-6,7,		•	VKHB 2070	32310 J2/Q	VKS 6146	
	VL 4/25 DL-6,7						
•	VL 4/27 D-7,5,	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•	VL 4/28 D-7,5,		•	VKHB 2070	32310 J2/Q	-	
	VL 4/29 D-7,5,						
	VL 4/31 DL-7,5						
•	VL 4/7 D-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	13)
•			•	VKHB 2068	33210/Q	VKS 6146	
•	VL 4/7 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	14)
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VL 4/8 D-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	
•			•	VKHB 2068	33210/Q	VKS 6146	
•	VL 4/9 D-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	13)
•			•	VKHB 2068	33210/Q	VKS 6146	
•	VL 4/9 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VL 4/9 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	14)
•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	VL 5/1 D-9,	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	
•	VL 5/2 D-9		•	VKHB 2002	32311 J2	-	
○	HD 4/02 GD-10,	VKBA 5056	•	VKHB 2124	33020/Q	VKS 6176	
○	HD 4/03 D-10		•	VKHB 2158	33117/Q	-	
○	HD 7/014 DGS-16	-	•	VKHB 2163	33022	VKS 6183	
○			•	VKHB 2165	33220	VKS 6181	
○	HD 7/016 DG-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HD 7/016 DG-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HD 7/19 DG-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HD 7/19 DG-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	
○	HD 7/2 DG-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
○			•	VKHB 2161	32019 X/Q	VKS 6181	
○	HD 7/2 DG-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
○			•	VKHB 2161	32019 X/Q	-	
○	HL 4/01 DL-10	VKBA 5056	•	VKHB 2124	33020/Q	VKS 6176	
○			•	VKHB 2158	33117/Q	-	
○	HL 7/013 D-16	-	•	VKHB 2163	33022	VKS 6183	
○			•	VKHB 2165	33220	VKS 6181	
○	HL 7/015 DL-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
○			•	VKHB 2164	30220 J2	VKS 6181	
○	HL 7/015 DL-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
○			•	VKHB 2164	30220 J2	-	



	○	HL 7/015 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HL 7/015 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	
	○	HL 7/016 DG-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HL 7/016 DG-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	
	○	HL 7/07 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/07 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HL 7/18 DS-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HL 7/18 DS-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	
	○	HL 7/18 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HL 7/18 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	
	○	HL 7/1-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/1-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HL 7/3 D-10	VKBA 5032	•	VKHB 2051	33213/Q	VKS 6157	26)
	○			•	VKHB 2065	33208/Q	-	
	○	HL 7/3 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/3 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
	○	HL7/015 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HL7/015 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	
SK, 2800 Ser.	•	VD 4/20 DL-7,5	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2068	33210/Q	VKS 6146	
	•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2070	32310 J2/Q	VKS 6146	
	•	VL 4/16 D-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
	•			•	VKHB 2070	32310 J2/Q	-	



# MERCEDES-BENZ



SK, 3000 Ser.

•	•	VD 4/20 DL-7,5	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	
•	•			•	VKHB 2068	33210/Q	VKS 6146	
•	•	VD 4/20 DL-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•	•			•	VKHB 2070	32310 J2/Q	-	
•	•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•	•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	•	VL 4/15 D-7,5, VL 4/16 D-7,5, VL 4/27 D-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•	•			•	VKHB 2070	32310 J2/Q	-	
•	•	VL 4/9 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•	•			•	VKHB 2070	32310 J2/Q	VKS 6146	
•	•	VL 5/2 D-9	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	
•	•			•	VKHB 2002	32311 J2	-	
•	•	HD 7/014 DGS-16	-	•	VKHB 2163	33022	VKS 6183	
•	•			•	VKHB 2165	33220	VKS 6181	
•	•	HD 7/016 DG-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
•	•			•	VKHB 2164	30220 J2	VKS 6181	
•	•	HD 7/016 DG-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
•	•			•	VKHB 2164	30220 J2	-	
•	•	HD 7/2 DG-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
•	•			•	VKHB 2161	32019 X/Q	VKS 6181	
•	•	HD 7/2 DG-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
•	•			•	VKHB 2161	32019 X/Q	-	
•	•	HD 7/5 DG-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
•	•			•	VKHB 2161	32019 X/Q	VKS 6181	
•	•	HD 7/5 DG-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
•	•			•	VKHB 2161	32019 X/Q	-	
•	•	HL 7/013 D-16	-	•	VKHB 2163	33022	VKS 6183	
•	•			•	VKHB 2165	33220	VKS 6181	
•	•	HL 7/015 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
•	•			•	VKHB 2164	30220 J2	VKS 6181	
•	•	HL 7/015 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
•	•			•	VKHB 2164	30220 J2	-	
•	•	HL 7/3 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
•	•			•	VKHB 2161	32019 X/Q	VKS 6181	
•	•	HL 7/3 D-10, HL 7/3 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
•	•			•	VKHB 2161	32019 X/Q	-	
•	•	HL 7/4 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
•	•			•	VKHB 2161	32019 X/Q	VKS 6181	
•	•	HL 7/4 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
•	•			•	VKHB 2161	32019 X/Q	-	

SK, 3200 Ser.

•	•	AL 7/1 D-7	VKBA 5166	•	VKHB 2172	331974 A/Q	VKS 6197	
•	•			•	VKHB 2161	32019 X/Q	VKS 6194	
•	•	VD 4/20 DL-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
•	•			•	VKHB 2070	32310 J2/Q	-	
•	•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
•	•			•	VKHB 2070	32310 J2/Q	VKS 6146	



•		VL 4/15 D-7,5, VL 4/16 D-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
•		VL 4/23 D-6,7, VL 4/24 D-6,7, VL 4/25 DL-6,7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
•		VL 4/27 D-7,5, VL 4/28 D-7,5, VL 4/29 D-7,5, VL 4/30 DL-7,5, VL 4/30 D-7,5, VL 4/31 DL-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
○		HD 7/014 DGS-16, HD 7/014 DG-16	-	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6183 VKS 6181	
○		HD 7/016 DG-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○		HD 7/016 DG-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○		HD 7/19 DG-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○		HD 7/19 DG-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○		HD 7/2 DG-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○		HD 7/2 DG-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○		HD 7/5 DG-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○		HD 7/5 DG-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○		HL 4/06 D-12	VKBA 5056	•	VKHB 2124 VKHB 2158	33020/Q 33117/Q	VKS 6176 -	
○		HL 7/013 D-16	-	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6183 VKS 6181	
○		HL 7/015 DL-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○		HL 7/015 DL-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○		HL 7/015 D-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○		HL 7/015 D-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○		HL 7/18 D-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○		HL 7/18 D-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○		HL 7/3 D-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)

# MERCEDES-BENZ



SK, 3200 Ser. .../...

○	HL 7/3 D-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/4 D-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HL 7/4 D-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	NR 4/11 DL-7,5	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
○	NS 4/11 D-10	VKBA 5052	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	

SK, 3300 Ser.

•	AL 7/1 D-7	VKBA 5166	•	VKHB 2172 VKHB 2161	331974 A/Q 32019 X/Q	VKS 6197 VKS 6194	
•	VD 4/20 DL-7,5	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
•	VD 4/20 DL-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
•	VL 4/15 D-7,5, VL 4/16 D-7,5, VL 4/27 D-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
•	VL 5/1 D-9	VKBA 5371	•	VKHB 2002 VKHB 2002	32311 J2 32311 J2	VKS 6150 -	
•	VL 5/2 D-9	VKBA 5237	•	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6270 -	
•	VL 5/20 DC-9, VL 5/21 DC-9	VKBA 5371	•	VKHB 2002 VKHB 2002	32311 J2 32311 J2	VKS 6150 -	
○	HD 7/016 DG-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○	HD 7/016 DG-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○	HD 7/19 DG-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○	HD 7/19 DG-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○	HD 7/2 DG-10	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
○	HD 7/2 DG-10	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
○	HL 7/015 D-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○	HL 7/015 D-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
○	HL 7/016 DG-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
○	HL 7/016 DG-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)



	○	HL 7/18 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HL 7/18 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	
	○	HL 7/3 D-10	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
	○			•	VKHB 2161	32019 X/Q	VKS 6181	
	○	HL 7/3 D-10	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
	○			•	VKHB 2161	32019 X/Q	-	
SK, 3500 Ser.	•	AL 7/1 D-7	VKBA 5166	•	VKHB 2172	331974 A/Q	VKS 6197	
	•			•	VKHB 2161	32019 X/Q	VKS 6194	
	•	VD 4/20 DL-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
	•			•	VKHB 2070	32310 J2/Q	-	
	•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2070	32310 J2/Q	VKS 6146	
	•	VL 4/15 D-7,5, VL 4/16 D-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
	•			•	VKHB 2070	32310 J2/Q	-	
	•	VL 4/23 D-6,7, VL 4/24 D-6,7, VL 4/25 DL-6,7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2070	32310 J2/Q	VKS 6146	
	•	VL 4/27 D-7,5, VL 4/28 D-7,5, VL 4/29 D-7,5, VL 4/31 DL-7,5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
	•			•	VKHB 2070	32310 J2/Q	-	
	•	VL 5/1 D-9, VL 5/2 D-9	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	
	•			•	VKHB 2002	32311 J2	-	
	•	VO 4/22 DLE-6,6	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	•			•	VKHB 2070	32310 J2/Q	VKS 6146	
	○	HD 7/014 DGS-16	-	•	VKHB 2163	33022	VKS 6183	
	○			•	VKHB 2165	33220	VKS 6181	
	○	HD 7/016 DG-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HD 7/016 DG-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	
	○	HD 7/19 DG-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HD 7/19 DG-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	
	○	HL 7/013 D-16	-	•	VKHB 2163	33022	VKS 6183	
	○			•	VKHB 2165	33220	VKS 6181	
	○	HL 7/015 DL-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HL 7/015 DL-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	
	○	HL 7/015 D-13	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
	○			•	VKHB 2164	30220 J2	VKS 6181	
	○	HL 7/015 D-13	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
	○			•	VKHB 2164	30220 J2	-	

# MERCEDES-BENZ



SK, 3500 Ser. .... / ...	○	HL 7/016 DG-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
		○	HL 7/016 DG-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -
	○	HL 7/18 D-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
		○	HL 7/18 D-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -
	○	NR 4/11 DL-7,5	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
		○						
SK, 3600 Ser.	•	VD 4/20 DL-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
		•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146
	•	VL 4/16 D-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
		○	HD 7/19 DG-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181
	○	HD 7/19 DG-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
		○						
SK, 3800 Ser.	•	VD 4/20 DL-7,5, VL 4/16 D-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
		○	HD 7/014 DGS-16, HD 7/014 DG-16, HL 7/013 D-16	-	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6183 VKS 6181
	○							
SK, 4000 Ser.	•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
		•	VL 4/16 D-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -
	○	HD 7/014 DGS-16	-	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6183 VKS 6181	
		○	HD 7/016 DG-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181
	○	HD 7/016 DG-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
		○	HL 7/013 D-16	-	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6183 VKS 6181
	○	HL 7/015 D-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
		○	HL 7/015 D-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -
	○							
SK, 4100 Ser.	•	VL 4/27 D-7,5, VL 4/53 DC-7,5, VL 4/55 D-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	24)
		•	VL 5/1 D-9	VKBA 5371	•	VKHB 2002 VKHB 2002	32311 J2 32311 J2	VKS 6150 -
	•							



	○	HD 4/02 GD-10, HD 4/03 D-10	VKBA 5056	•	VKHB 2124 VKHB 2158	33020/Q 33117/Q	VKS 6176 -	
	○	HD 7/016 DG-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
	○	HD 7/016 DG-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
	○	HL 7/015 DL-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
	○	HL 7/015 DL-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
SK, 4400 Ser.	•	AL 7/1 D-7	VKBA 5166	•	VKHB 2172 VKHB 2161	331974 A/Q 32019 X/Q	VKS 6197 VKS 6194	
	•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
	•	VL 4/15 D-7,5, VL 4/16 D-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
	•	VL 4/25 DL-6,7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
	•	VL 4/27 D-7,5, VL 4/28 D-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
	•	VL 5/1 D-9	VKBA 5237	•	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6270 -	
	•	VL 5/2 D-9	VKBA 5237	•	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6270 -	
	○	HD 7/016 DG-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
	○	HD 7/016 DG-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
SK, 4800 Ser.	•	VL 4/10 D-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
	•	VL 4/15 D-7,5, VL 4/16 D-7,5, VL 4/27 D-7,5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
	•	VL 5/1 D-9, VL 5/2 D-9	VKBA 5237	•	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6270 -	
	○	HD 7/016 DG-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
	○	HD 7/016 DG-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
	○	HL 7/015 D-13	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
	○	HL 7/015 D-13	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)

# MERCEDES-BENZ



SK, 5000 Ser.

•

VL 4/27 D-7,5

VKBA 5039

•

VKHB 2072  
VKHB 2070

32314 J2/Q  
32310 J2/Q

VKS 6150  
-

•

VL 4/10 D-7

VKBA 5038

•

VKHB 2071  
VKHB 2070

332330 B/Q  
32310 J2/Q

VKS 6158  
VKS 6146

•

VL 4/15 D-7,5,  
VL 4/16 D-7,5

VKBA 5039

•

VKHB 2072  
VKHB 2070

32314 J2/Q  
32310 J2/Q

VKS 6150  
-

•

VL 4/23 D-6,7,  
VL 4/24 D-6,7

VKBA 5038

•

VKHB 2071  
VKHB 2070

332330 B/Q  
32310 J2/Q

VKS 6158  
VKS 6146

•

VL 4/27 D-7,5,  
VL 4/28 D-7,5

VKBA 5039

•

VKHB 2072  
VKHB 2070

32314 J2/Q  
32310 J2/Q

VKS 6150  
-

•

VL 5/1 D-9,  
VL 5/2 D-9

VKBA 5237

•

VKHB 2203  
VKHB 2002

JH 415647/JH 415610  
32311 J2

VKS 6270  
-

•

○ HD 7/014 DGS-16

-

•

VKHB 2163  
VKHB 2165

33022  
33220

VKS 6183  
VKS 6181

○

○ HD 7/016 DG-13

VKBA 5059

•

VKHB 2163  
VKHB 2164

33022  
30220 J2

VKS 6183  
VKS 6181

25)

○

○ HD 7/016 DG-13

VKBA 5341

•

VKHB 2163  
VKHB 2164

33022  
30220 J2

VKS 6334  
-

26)

○

○ HD 7/19 DG-13

VKBA 5059

•

VKHB 2163  
VKHB 2164

33022  
30220 J2

VKS 6183  
VKS 6181

25)

○

○ HD 7/19 DG-13

VKBA 5341

•

VKHB 2163  
VKHB 2164

33022  
30220 J2

VKS 6334  
-

26)

○

○ HL 7/015 DL-13

VKBA 5059

•

VKHB 2163  
VKHB 2164

33022  
30220 J2

VKS 6183  
VKS 6181

25)

○

○ HL 7/015 DL-13

VKBA 5341

•

VKHB 2163  
VKHB 2164

33022  
30220 J2

VKS 6334  
-

26)

○

○ HL 7/18 D-13

VKBA 5059

•

VKHB 2163  
VKHB 2164

33022  
30220 J2

VKS 6183  
VKS 6181

25)

○

○ HL 7/18 D-13

VKBA 5341

•

VKHB 2163  
VKHB 2164

33022  
30220 J2

VKS 6334  
-

26)

○

SK, 6000 Ser.

•

VL 4/10 D-7

VKBA 5038

•

VKHB 2071  
VKHB 2070

332330 B/Q  
32310 J2/Q

VKS 6158  
VKS 6146

•

VL 4/15 D-7,5,  
VL 4/16 D-7,5

VKBA 5039

•

VKHB 2072  
VKHB 2070

32314 J2/Q  
32310 J2/Q

VKS 6150  
-

ATEGO, 700 Ser.

•

VL 2/21 DC-3,5,

VKBA 5386

•

VKHB 2318  
VKHB 2317

33111 JR  
32306 JR

VKS 6346  
-

•

○ HL 2/43 DC-6.2

VKBA 5048

•

VKHB 2155  
VKHB 2156

331293/Q  
33011/Q

VKS 6172  
-

37)

○

ATEGO, 800 Ser.

•

VL 2/21 DC-3.5

VKBA 5386

•

VKHB 2318  
VKHB 2317

33111 JR  
32306 JR

VKS 6346  
-

•

VL 2/22 DC-4.1

VKBA 5386

•

VKHB 2318  
VKHB 2317

33111 JR  
32306 JR

VKS 6346  
-

•

○ HL 2/43 DC-6.2

VKBA 5048

•

VKHB 2155  
VKHB 2156

331293/Q  
33011/Q

VKS 6172  
-

37)

○

○ HL 4/40 DC-7

VKBA 5392

•

VKHB 2321  
VKHB 2044

33017/Q  
33014

VKS 6350  
-

38)

○



	○	HL 4/40 DC-7	VKBA 5393	•	VKHB 2124	33020/Q	VKS 6351	39)
	○			•	VKHB 2326	33116/Q	-	
	○	HL 4/40 DC-7	VKBA 5394	•	VKHB 2082	33019/Q	VKS 6352	40)
	○			•	VKHB 2170	32018 X/Q	-	
	○	HL 4/40 DC-7	VKBA 5395	•	VKHB 2041	580/572/Q	VKS 6178	41)
	○			•	VKHB 2328	504376 A	-	
ATEGO, 900 Ser.	•	VL 2/22 DC-4.1	VKBA 5386	•	VKHB 2318	33111 JR	VKS 6346	
	•			•	VKHB 2317	32306 JR	-	
	•	VL 3/21 DC-5.3	VKBA 5387	•	VKHB 2319	33213 JR	VKS 6347	
	•			•	VKHB 2320	33208 JR-1/33208 J	-	
	•	AL 3/40 D-4.7	-	•	VKHB 2321	33017/Q	VKS 6348	
	•			•	-	-	-	
	○	HL 2/43 DC-6.2	VKBA 5048	•	VKHB 2155	331293/Q	VKS 6172	37)
	○			•	VKHB 2156	33011/Q	-	
	○	HL 4/40 DC-7, HL 4/40 D-7, HL 4/40 DS-7.7	VKBA 5392	•	VKHB 2321	33017/Q	VKS 6350	38)
	○			•	VKHB 2044	33014	-	
	○	HL 4/40 DC-7, HL 4/40 D-7, HL 4/40 DS-7.7	VKBA 5393	•	VKHB 2124	33020/Q	VKS 6351	39)
	○			•	VKHB 2326	33116/Q	-	
	○	HL 4/40 DC-7, HL 4/40 D-7, HL 4/40 DS-7.7	VKBA 5394	•	VKHB 2082	33019/Q	VKS 6352	40)
	○			•	VKHB 2170	32018 X/Q	-	
	○	HL 4/40 DC-7, HL 4/40 D-7, HL 4/40 DS-7.7	VKBA 5395	•	VKHB 2041	580/572/Q	VKS 6178	41)
	○			•	VKHB 2328	504376 A	-	
ATEGO, 1000 Ser.	•	VL 2/22 DC-4.1	VKBA 5386	•	VKHB 2318	33111 JR	VKS 6346	
	•			•	VKHB 2317	32306 JR	-	
	•	VL 3/21 DC-5.3	VKBA 5387	•	VKHB 2319	33213 JR	VKS 6347	
	•			•	VKHB 2320	33208 JR-1/33208 J	-	
	•	AL 3/40 D-4.7	-	•	VKHB 2321	33017/Q	VKS 6348	
	•			•	-	-	-	
	○	HL 2/43 DC-6.2	VKBA 5048	•	VKHB 2155	331293/Q	VKS 6172	37)
	○			•	VKHB 2156	33011/Q	-	
	○	HL 4/40 DC-7, HL 4/40 D-7, HL 4/40 DS-7.7	VKBA 5392	•	VKHB 2321	33017/Q	VKS 6350	38)
	○			•	VKHB 2044	33014	-	
	○	HL 4/40 DC-7, HL 4/40 D-7, HL 4/40 DS-7.7	VKBA 5393	•	VKHB 2124	33020/Q	VKS 6351	39)
	○			•	VKHB 2326	33116/Q	-	
	○	HL 4/40 DC-7, HL 4/40 D-7, HL 4/40 DS-7.7	VKBA 5394	•	VKHB 2082	33019/Q	VKS 6352	40)
	○			•	VKHB 2170	32018 X/Q	-	
	○	HL 4/40 DC-7, HL 4/40 D-7, HL 4/40 DS-7.7	VKBA 5395	•	VKHB 2041	580/572/Q	VKS 6178	41)
	○			•	VKHB 2328	504376 A	-	



# MERCEDES-BENZ



ATEGO, 1200, 1300, 1500 Ser.	•	VL 3/21 DC-5.3	VKBA 5387	•	VKHB 2319	33213 JR	VKS 6347	
	•			•	VKHB 2320	33208 JR-1/33208 J	-	
	•	AL 3/40 D-6	VKBA 5389	•	VKHB 2124	33020/Q	VKS 6349	
	•			•	VKHB 2169	32017 X/Q	-	
	○	HL 4/40 DC-10.8	VKBA 5392	•	VKHB 2321	33017/Q	VKS 6350	38)
	○			•	VKHB 2044	33014	-	
ATEGO, 1800 Ser.	○	HL 4/40 DC-10.8	VKBA 5393	•	VKHB 2124	33020/Q	VKS 6351	39)
	○			•	VKHB 2326	33116/Q	-	
	○	HL 4/40 DC-10.8	VKBA 5394	•	VKHB 2082	33019/Q	VKS 6352	40)
	○			•	VKHB 2170	32018 X/Q	-	
	○	HL 4/40 DC-10.8	VKBA 5395	•	VKHB 2041	580/572/Q	VKS 6178	41)
	○			•	VKHB 2328	504376 A	-	
	•	VL 5/1 D-9	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	24)
	•			•	VKHB 2002	32311 J2	-	
	•	VL 5/1 D-9	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	42)
	•			•	VKHB 2002	32311 J2	-	
	•	VL 4/50 DC-7.5, VL 4/51 DC-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8,	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	24)
	•			•	VKHB 2070	32310 J2/Q	-	
	•	VL 4/50 DC-7.5, VL 4/51 DC-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8	VKBA 5374	•	VKHB 2307	801785	VKS 6315	42),43)
	•			+			VKS 6150	
	•			•	VKHB 2003	32312 J2/Q	VKS 6146	
	•	VL 4/50 DC-7.5, VL 4/51 DC-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8	VKBA 5375	•	VKHB 2280	BT1-0084/Q	VKS 6315	42),44)
	•			+			VKS 6150	
	•			•	VKHB 2003	32312 J2/Q	VKS 6146	
	•	VL 5/21 DC-9	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	
	•			•	VKHB 2002	32311 J2	-	
	•	AL 7/52 DS-7.5, AL 7/52 D-9	VKBA 5390	•	VKHB 2082	33019/Q	VKS 6194	
	•			•	VKHB 2323	32021X/528595	VKS 6197	
	○	HL 7/50 DCS- 11.5, HL 7/050 DCS-13, HL 7/052 DS-13	VKBA 5369	•	VKHB 2162	33021/Q	VKS 6334	29)
	○			•	VKHB 2306	32020 X/Q	-	
	○	HL 7/50 DCS- 11.5, HL 7/050 DCS-13, HL 7/052 DS-13	VKBA 5370	•	VKHB 2163	33022	VKS 6334	30)
	○			•	VKHB 2165	33220	-	
	○	HL 8/1 DCS-13	VKBA 5401	•	VKHB 2163	33022	VKS 6353	
	○			•	VKHB 2329	KHM.220110/567549	-	
	○	NS 4/50 DC-10	VKBA 5402	•	VKHB 2124	33020/Q	VKS 6150	
	○			•	VKHB 2326	33116/Q	-	
	○	NS 4/50 DCL-7.5	VKBA 5375	•	VKHB 2280	BT1-0084/Q	VKS 6315	
			+			VKS 6150		
			•	VKHB 2003	32312 J2/Q	VKS 6146		



ATEGO, 2500 Ser.

•		VL 4/51 DC-7.5, VL 4/54 DC-8, VL 4/52 DC-7.5, VL 4/53 DC-7.5	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	24)
•		VL 4/51 DC-7.5, VL 4/54 DC-8, VL 4/52 DC-7.5, VL 4/53 DC-7.5	VKBA 5374	• +	VKHB 2307 VKHB 2003	801785 32312 J2/Q	VKS 6315 VKS 6150 VKS 6146	42,43)
•		VL 4/51 DC-7.5, VL 4/54 DC-8, VL 4/52 DC-7.5, VL 4/53 DC-7.5	VKBA 5375	• +	VKHB 2280 VKHB 2003	BT1-0084/Q 32312 J2/Q	VKS 6315 VKS 6150 VKS 6146	42),44)
•		VL 5/21 DC-9	VKBA 5371	•	VKHB 2002 VKHB 2002	32311 J2 32311 J2	VKS 6150 -	
•	○	HL 7/50 DCS-11.5	VKBA 5369	•	VKHB 2162 VKHB 2306	33021/Q 32020 X/Q	VKS 6334 -	29)
•	○	HL 7/50 DCS-11.5	VKBA 5370	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6334 -	30)
•	○	HL 8/1 DCS-13	VKBA 5401	•	VKHB 2163 VKHB 2329	33022 KHM.220110/567549	VKS 6353 -	
•	○	HL 7/052 DS-13	VKBA 5369	•	VKHB 2162 VKHB 2306	33021/Q 32020 X/Q	VKS 6334 -	29)
•	○	HL 7/052 DS-13	VKBA 5370	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6334 -	30)
•	○	NS 4/50 DC-10	VKBA 5402	•	VKHB 2124 VKHB 2326	33020/Q 33116/Q	VKS 6150 -	
•	○	NS 4/50 DCL-7.5	VKBA 5375	• +	VKHB 2280 VKHB 2003	BT1-0084/Q 32312 J2/Q	VKS 6315 VKS 6150 VKS 6146	

ATEGO, 2600 Ser.

•		VL 4/50 DC-7.5, VL 4/51 DC-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	24)
•		VL 4/50 DC-7.5, VL 4/51 DC-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8	VKBA 5374	• +	VKHB 2307 VKHB 2003	801785 32312 J2/Q	VKS 6315 VKS 6150 VKS 6146	42,43)
•		VL 4/50 DC-7.5, VL 4/51 DC-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8	VKBA 5375	• +	VKHB 2280 VKHB 2003	BT1-0084/Q 32312 J2/Q	VKS 6315 VKS 6150 VKS 6146	42),44)
•	○	HL 7/50 DC-11.5, HL 7/50 DCGS-11.5, HL 7/52 DS-11.5	VKBA 5369	•	VKHB 2162 VKHB 2306	33021/Q 32020 X/Q	VKS 6334 -	29)
•	○	HL 7/50 DC-11.5, HL 7/50 DCGS-11.5, HL 7/52 DS-11.5	VKBA 5370	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6334 -	30)
•	○	NS 4/50 DC-10	VKBA 5402	•	VKHB 2124 VKHB 2326	33020/Q 33116/Q	VKS 6150 -	

# MERCEDES-BENZ



ATEGO, 2600 Ser. ....	○	NS 4/50 DCL-7.5	VKBA 5375	• +	VKHB 2280	BT1-0084/Q	VKS 6315 VKS 6150 VKS 6146	
	○			•	VKHB 2003	32312 J2/Q		
ACTROS, 1800 Ser.	•	VL 5/1 D-9	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	24)
	•			•	VKHB 2002	32311 J2	-	
	•	VL 5/1 D-9	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	42)
	•			•	VKHB 2002	32311 J2	-	
	•	VL 5/20 DC-9, VL 5/21 DC-9	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	
	•			•	VKHB 2002	32311 J2	-	
	•	VL 4/50 DC-7.5, VL 4/51 DC-7.5, VL 4/52 DC-7.5, VL 4/53 DC-7.5, VL 4/27 D-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	24)
	•			•	VKHB 2070	32310 J2/Q	-	
	•	VL 4/50 DC-7.5, VL 4/51 DC-7.5, VL 4/52 DC-7.5, VL 4/53 DC-7.5, VL 4/27 D-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8	VKBA 5374	• +	VKHB 2307	801785	VKS 6315 VKS 6150 VKS 6146	42,43)
	•			•	VKHB 2003	32312 J2/Q		
	•	VL 4/50 DC-7.5, VL 4/51 DC-7.5, VL 4/52 DC-7.5, VL 4/53 DC-7.5, VL 4/27 D-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8	VKBA 5375	• +	VKHB 2280	BT1-0084/Q	VKS 6315	42),44)
	•			•	VKHB 2003	32312 J2/Q	VKS 6150 VKS 6146	
	○	HL 7/50 DC-11.5, HL 7/50 DCGS-11.5, HL 7/50 DCS-11.5, HL 7/050 DCS-13, HL 7/52 DS-11.5, HL 7/052 DS-11.5, HL 7/052 DS-13, HL 7/53 DS-16	VKBA 5369	•	VKHB 2162	33021/Q	VKS 6334	29)
	○			•	VKHB 2306	32020 X/Q	-	
	○	HL 7/50 DC-11.5, HL 7/50 DCGS-11.5, HL 7/50 DCS-11.5, HL 7/050 DCS-13, HL 7/52 DS-11.5, HL 7/052 DS-11.5, HL 7/052 DS-13, HL 7/53 DS-16	VKBA 5370	•	VKHB 2163	33022	VKS 6334	30)
	○			•	VKHB 2165	33220	-	
	○	NS 4/50 DCL-7.5	VKBA 5375	• +	VKHB 2280	BT1-0084/Q	VKS 6315 VKS 6150 VKS 6146	
	○			•	VKHB 2003	32312 J2/Q		
	○	NS 4/50 DC-10	VKBA 5402	•	VKHB 2124	33020/Q	VKS 6150	
	○			•	VKHB 2326	33116/Q	-	
ACTROS, 1900 Ser.	•	VL 5/1 D-9	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	24)
	•			•	VKHB 2002	32311 J2	-	



	•	VL 5/1 D-9	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	42)
	•			•	VKHB 2002	32311 J2	-	
	•	VL 5/20 DC-9,	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	
	•	VL 5/21 DC-9		•	VKHB 2002	32311 J2	-	
	•	VL 4/50 DC-7.5,	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	24)
	•	VL 4/51 DC-7.5,		•	VKHB 2070	32310 J2/Q	-	
		VL 4/52 DC-7.5,						
		VL 4/53 DC-7.5,						
		VL 4/55 D-7.5,						
		VL 4/56 D-7.5,						
		VL 4/54 DC-8						
	•	VL 4/50 DC-7.5,	VKBA 5374	•	VKHB 2307	801785	VKS 6315	42), 43)
	•	VL 4/51 DC-7.5,		+			VKS 6150	
		VL 4/52 DC-7.5,		•	VKHB 2003	32312 J2/Q	VKS 6146	
		VL 4/53 DC-7.5,						
		VL 4/55 D-7.5,						
		VL 4/56 D-7.5,						
		VL 4/54 DC-8						
	•	VL 4/50 DC-7.5,	VKBA 5375	•	VKHB 2280	BT1-0084/Q	VKS 6315	42), 44)
	•	VL 4/51 DC-7.5,		+			VKS 6150	
		VL 4/52 DC-7.5,		•	VKHB 2003	32312 J2/Q	VKS 6146	
		VL 4/53 DC-7.5,						
		VL 4/55 DC-7.5,						
		VL 4/56 D-7.5,						
		VL 4/54 DC-8						
	○	HL 7/50 DC-11.5,	VKBA 5369	•	VKHB 2162	33021/Q	VKS 6334	29)
	○	HL 7/50 DCGS-11.5,		•	VKHB 2306	32020 X/Q	-	
		HL 7/50 DCS-11.5,						
		HL 7/50 DCS-13,						
		HL 7/52 DS-11.5,						
		HL 7/052 DS-13,						
		HL 7/053 DS-16						
	○	HL 7/50 DC-11.5,	VKBA 5370	•	VKHB 2163	33022	VKS 6334	30)
	○	HL 7/50 DCGS-11.5,		•	VKHB 2165	33220	-	
		HL 7/50 DCS-11.5,						
		HL 7/50 DCS-13,						
		HL 7/52 DS-11.5,						
		HL 7/052 DS-13,						
		HL 7/53 DS-16						
	○	NS 4/50 DCL-7.5	VKBA 5375	•	VKHB 2280	BT1-0084/Q	VKS 6315	
	○			+			VKS 6150	
				•	VKHB 2003	32312 J2/Q	VKS 6146	
	○	NS 4/50 DC-10	VKBA 5402	•	VKHB 2124	33020/Q	VKS 6150	
	○			•	VKHB 2326	33116/Q	-	
ACTROS, 2000 Ser.	•	VL 5/1 D-9	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	24)
	•			•	VKHB 2002	32311 J2	-	
	•	VL 5/1 D-9	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	42)
	•			•	VKHB 2002	32311 J2	-	
	•	VL 5/20 DC-9,	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	
	•	VL 5/21 DC-9		•	VKHB 2002	32311 J2	-	
	•	VL 4/50 DC-7.5,	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	24)
	•	VL 4/51 DC-7.5,		•	VKHB 2070	32310 J2/Q	-	
		VL 4/52 DC-7.5,						
		VL 4/53 DC-7.5,						
		VL 4/55 D-7.5,						
		VL 4/56 D-7.5,						
		VL 4/54 DC-8						



ACTROS, 2000 Ser..../...

•	VL 4/50 DC-7.5, VL 4/51 DC-7.5,	<b>VKBA 5374</b>	• +	<b>VKHB 2307</b>	801785	<b>VKS 6315</b>	42,43)
•	VL 4/52 DC-7.5, VL 4/53 DC-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8		•	<b>VKHB 2003</b>	32312 J2/Q	<b>VKS 6150</b> <b>VKS 6146</b>	
•	VL 4/50 DC-7.5, VL 4/51 DC-7.5,	<b>VKBA 5375</b>	• +	<b>VKHB 2280</b>	BT1-0084/Q	<b>VKS 6315</b>	42),44)
•	VL 4/52 DC-7.5, VL 4/53 DC-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8		•	<b>VKHB 2003</b>	32312 J2/Q	<b>VKS 6150</b> <b>VKS 6146</b>	
○	HL 7/50 DC-11.5,	<b>VKBA 5369</b>	•	<b>VKHB 2162</b>	33021/Q	<b>VKS 6334</b>	29)
○	HL 7/50 DCGS-11.5, HL 7/50 HL 7/50 DCS-13, HL 7/52 DS-11.5, HL 7/052 DS-13, HL 7/53 DS-16		•	<b>VKHB 2306</b>	32020 X/Q	-	
○	HL 7/50 DC-11.5,	<b>VKBA 5370</b>	•	<b>VKHB 2163</b>	33022	<b>VKS 6334</b>	30)
○	HL 7/50 DCGS-11.5, HL 7/50 DCS-11.5, HL 7/50 DCS-13, HL 7/52 DS-11.5, HL 7/052 DS-13, HL 7/53 DS-16		•	<b>VKHB 2165</b>	33220	-	
○	NS 4/50 DCL-7.5	<b>VKBA 5375</b>	• +	<b>VKHB 2280</b>	BT1-0084/Q	<b>VKS 6315</b>	
○			•	<b>VKHB 2003</b>	32312 J2/Q	<b>VKS 6150</b> <b>VKS 6146</b>	
○	NS 4/50 DC-10	<b>VKBA 5402</b>	•	<b>VKHB 2124</b>	33020/Q	<b>VKS 6150</b>	
○			•	<b>VKHB 2326</b>	33116/Q	-	

ACTROS, 2500 Ser.

•	VL 5/1 D-9	<b>VKBA 5237</b>	•	<b>VKHB 2203</b>	JH 415647/JH 415610	<b>VKS 6270</b>	24)
•			•	<b>VKHB 2002</b>	32311 J2	-	
•	VL 5/21 DC-9	<b>VKBA 5371</b>	•	<b>VKHB 2002</b>	32311 J2	<b>VKS 6150</b>	
•			•	<b>VKHB 2002</b>	32311 J2	-	
•	VL 4/50 DC-7.5, VL 4/51 DC-7.5, VL 4/52 DC-7.5, VL 4/53 DC-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8	<b>VKBA 5039</b>	•	<b>VKHB 2072</b>	32314 J2/Q	<b>VKS 6150</b>	24)
•			•	<b>VKHB 2070</b>	32310 J2/Q	-	
•	VL 4/50 DC-7.5, VL 4/51 DC-7.5,	<b>VKBA 5374</b>	• +	<b>VKHB 2307</b>	801785	<b>VKS 6315</b>	42,43)
•	VL 4/52 DC-7.5, VL 4/53 DC-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8		•	<b>VKHB 2003</b>	32312 J2/Q	<b>VKS 6150</b> <b>VKS 6146</b>	
•	VL 4/50 DC-7.5, VL 4/51 DC-7.5,	<b>VKBA 5375</b>	• +	<b>VKHB 2280</b>	BT1-0084/Q	<b>VKS 6315</b>	42),44)
•	VL 4/52 DC-7.5, VL 4/53 DC-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8		•	<b>VKHB 2003</b>	32312 J2/Q	<b>VKS 6150</b> <b>VKS 6146</b>	



	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HL 7/50 DC-11.5, VL 7/50 DCGS-11.5, HL 7/50 DCS-11.5, HL 7/050 DCS-13, HL 7/52 DS-11.5, HL 7/052 DS-13	VKBA 5369	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VKHB 2162 VKHB 2306	33021/Q 32020 X/Q	VKS 6334 -	29)
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HL 7/50 DC-11.5, HL 7/50 DCGS-11.5, HL 7/50 DCS-11.5, HL 7/050 DCS-13, HL 7/52 DS-11.5, HL 7/052 DS-13	VKBA 5370	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VKHB 2163 VKHB 2165	33022 33220	VKS 6334 -	30)
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	NS 4/50 DCL-7.5	VKBA 5375	<ul style="list-style-type: none"> <li>•</li> <li>+</li> <li>•</li> </ul>	VKHB 2280 VKHB 2003	BT1-0084/Q 32312 J2/Q	VKS 6315 VKS 6150 VKS 6146	
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	NS 4/50 DC-10	VKBA 5402	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VKHB 2124 VKHB 2326	33020/Q 33116/Q	VKS 6150 -	
ACTROS, 2600 Ser.	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VL 5/1 D-9	VKBA 5237	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VKHB 2203 VKHB 2002	JH 415647/JH 415610 32311 J2	VKS 6270 -	24)
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VL 5/1 D-9	VKBA 5371	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VKHB 2002 VKHB 2002	32311 J2 32311 J2	VKS 6150 -	42)
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VL 5/20 DC-9, VL 5/21 DC-9	VKBA 5371	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VKHB 2002 VKHB 2002	32311 J2 32311 J2	VKS 6150 -	
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VL 4/50 DC-7.5, VL 4/51 DC-7.5, VL 4/52 DC-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8	VKBA 5039	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	24)
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VL 4/50 DC-7.5, VL 4/51 DC-7.5, VL 4/52 DC-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8	VKBA 5374	<ul style="list-style-type: none"> <li>•</li> <li>+</li> <li>•</li> </ul>	VKHB 2307 VKHB 2003	801785 32312 J2/Q	VKS 6315 VKS 6150 VKS 6146	42,43)
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VL 4/50 DC-7.5, VL 4/51 DC-7.5, VL 4/52 DC-7.5, VL 4/55 D-7.5, VL 4/56 D-7.5, VL 4/54 DC-8	VKBA 5375	<ul style="list-style-type: none"> <li>•</li> <li>+</li> <li>•</li> </ul>	VKHB 2280 VKHB 2003	BT1-0084/Q 32312 J2/Q	VKS 6315 VKS 6150 VKS 6146	42,44)
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HL 7/50 DC-11.5, HL 7/50 DCGS-11.5, HL 7/50 DCS-11.5, HL 7/050 DCS-13, HL 7/52 DS-11.5, HL 7/052 DS-13	VKBA 5369	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VKHB 2162 VKHB 2306	33021/Q 32020 X/Q	VKS 6334 -	29)
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HL 7/50 DC-11.5, HL 7/50 DCGS-11.5, HL 7/50 DCS-11.5, HL 7/050 DCS-13, HL 7/52 DS-11.5, HL 7/052 DS-13	VKBA 5370	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VKHB 2163 VKHB 2165	33022 33220	VKS 6334 -	30)
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	NS 4/50 DCL-7.5	VKBA 5375	<ul style="list-style-type: none"> <li>•</li> <li>+</li> <li>•</li> </ul>	VKHB 2280 VKHB 2003	BT1-0084/Q 32312 J2/Q	VKS 6315 VKS 6150 VKS 6146	

# MERCEDES-BENZ



ACTROS, 3200 Ser.	○	NS 4/50 DC-10	VKBA 5402	•	VKHB 2124	33020/Q	VKS 6150	
	○			•	VKHB 2326	33116/Q	-	
	•	VL 4/53 DC-7.5,	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	24)
	•	VL 4/55 D-7.5		•	VKHB 2070	32310 J2/Q	-	
	•	VL 4/53 DC-7.5,	VKBA 5374	•	VKHB 2307	801785	VKS 6315	42,43)
	•	VL 4/55 D-7.5		+			VKS 6150	
	•			•	VKHB 2003	32312 J2/Q	VKS 6146	
	•	VL 4/53 DC-7.5,	VKBA 5375	•	VKHB 2280	BT1-0084/Q	VKS 6315	42,44)
	•	VL 4/55 D-7.5		+			VKS 6150	
	•			•	VKHB 2003	32312 J2/Q	VKS 6146	
ACTROS, 3300 Ser	○	HL 7/50 DC-11.5,	VKBA 5369	•	VKHB 2162	33021/Q	VKS 6334	29)
	○	HL 7/50 DCGS-11.5,		•	VKHB 2306	32020 X/Q	-	
		HL 7/50 DCS-11.5,						
		HL 7/52 DS-11.5,						
		HL 7/052 DS-13						
	○	HL 7/50 DC-11.5,	VKBA 5370	•	VKHB 2163	33022	VKS 6334	30)
	○	HL 7/50 DCGS-11.5,		•	VKHB 2165	33220	-	
		HL 7/50 DCS-11.5,						
		HL 7/52 DS-11.5,						
		HL 7/052 DS-13						
ACTROS, 3300 Ser	○	NS 4/50 DCL-7.5	VKBA 5375	•	VKHB 2280	BT1-0084/Q	VKS 6315	
	○			+			VKS 6150	
	○			•	VKHB 2003	32312 J2/Q	VKS 6146	
	○	NS 4/50 DC-10	VKBA 5402	•	VKHB 2124	33020/Q	VKS 6150	
	○			•	VKHB 2326	33116/Q	-	
	•	VL 5/1 D-9	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	24)
	•			•	VKHB 2002	32311 J2	-	
	•	VL 5/1 D-9	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	42)
	•			•	VKHB 2002	32311 J2	-	
	•	VL 5/20 DC-9,	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	
•	VL 5/21 DC-9		•	VKHB 2002	32311 J2	-		
ACTROS, 3300 Ser	•	VL 4/50 DC-7.5,	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	24)
	•	VL 4/55 D-7.5,		•	VKHB 2070	32310 J2/Q	-	
	•	VL 4/56 D-7.5,						
	•	VL 4/54 DC-8						
	•	VL 4/50 DC-7.5,	VKBA 5374	•	VKHB 2307	801785	VKS 6315	42,43)
	•	VL 4/55 D-7.5,		+			VKS 6150	
	•	VL 4/56 D-7.5,		•	VKHB 2003	32312 J2/Q	VKS 6146	
	•	VL 4/54 DC-8						
	•	VL 4/50 DC-7.5,	VKBA 5375	•	VKHB 2280	BT1-0084/Q	VKS 6315	42,44)
	•	VL 4/55 D-7.5,		+			VKS 6150	
ACTROS, 3300 Ser	○	HL 7/050 DCS-13,	VKBA 5369	•	VKHB 2162	33021/Q	VKS 6334	29)
	○	HL 7/50 DCS-16,		•	VKHB 2306	32020 X/Q	-	
		HL 7/52 DS-11.5,						
		HL 7/052 DS-13,						
		HL 7/53 DS-16						
	○	HL 7/050 DCS-13,	VKBA 5370	•	VKHB 2163	33022	VKS 6334	30)
	○	HL 7/50 DCS-16,		•	VKHB 2165	33220	-	
		HL 7/52 DS-11.5,						
		HL 7/052 DS-13,						
		HL 7/53 DS-16						



	○	NS 4/50 DCL-7.5	VKBA 5375	• +	VKHB 2280	BT1-0084/Q	VKS 6315 VKS 6150 VKS 6146	
	○			•	VKHB 2003	32312 J2/Q		
	○	NS 4/50 DC-10	VKBA 5402	•	VKHB 2124	33020/Q	VKS 6150	
	○			•	VKHB 2326	33116/Q	-	
ACTROS, 4100 Ser.	•	VL 5/1 D-9	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	24)
	•			•	VKHB 2002	32311 J2	-	
	•	VL 5/1 D-9	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	42)
	•			•	VKHB 2002	32311 J2	-	
	•	VL 4/53 DC-7.5, VL 4/27 D-7.5, VL 4/55 D-7.5	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	24)
	•			•	VKHB 2070	32310 J2/Q	-	
	•	VL 4/53 DC-7.5, VL 4/27 D-7.5, VL 4/55 D-7.5	VKBA 5374	• +	VKHB 2307	801785	VKS 6315 VKS 6150	42,43)
	•			•	VKHB 2003	32312 J2/Q	VKS 6146	
	•	VL 4/53 DC-7.5, VL 4/27 D-7.5, VL 4/55 D-7.5	VKBA 5375	• +	VKHB 2280	BT1-0084/Q	VKS 6315	42,44)
	•			•	VKHB 2003	32312 J2/Q	VKS 6150 VKS 6146	
	○	HL 7/050 DCS-13, HL 7/052 DS-13, HL 7/53 DS-16	VKBA 5369	•	VKHB 2162	33021/Q	VKS 6334	29)
	○			•	VKHB 2306	32020 X/Q	-	
	○	HL 7/050 DCS-13, HL 7/052 DS-13, HL 7/53 DS-16	VKBA 5370	•	VKHB 2163	33022	VKS 6334	30)
	○			•	VKHB 2165	33220	-	
	○	NS 4/50 DCL-7.5	VKBA 5375	• +	VKHB 2280	BT1-0084/Q	VKS 6315 VKS 6150 VKS 6146	
	○			•	VKHB 2003	32312 J2/Q		
	○	NS 4/50 DC-10	VKBA 5402	•	VKHB 2124	33020/Q	VKS 6150	
	○			•	VKHB 2326	33116/Q	-	



Mercedes-Benz Fahrzeugdaten				F18M14380				WVW1739,172 E 266422				F18M14380						
Kombi				14.09.1984				14.09.1984				14.09.1984						
1 2 569 00170				1693622				714700 10 272051				2420 6X						
1693622				714700 10 272051				2420 6X				1 2 569 00170						
A00	A40	A71	A87	A94	B02	B43	B49	B51	B45	B83	C53	C59	D05	D38	D41	D70	D75	D79
B84	B87	FA1	EA3	EB1	ED7	E18	E20	E10	E40	E66	E50	F05	F41	F46	F40	F52	F55	F69
F73	F77	F81	G77	H04	H25	J73	K17	K69	L01	L04	L16	MA2	M81	M10	M32	M45	M83	M89
M97	R04	R38	R40	S43	S30	S53	S68	S69	X87	X56	Y89	Y07	Y20	Y62	Y82			
01	01830357	1501865072				2008316494		3203273919			4202020501		4203282659				4703292651	
	01856157	01886821						03293512			02028733		03285405					
	08339411	08316494			23	01830357		03294019			02031057		03288914				4903159307	
	08361204	08339411				08339411		3302031057			02101914		03289322				03167103	
02	08316494	1401856157				08361204		02114909			02102607		03292651				03294703	
	08361204	01884424			24	02533524		3501989519			02114909		03294019				5001856157	
	0701854157	1501856157						02015402			02433314		03340503				02533524	
	01886424	01886424			30	03308602		02020501			03237748		4302533524				03295308	
	08338121	08316494						02028733			03273382		03280078				03302903	
	08364123	1801856157			31	03263339		02101822			03273919		03289322				5202633314	
09	01886424	01865046				03264202		02101914			03274201		03350503				03204913	
	01886821	01865072						02102607			03280078		4603159307				03260804	
	08339411	2001830357				03293512		02114909			03280173		03167103				03263339	
13	01830357	01856157			32	03259404		03273382			03281228		03259914				03293408	
	01856157	01865046				03263339		4003102105			03281701		03295518				03295308	
	01865046	01865072				03264202					03281830		03303017					

MERCEDES-BENZ "Baumuster"



739.163-165	VKBA 5039	i	VKHB 2072 (32314 J2)	VKA 4095
		o	VKHB 2070 (32310 J2)	
739.166-173	VKBA 5038	i	VKHB 2071 (32330 B)	VKA 4094
		o	VKHB 2070 (32310 J2)	
748.437	VKBA 5058	i	VKHB 2162 (33021)	VKA 4111
		o	VKHB 2161 (32019 X)	
748.440	VKBA 5059	i	VKHB 2163 (33022)	VKA 4111
		o	VKHB 2164 (30220 J2)	
748.441-445	VKBA 5058	i	VKHB 2162 (33021)	VKA 4111
		o	VKHB 2161 (32019 X)	
748.446-447	VKBA 5059	i	VKHB 2163 (33022)	VKA 4111
		o	VKHB 2164 (30220 J2)	
748.449-451	VKBA 5058	i	VKHB 2162 (33021)	VKA 4111
		o	VKHB 2161 (32019 X)	
749.007	VKBA 5052	i	VKHB 2062 (33019)	VKA 4107
		o	VKHB 2068 (33215 Q)	
749.031-036, 749.100	VKBA 5037	i	VKHB 2071 (33230 B)	VKA 4094
		o	VKHB 2068 (33210 Q)	



730.001-.002, 730.004	-	•	-	VKHB 2064	529656	VKS 6157	
		•				-	
730.005	VKBA 5034	•		VKHB 2066	33214/Q	VKS 6175	
		•		VKHB 2068	33210/Q	-	
730.006-.010	VKBA 5032	•		VKHB 2051	33213/Q	VKS 6157	
		•		VKHB 2065	33208/Q	-	
730.011-.012	VKBA 5034	•		VKHB 2066	33214/Q	VKS 6175	11)
		•		VKHB 2068	33210/Q	-	
	VKBA 5033	•		VKHB 2066	33214/Q	VKS 6175	10)
		•		VKHB 2067	33209/Q	-	
730.016-.019	VKBA 5032	•		VKHB 2051	33213/Q	VKS 6157	
		•		VKHB 2065	33208/Q	-	
730.020	VKBA 5033	•		VKHB 2066	33214/Q	VKS 6175	
		•		VKHB 2067	33209/Q	-	
730.021	VKBA 5034	•		VKHB 2066	33214/Q	VKS 6175	
		•		VKHB 2068	33210/Q	-	
730.022	VKBA 5032	•		VKHB 2051	33213/Q	VKS 6157	
		•		VKHB 2065	33208/Q	-	
730.030-.031	-	•		-		VKS 6157	
		•		VKHB 2064	529656	-	
730.034	VKBA 5033	•		VKHB 2066	33214/Q	VKS 6175	10)
		•		VKHB 2067	33209/Q	-	
	VKBA 5034	•		VKHB 2066	33214/Q	VKS 6175	11)
		•		VKHB 2068	33210/Q	-	
730.036, 730.039	-	•		-		VKS 6157	
		•		VKHB 2064	529656	-	
730.041, 730.043	VKBA 5034	•		VKHB 2066	33214/Q	VKS 6175	
		•		VKHB 2068	33210/Q	-	
730.044	VKBA 5032	•		VKHB 2051	33213/Q	VKS 6157	
		•		VKHB 2065	33208/Q	-	
730.045	VKBA 5034	•		VKHB 2066	33214/Q	VKS 6175	
		•		VKHB 2068	33210/Q	-	
730.048	VKBA 5032	•		VKHB 2051	33213/Q	VKS 6157	
		•		VKHB 2065	33208/Q	-	
730.050	VKBA 5034	•		VKHB 2066	33214/Q	VKS 6175	
		•		VKHB 2068	33210/Q	-	
730.052, 730.056-.060, 730.062-.066	VKBA 5032	•		VKHB 2051	33213/Q	VKS 6157	
		•		VKHB 2065	33208/Q	-	
730.100-.101	VKBA 5390	•		VKHB 2082	33019/Q	VKS 6194	
		•		VKHB 2323	32021X/528595	VKS 6197	
730.200, 730.230-.231	-	•		VKHB 2066	33214/Q	VKS 6175	
		•		VKHB 2067	33209/Q	-	
730.403-.404	VKBA 596	•		-		-	
		•		-		-	

# MERCEDES-BENZ "Baumuster"



730.405, 730.407-.414	VKBA 3434	• •	- -		- -	
730.445-.446	VKBA 596	• •	- -		- -	
730.447-.448	VKBA 3434	• •	- -		- -	
730.502	VKBA 5023	• •	VKHB 2058 VKHB 2018	32304 J2/Q 32207 J2/Q	VKS 6149 -	6)
	VKBA 5024	• •	VKHB 2054 VKHB 2055	2789/2720/QCL7C 1380/Q/1328/Q	VKS 6152 -	7)
	VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	8)
730.503-.504	VKBA 5024	• •	VKHB 2054 VKHB 2055	2789/2720/QCL7C 1380/Q/1328/Q	VKS 6152 -	4)
	VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	5)
730.505	VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	
730.506	VKBA 5024	• •	VKHB 2054 VKHB 2055	2789/2720/QCL7C 1380/Q/1328/Q	VKS 6152 -	4)
	VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	5)
730.531	VKBA 5024	• •	VKHB 2054 VKHB 2055	2789/2720/QCL7C 1380/Q/1328/Q	VKS 6152 -	4)
	VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	5)
730.532	VKBA 5023	• •	VKHB 2058 VKHB 2018	32304 J2/Q 32207 J2/Q	VKS 6149 -	6)
	VKBA 5024	• •	VKHB 2054 VKHB 2055	2789/2720/QCL7C 1380/Q/1328/Q	VKS 6152 -	7)
	VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	8)
730.533	VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	
730.534-.535	VKBA 5024	• •	VKHB 2054 VKHB 2055	2789/2720/QCL7C 1380/Q/1328/Q	VKS 6152 -	4)
	VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	5)
730.600-.603, 730.630	VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	
730.702	-	• •	VKHB 2060 VKHB 2016	32011 X/Q 32206 J2/Q	VKS 6159 -	
730.703-.704	VKBA 5026	• •	VKHB 2059 VKHB 2007	33111/Q 32306 J2/Q	VKS 6159 -	
730.705	VKBA 5028	• •	VKHB 2061 VKHB 2007	33211/Q 32306 J2/Q	VKS 6148 -	



730.706	VKBA 5026	•	VKHB 2059 VKHB 2007	33111/Q 32306 J2/Q	VKS 6159 -
730.708-709	VKBA 5028	•	VKHB 2061 VKHB 2007	33211/Q 32306 J2/Q	VKS 6148 -
730.713-714	VKBA 5386	•	VKHB 2318 VKHB 2317	33111 JR 32306 JR	VKS 6346 -
730.023-024	VKBA 5387	•	VKHB 2319 VKHB 2320	33213 JR 33208 JR-1/33208 J	VKS 6347 -
730.730	VKBA 5026	•	VKHB 2059 VKHB 2007	33111/Q 32306 J2/Q	VKS 6159 -
730.731	VKBA 5029	•	VKHB 2061 VKHB 2064	33211/Q 529656	VKS 6148 -
730.732	VKBA 5026	•	VKHB 2059 VKHB 2007	33111/Q 32306 J2/Q	VKS 6159 -
730.733	VKBA 5028	•	VKHB 2061 VKHB 2007	33211/Q 32306 J2/Q	VKS 6148 -
730.736	VKBA 5029	•	VKHB 2061 VKHB 2064	33211/Q 529656	VKS 6148 -
730.800	VKBA 5026	•	VKHB 2059 VKHB 2007	33111/Q 32306 J2/Q	VKS 6159 -
730.801	VKBA 5028	•	VKHB 2061 VKHB 2007	33211/Q 32306 J2/Q	VKS 6148 -
730.802, 730.830-832	VKBA 5029	•	VKHB 2061 VKHB 2064	33211/Q 529656	VKS 6148 -
731.000,731.002,731.004-.009, 731.012,731.031-.033, 731.035-.037, 731.044-.045,731.048-.057	VKBA 5166	•	VKHB 2172 VKHB 2161	331974 A/Q 32019 X/Q	VKS 6197 VKS 6194
731.700	-	•	VKHB 2321 -	33017/Q -	VKS 6348 -
731.720	VKBA 5389	•	VKHB 2124 VKHB 2169	33020/Q 32017 X/Q	VKS 6349 -
739.001-003	-	•	- VKHB 2070	32310 J2/Q	VKS 6160 -
739.006	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -
739.007, 739.016-.019, 739.030-031	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146
739.032	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -
739.033	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146
739.034, 739.036	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -
739.037-.039	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146
739.040-.047	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -

# MERCEDES-BENZ "Baumuster"



739.048-.049	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.050, 739.052-.053	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
		•	VKHB 2070	32310 J2/Q	-	
739.054-.055	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.056-.061, 739.064, 739.066, 739.070	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
		•	VKHB 2070	32310 J2/Q	-	
739.071-.072	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.073-.074, 739.076-.081	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
		•	VKHB 2070	32310 J2/Q	-	
739.082	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.083	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
		•	VKHB 2070	32310 J2/Q	-	
739.084	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.086	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
		•	VKHB 2070	32310 J2/Q	-	
739.087-.088	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.089-.092	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
		•	VKHB 2070	32310 J2/Q	-	
739.093	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.094	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
		•	VKHB 2070	32310 J2/Q	-	
739.096-.099	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.100	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2068	33210/Q	VKS 6146	
739.102, 739.104	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.105-.106, 739.109	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2068	33210/Q	VKS 6146	
739.110-.111	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.112	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	14)
		•	VKHB 2070	32310 J2/Q	VKS 6146	
	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	13)
		•	VKHB 2068	33210/Q	VKS 6146	
739.113	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	



739.114	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
739.115	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
739.116-.117	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
739.118-.120	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
739.121-.123	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
739.130-.131	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	13)
	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	14)
739.133-.134	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
739.136	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	13)
	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	14)
739.137	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
739.138	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
739.139	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	28)
	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	27)
739.140	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
739.140-.145	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
739.146-.149	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
739.150-.157	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
739.158-.159	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	
739.160	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
739.161	VKBA 5039	•	VKHB 2072 VKHB 2070	32314 J2/Q 32310 J2/Q	VKS 6150 -	

# MERCEDES-BENZ "Baumuster"



739.162	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.163-.165	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
		•	VKHB 2070	32310 J2/Q	-	
739.166-.173	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.174-.175	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
		•	VKHB 2070	32310 J2/Q	-	
739.177-.178	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.179-.181	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
		•	VKHB 2070	32310 J2/Q	-	
739.182-.184	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.187-.188, 739.190	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
		•	VKHB 2070	32310 J2/Q	-	
739.191-.195	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.197-.198	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	
		•	VKHB 2070	32310 J2/Q	-	
739.199, 739.207, 739.209	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
		•	VKHB 2070	32310 J2/Q	VKS 6146	
739.400-.401	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	
		•	VKHB 2002	32311 J2	-	
739.410-.411	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	24)
		•	VKHB 2002	32311 J2	-	
	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	42)
		•	VKHB 2002	32311 J2	-	
739.430-.431, 739.434	VKBA 5237	•	VKHB 2203	JH 415647/JH 415610	VKS 6270	
		•	VKHB 2002	32311 J2	-	
739.500, 739.510, 739.520, 739.530-.531, 739.540-.543, 739.550	VKBA 5039	•	VKHB 2072	32314 J2/Q	VKS 6150	24)
		•	VKHB 2070	32310 J2/Q	-	
739.500, 739.510, 739.520, 739.530-.531, 739.540-.543, 739.550	VKBA 5374	•	VKHB 2307	801785	VKS 6315	42,43)
		+	VKHB 2003	32312 J2/Q	VKS 6150	
		•	VKHB 2003	32312 J2/Q	VKS 6146	
	VKBA 5375	•	VKHB 2280	BT1-0084/Q	VKS 6315	42),44)
		+	VKHB 2003	32312 J2/Q	VKS 6150	
		•	VKHB 2003	32312 J2/Q	VKS 6146	
739.560, 739.570	VKBA 5371	•	VKHB 2002	32311 J2	VKS 6150	
		•	VKHB 2002	32311 J2	-	
740.000	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.001	VKBA 5057	•	VKHB 2160	32021 X/Q	VKS 6183	
		•	VKHB 2161	32019 X/Q	VKS 6181	



740.002	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.003	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.004	VKBA 5057	•	VKHB 2160	32021 X/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
740.005	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.006-007	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.008	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.009	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.030	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.031	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.033-034	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.035-037	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.039-043	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	



# MERCEDES-BENZ "Baumuster"



740.045	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.047-.051	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.053	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.054-.056	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.057-.058	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.059-.064	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.065-.071	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.072	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.074	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.100-.104	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.105	VKBA 5057	•	VKHB 2160	32021 X/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
740.106	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	



740.107	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.109	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.110-.113	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.114	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.115-.117	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.119	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.130-.133	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.134-.135	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.136	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.138-.139	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.140-.147	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	

# MERCEDES-BENZ "Baumuster"



740.148	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.149-.155	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.157	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.159-.172	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.174-.175	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.176-.179	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.180	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.181-.184	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.185-.192	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.195-.198	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.301-.302	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	



740.304	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
740.305	-	• +	VKHB 2163 VKHB 2165	33022 33220	VKS 6183 VKS 6181 -	
740.306-307	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
740.308	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
740.309-310	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
740.311-312	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
740.313	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
740.314	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
740.318-319	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
740.330-333	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
740.334	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
740.334-335	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)

# MERCEDES-BENZ "Baumuster"



740.335	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.335-.336	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
740.336	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.337	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.338-.339	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.340	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.341	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.342	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.346	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
740.347	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
740.348	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
740.350-.351	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	



740.352-.354	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.356-.357	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
740.364-.366	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
740.367-.368	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.369	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.370-.372	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.374-.376	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.380-.382	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
740.383	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
740.384-.385	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.386	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	

# MERCEDES-BENZ "Baumuster"



740.387-.388	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
740.392-.393	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
740.394-.395	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.396	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.397	-	•	VKHB 2163	33022	VKS 6183	
		+			VKS 6181	
		•	VKHB 2165	33220	-	
740.398	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.500	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
740.501	-	•	VKHB 2163	33022	VKS 6183	
		+			VKS 6181	
		•	VKHB 2165	33220	-	
740.502	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
740.530-.532	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.536-.538	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.539	-	•	VKHB 2163	33022	VKS 6183	
		+			VKS 6181	
		•	VKHB 2165	33220	-	



740.540	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
740.544	-	• +	VKHB 2163 VKHB 2165	33022 33220	VKS 6183 VKS 6181 -	
740.545-548	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
740.901	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
740.903-906	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
740.908	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
740.909	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
740.909-910	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
740.910	VKBA 5032	•	VKHB 2051 VKHB 2065	33213/Q 33208/Q	VKS 6157 -	26)
740.911	VKBA 5341	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6334 -	26)
	VKBA 5059	•	VKHB 2163 VKHB 2164	33022 30220 J2	VKS 6183 VKS 6181	25)
740.912	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
740.914-916	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
740.914-920	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
740.917	VKBA 5032	•	VKHB 2051 VKHB 2065	33213/Q 33208/Q	VKS 6157 -	26)
740.918-920	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)



# MERCEDES-BENZ "Baumuster"



740.921-.929	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
740.931	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
740.932	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
740.935	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.936	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
740.952-.953	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
740.954	-	•	VKHB 2163	33022	VKS 6183	25)
		+	VKHB 2165	33220	VKS 6181	
		•	VKHB 2165	33220	-	
740.955	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
740.956-.957	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
740.958-.959	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
740.960	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	



740.961-.963	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
740.964	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
740.965-.966	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
740.968	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
740.974	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
741.200-.203, 741.300-.304, 741.330-.337	VKBA 5043	•	VKHB 2074	3984/3920	VKS 6147	
		•	VKHB 2075	33822/Q/33895/Q	-	
741.400-.401, 741.404, 741.406, 741.436-.439	VKBA 1470	•	-	-	-	1)
		•	-	-	-	
741.520-.521, 741.526-.530, 741.540	VKBA 5040	•	VKHB 2060	32011 X/Q	VKS 6159	
		•	VKHB 2017	32210 J2/Q	-	
741.550, 741.559	VKBA 5234	•	VKHB 2234	32012 X/OCL7C	VKS 6288	
		•	VKHB 2017	32210 J2/Q	-	
741.560, 741.570	VKBA 5047	•	VKHB 2154	32014 X/Q	VKS 6173	
		•	VKHB 2060	32011 X/Q	-	
741.580	VKBA 5048	•	VKHB 2155	331293/Q	VKS 6172	
		•	VKHB 2156	33011/Q	-	
742.001-.002	VKBA 5043	•	VKHB 2074	3984/3920	VKS 6147	
		•	VKHB 2075	33822/Q/33895/Q	-	
742.100	-	•	VKHB 2076	47490/47420	VKS 6153	
		•	VKHB 2059	33111/Q	-	
742.201-.204, 742.230	VKBA 5232	•	VKHB 2137	JM 714249/210/Q	VKS 6155	
		•	VKHB 2233	33112/QVB259	-	
742.300	VKBA 5046	•	VKHB 2041	580/572/Q	VKS 6178	
		•	VKHB 2079	330356 A/Q	-	
742.400,742.410-.414	VKBA 5047	•	VKHB 2154	32014 X/Q	VKS 6173	
		•	VKHB 2060	32011 X/Q	-	
742.420-.421, 742.430, 742.432-.443	VKBA 5048	•	VKHB 2155	331293/Q	VKS 6172	
		•	VKHB 2156	33011/Q	-	

# MERCEDES-BENZ "Baumuster"



742.450, 742.460-.462	VKBA 5233	• •	VKHB 2137 VKHB 2233	JM 714249/210/Q 33112/QVB259	VKS 6174 -	
742.470-.471, 742.480-.487	VKBA 5048	• •	VKHB 2155 VKHB 2156	331293/Q 33011/Q	VKS 6172 -	
742.503	VKBA 5048	• •	VKHB 2155 VKHB 2156	331293/Q 33011/Q	VKS 6172 -	37)
744.300-.302	VKBA 5046	• •	VKHB 2041 VKHB 2079	580/572/Q 330356 A/Q	VKS 6178 -	
744.303-.305	-	• •	VKHB 2026 VKHB 2079	32216 J2/Q 330356 A/Q	VKS 6144 -	
744.309-.311, 744.330-.333	VKBA 5046	• •	VKHB 2041 VKHB 2079	580/572/Q 330356 A/Q	VKS 6178 -	
744.334, 744.336-.338	-	• •	VKHB 2026 VKHB 2079	32216 J2/Q 330356 A/Q	VKS 6144 -	
744.339-.340	-	• •	VKHB 2080 VKHB 2081	32217 J2/Q 331074/Q	VKS 6151 -	
744.341-.342, 744.344-.349	VKBA 5046	• •	VKHB 2041 VKHB 2079	580/572/Q 330356 A/Q	VKS 6178 -	
744.351	-	• •	VKHB 2026 VKHB 2079	32216 J2/Q 330356 A/Q	VKS 6144 -	
744.352, 744.400-.402, 744.405, 744.407-.409, 744.412-.414, 744.430, 744.432-.433	-	• •	VKHB 2080 VKHB 2081	32217 J2/Q 331074/Q	VKS 6151 -	
744.434	VKBA 5052	• •	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	
744.435-.437	-	• •	VKHB 2080 VKHB 2081	32217 J2/Q 331074/Q	VKS 6151 -	
744.438	VKBA 5052	• •	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	
744.442-.443	-	• •	VKHB 2080 VKHB 2081	32217 J2/Q 331074/Q	VKS 6151 -	
744.500-.502, 744.504-.508, 744.530-.532, 744.802-.804, 744.807-.810, 744.830-.835, 744.842, 744.845, 744.854-.856, 744.863, 744.868-.871, 744.876-.877	VKBA 5052	• •	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	
744.900, 744.902-.919	VKBA 5046	• •	VKHB 2041 VKHB 2079	580/572/Q 330356 A/Q	VKS 6178 -	
744.920	-	• •	VKHB 2158 VKHB 2081	33117/Q 331074/Q	VKS 6178 -	
744.921	VKBA 5236	• •	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6270 -	
744.930, 744.932, 744.936-.940, 744.942	-	• •	VKHB 2158 VKHB 2081	33117/Q 331074/Q	VKS 6178 -	
744.947-.949	VKBA 5236	• •	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6270 -	



744.950, 744.952-.955, 744.957-.960, 744.978-.979, 744.988-.989	-	•	VKHB 2157 VKHB 2159	32016 X/Q 33113/QVB022	VKS 6175 -	
745.100-.101, 745.104-.108	VKBA 5052	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	
745.109	-	•	VKHB 2083 VKHB 2083	CK-598 A/K-592 A CK-598 A/K-592 A	VKS 6145 -	
745.110-.114, 745.131	VKBA 5052	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	
745.139, 745.142	-	•	VKHB 2083 VKHB 2083	CK-598 A/K-592 A CK-598 A/K-592 A	VKS 6145 -	
745.143-.145, 745.147-.149	VKBA 5052	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	
745.600-.611, 745.613-.614, 745.616, 745.620-.625, 745.630-.639, 745.642-.650, 745.653-.657, 745.659-.661, 745.663, 745.666-.689, 745.700-.703, 745.730-.733, 745.736-.742, 745.750-.755, 745.774, 745.780-.787, 745.791, 745.799-.800	VKBA 5056	•	VKHB 2124 VKHB 2158	33020/Q 33117/Q	VKS 6176 -	
745.810, 745.812, 745.820, 745.822, 745.824-.827	VKBA 5236	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6270 -	
745.880-.881	VKBA 5056	•	VKHB 2124 VKHB 2158	33020/Q 33117/Q	VKS 6176 -	
748.210-.211	VKBA 5370	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6334 -	30)
	VKBA 5369	•	VKHB 2162 VKHB 2306	33021/Q 32020 X/Q	VKS 6334 -	29)
748.214	VKBA 5370	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6334 -	30)
	VKBA 5369	•	VKHB 2162 VKHB 2306	33021/Q 32020 X/Q	VKS 6334 -	29)
748.216	VKBA 5370	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6334 -	30)
	VKBA 5369	•	VKHB 2162 VKHB 2306	33021/Q 32020 X/Q	VKS 6334 -	29)
748.218	VKBA 5369	•	VKHB 2162 VKHB 2306	33021/Q 32020 X/Q	VKS 6334 -	29)
	VKBA 5370	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6334 -	30)
748.230	VKBA 5370	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6334 -	30)
	VKBA 5369	•	VKHB 2162 VKHB 2306	33021/Q 32020 X/Q	VKS 6334 -	29)
748.234	VKBA 5370	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6334 -	30)
	VKBA 5369	•	VKHB 2162 VKHB 2306	33021/Q 32020 X/Q	VKS 6334 -	29)

# MERCEDES-BENZ "Baumuster"



748.236	VKBA 5370	•	VKHB 2163	33022	VKS 6334	30)
		•	VKHB 2165	33220	-	
	VKBA 5369	•	VKHB 2162	33021/Q	VKS 6334	29)
		•	VKHB 2306	32020 X/Q	-	
748.238	VKBA 5370	•	VKHB 2163	33022	VKS 6334	30)
		•	VKHB 2165	33220	-	
	VKBA 5369	•	VKHB 2162	33021/Q	VKS 6334	29)
		•	VKHB 2306	32020 X/Q	-	
748.400-.401	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
748.402-.403	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
748.430-.433	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
748.434-.436	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
748.437-.439	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
748.440	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
748.441-.445	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
748.446-.448	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
748.449-.451	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	



748.452-.454	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
748.455-.459	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
748.460-.462	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
748.463	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
748.464	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
748.465	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
748.466-.468	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
748.469-.470	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
748.471	VKBA 5341	•	VKHB 2163	33022	VKS 6334	26)
		•	VKHB 2164	30220 J2	-	
	VKBA 5059	•	VKHB 2163	33022	VKS 6183	25)
		•	VKHB 2164	30220 J2	VKS 6181	
748.590	VKBA 5401	•	VKHB 2163	33022	VKS 6353	
		•	VKHB 2329	KHM.220110/567549	-	
748.900-.901	VKBA 5302	•	VKHB 2146	33021/QVB091	VKS 6334	26)
		•	VKHB 2161	32019 X/Q	-	
	VKBA 5058	•	VKHB 2162	33021/Q	VKS 6183	25)
		•	VKHB 2161	32019 X/Q	VKS 6181	
748.902, 748.904-.907	VKBA 5376	•	VKHB 2162	33021/Q	VKS 6183	
		•	VKHB 2082	33019/Q	VKS 6181	

# MERCEDES-BENZ "Baumuster"



748.908	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
748.910	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
748.911	VKBA 5376	•	VKHB 2162 VKHB 2082	33021/Q 33019/Q	VKS 6183 VKS 6181	
748.912	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
748.913-.922, 748.925-.930, 748.932-.933, 748.936	VKBA 5376	•	VKHB 2162 VKHB 2082	33021/Q 33019/Q	VKS 6183 VKS 6181	
748.990-.999	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	26)
	VKBA 5058	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	25)
749.000	-	•	- VKHB 2070	- 32310 J2/Q	VKS 6160 -	
749.001, 749.003-.004	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
749.005	VKBA 5052	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	
749.006	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
749.007	VKBA 5052	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	
749.010	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
749.011	VKBA 5402	•	VKHB 2124 VKHB 2326	33020/Q 33116/Q	VKS 6150 -	
749.031-.036	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	
749.100-.101	-	•	- VKHB 2070	- 32310 J2/Q	VKS 6160 -	
749.102-.103, 749.105-.107	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
749.108	VKBA 5375	• +	VKHB 2280 VKHB 2003	BT1-0084/Q 32312 J2/Q	VKS 6315 VKS 6150 VKS 6146	
749.130-.141	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	



749.300-.301

VKBA 5548

- 
- 

VKHB 2225 33217/Q  
VKHB 2002 32311 J2

VKS 6150  
-

770.000-.003

VKBA 5392

- 
- 

VKHB 2321 33017/Q  
VKHB 2044 33014

VKS 6350 38)  
-

VKBA 5393

- 
- 

VKHB 2124 33020/Q  
VKHB 2326 33116/Q

VKS 6351 39)  
-

VKBA 5394

- 
- 

VKHB 2082 33019/Q  
VKHB 2170 32018 X/Q

VKS 6352 40)  
-

VKBA 5395

- 
- 

VKHB 2041 580/572/Q  
VKHB 2328 504376 A

VKS 6178 41)  
-







## PEUGEOT

Boxer .....	142
J 5 - Ser. ....	142
J 7 - Ser. ....	143
J 9 - Ser. ....	143

# PEUGEOT



Boxer 1000/1400 kg	•		VKBA 1444	•	VKHB 2275	32010 X/OCL7CVB026	-	
	•			•	VKHB 2275	32010 X/OCL7CVB026	-	
		○	VKBA 3429	•	VKHB 2266	XAA 32008 X	-	
		○		•	VKHB 2267	32006 X/Q	-	
Boxer 1800 kg	•		VKBA 3428	•	VKHB 2302	JXC 25678 CA	-	
	•			•	VKHB 2302	JXC 25678 CA	-	
		○	VKBA 3430	•	VKHB 2268	10R 33108 A	-	
		○		•	VKHB 2016	32206 J2/Q	-	
J 5 (4x4)	•		VKBA 844	•	VKHB 2275	32010 X/OCL7CVB026	-	13)
	•			•	VKHB 2275	32010 X/OCL7CVB026	-	
	•		VKBA 1444	•	VKHB 2275	32010 X/OCL7CVB026	-	8)
	•			•	VKHB 2275	32010 X/OCL7CVB026	-	
		○	-	•	-	-	-	14)
		○		•	-	-	-	
J 5 1000/1300 kg	•		VKBA 844	•	VKHB 2275	32010 X/OCL7CVB026	-	1)
	•			•	VKHB 2275	32010 X/OCL7CVB026	-	
	•		VKBA 1444	•	VKHB 2275	32010 X/OCL7CVB026	-	2)
	•			•	VKHB 2275	32010 X/OCL7CVB026	-	
		○	VKBA 845	•	VKHB 2266	XAA 32008 X	-	3)
		○		•	VKHB 2267	32006 X/Q	-	
	○	VKBA 846	•	VKHB 2266	XAA 32008 X	-	4)	
	○		•	VKHB 2267	32006 X/Q	-		
	○	VKBA 1445	•	VKHB 2266	XAA 32008 X	-	5)	
	○		•	VKHB 2267	32006 X/Q	-		
	○	VKBA 1446	•	VKHB 2266	XAA 32008 X	-	6)	
	○		•	VKHB 2267	32006 X/Q	-		
J 5 1400 kg	•		VKBA 844	•	VKHB 2275	32010 X/OCL7CVB026	-	7)
	•			•	VKHB 2275	32010 X/OCL7CVB026	-	
	•		VKBA 1444	•	VKHB 2275	32010 X/OCL7CVB026	-	8)
	•			•	VKHB 2275	32010 X/OCL7CVB026	-	
	○	VKBA 1445	•	VKHB 2266	XAA 32008 X	-	9)	
	○		•	VKHB 2267	32006 X/Q	-		
	○	VKBA 1446	•	VKHB 2266	XAA 32008 X	-	10)	
	○		•	VKHB 2267	32006 X/Q	-		
J 5 180/1800 kg	•		VKBA 844	•	VKHB 2275	32010 X/OCL7CVB026	-	1)
	•			•	VKHB 2275	32010 X/OCL7CVB026	-	
	•		VKBA 1444	•	VKHB 2275	32010 X/OCL7CVB026	-	2)
	•			•	VKHB 2275	32010 X/OCL7CVB026	-	
	○	VKBA 1462	•	VKHB 2268	10R 33108 A	-	11)	
	○		•	VKHB 2016	32206 J2/Q	-		
	○	VKBA 1463	•	VKHB 2268	10R 33108 A	-	12)	
	○		•	VKHB 2016	32206 J2/Q	-		



J 7	• •		-	•	-	-	-	15)
	• •		VKBA 804	•	-	-	-	16)
	○ ○		-	•	-	-	-	17)
J 9	• •		VKBA 804	•	-	-	-	18)
	○ ○		-	•	-	-	-	18)





## RENAULT (RVI)

Master .....	146	M - Ser. (Midliner) .....	165–170
Traffic .....	146–147	PC - Ser.....	170
AE - Ser. (Magnum) .....	147	PP - Ser. ....	170
B - Ser. (+ Messenger) .....	148	Premium .....	171
C - Ser. ....	148–150	PS - Ser. ....	171
CBH - Ser. ....	150	PX - Ser. ....	171–172
CE / P - Ser. (Maroc) .....	150	R - Ser. (+ Major) .....	172–177
CLM - Ser. ....	150–151	S - Ser. (Midliner) .....	177–181
CLR - Ser. ....	151		
G - Ser. (+ Manager / Maxter) .....	151–161		
GB - Ser. ....	161	SG - Ser. ....	181
GBC - Ser. ....	161	TB - Ser. ....	181
GBH - Ser. ....	161–162	TBH - Ser. ....	182
GC - Ser. ....	162	TLM - Ser. ....	182
GF - Ser. ....	162		
GLC - Ser. ....	162	TR - Ser .....	182–183
GLM - Ser. ....	162	110 - Ser. ....	183–184
GLR - Ser. ....	163	130 - Ser. ....	184
GR - Ser. ....	163	75.130 (4x4) .....	185
GRH - Ser. ....	163–164	85.150 (4x4) .....	185–186
JK - Ser. ....	164	90 B6/B7/B8 .....	186
JN - Ser. ....	164	95.130 (4x4) .....	186
JP - Ser. ....	164–165	150 B11/B13 .....	186
JR - Ser. ....	165	770 KB6 .....	186
JX - Ser. ....	165		
Kerax .....	165		

# RENAULT - R V I



Master (Q) RWD	•		VKBA 847	•	-	-	-	
	•		VKBA 848	•	-	-	-	
		○		•	-	-	-	
		○		•	-	-	-	
Master (R) FWD	•		VKBA 829	•	-	-	-	
	•		VKBA 828	•	-	-	-	
		○		•	-	-	-	
		○		•	-	-	-	
Master (ED../FD../HD../JD../UD..)	•		VKBA 3500	•	-	-	-	91)
	•		-	•	-	-	-	92)
	•		VKBA 3501	•	-	-	-	91)
	•		-	•	-	-	-	92)
		○		•	-	-	-	
		○		•	-	-	-	
		○		•	-	-	-	
		○		•	-	-	-	
Trafic (P)	•		VKBA 908	•	-	-	-	100)
	•		-	•	-	-	-	101)
		○		•	-	-	-	
		○		•	-	-	-	
Trafic (PA, P5, P6, P8)		○	VKBA 849	•	-	-	-	
		○		•	-	-	-	
Trafic (PC)		○	VKBA 848	•	-	-	-	
		○		•	-	-	-	
Trafic (TA, T1, T3, T4, T5, T6, T9)	•		VKBA 909	•	-	-	-	
	•		VKBA 977	•	-	-	-	93)
		○	VKBA 830	•	-	-	-	94)
		○	VKBA 977	•	-	-	-	95)
		○	VKBA 828	•	-	-	-	96)
		○	VKBA 3407	•	-	-	-	97)
		○		•	-	-	-	
Trafic (TB, T2, T7)	•		VKBA 909	•	-	-	-	
	•		VKBA 977	•	-	-	-	98)
		○	VKBA 828	•	-	-	-	96)
		○	VKBA 3407	•	-	-	-	97)
	○		•	-	-	-		
	○		•	-	-	-		



Trafic (V) 4x4	•		VKBA 909	•	-	-	-	
	•		VKBA 849	•	-	-	-	98)
	○		VKBA 848	•	-	-	-	99)
AE 380/385 TI/390 Magnum	•	E 61, E 81	VKBA 5316	•	-	-	-	71)
	•	E 81	VKBA 5308	•	-	BTF-0034	-	72)
	○	1341	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○	1345	-	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○	840 A	VKBA 5311	•	VKHB 2161	32019 X/Q	VKS 6201	
				•	VKHB 2158	33117/Q	-	
AE 420 TI/430 Magnum	•	E 61, E 81	VKBA 5316	•	-	-	-	71)
	•	E 81	VKBA 5308	•	-	BTF-0034	-	72)
	○	1341	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○	1345	-	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○	840 A	VKBA 5311	•	VKHB 2161	32019 X/Q	VKS 6201	
				•	VKHB 2158	33117/Q	-	
AE 470 Magnum	•		VKBA 5308	•	-	BTF-0034	-	
	•		-	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○	Trailing axle	-	•	-	-	-	
AE 500/520/560 Magnum	•	E 61, E 81	VKBA 5316	•	-	-	-	71)
	•	E 81	VKBA 5308	•	-	BTF-0034	-	72)
	○	1341	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○	1345	-	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○	840 A	VKBA 5311	•	VKHB 2161	32019 X/Q	VKS 6201	
				•	VKHB 2158	33117/Q	-	



# RENAULT - R V I



B 110 (4x2)	•		VKBA 5206	•	VKHB 2190 VKHB 2057	33108/Q 33205/QVQ077	VKS 6118 -	67)	
	•		VKBA 5359	•	VKHB 2190 VKHB 2294	33108/Q 32305 J2	VKS 6118 -	68)	
	•	○	569-01-39	VKBA 5207	•	VKHB 2060 VKHB 2191	32011 X/Q 32010 X/Q	VKS 6238 VKS 6229	46)
B 110 (4x4)	•		-	•	VKHB 2199 VKHB 2060	32013 X/Q 32011 X/Q	- -	46)	
	•		569-10	-	VKHB 2234 VKHB 2191	32012 X/OCL7C 32010 X/Q	- -	47)	
	•	○	669-04	-	VKHB 2047 VKHB 2060	33013/Q 32011 X/Q	- -	46)	
	•	○	669-04	-	VKHB 2044 VKHB 2045	33014 33012/Q	VKS 6237 VKS 6219	47)	
B 120	•		VKBA 5206	•	VKHB 2190 VKHB 2057	33108/Q 33205/QVQ077	VKS 6118 -	67)	
	•		VKBA 5359	•	VKHB 2190 VKHB 2294	33108/Q 32305 J2	VKS 6118 -	68)	
	•	○	569-01-39	VKBA 5207	•	VKHB 2060 VKHB 2191	32011 X/Q 32010 X/Q	VKS 6238 VKS 6229	46)
B 70	•		369	VKBA 5206	•	VKHB 2190 VKHB 2057	33108/Q 33205/QVQ077	VKS 6118 -	17)
	•		369	VKBA 5205	•	VKHB 2188 VKHB 2189	32008 X/Q 30205 J2/Q	VKS 6118 -	16)
	•	○	569-39	VKBA 5207	•	VKHB 2060 VKHB 2191	32011 X/Q 32010 X/Q	VKS 6238 VKS 6229	
B 80	•		VKBA 5206	•	VKHB 2190 VKHB 2057	33108/Q 33205/QVQ077	VKS 6118 -	67)	
	•		VKBA 5359	•	VKHB 2190 VKHB 2294	33108/Q 32305 J2	VKS 6118 -	68)	
	•	○	569-01-39	VKBA 5207	•	VKHB 2060 VKHB 2191	32011 X/Q 32010 X/Q	VKS 6238 VKS 6229	46)
B 90	•		369	VKBA 5206	•	VKHB 2190 VKHB 2057	33108/Q 33205/QVQ077	VKS 6118 -	
	•	○	569-39	VKBA 5207	•	VKHB 2060 VKHB 2191	32011 X/Q 32010 X/Q	VKS 6238 VKS 6229	
	•	○	669-02	-	VKHB 2044 VKHB 2045	33014 33012/Q	VKS 6237 VKS 6219		
C 210	•		E 6A - 4C	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	23)
	•		E 6A - 4C	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	24)
	•	○	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	












C 230/260/280/290 (4x2, 4x4)	•		E 6A - 4C	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	24)
	•		E 6A - 711	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
	•		PA 721-B	-	•	- VKHB 2080	- 32217 J2/Q	VKS 6234 -	
	○	○	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
C 300/340 TI (4x2, 4x4)	•		E 6A - 4C	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	23)
	•		E 6A - 4C	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	24)
	•		E 6A - 711	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
	•		PA 721-B	-	•	- VKHB 2080	- 32217 J2/Q	VKS 6234 -	
	○	○	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
C 260/280/290 (6x4)	•		E5A-4E	VKBA 5221	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	52)
	•		E5A-4E	VKBA 5315	•	VKHB 2051 VKHB 2068	33213/Q 33210/Q	VKS 6175 -	43)
	•		E 6A - 4C	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	23)
	•		E 6A - 4C	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	24)
	•		E 6A - 711	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
	○	○	PMA/PR 1141-A	-	•	VKHB 2161 -	32019 X/Q -	VKS 6201 -	
	○	○	PMA/PR 1321	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -	
○	○	PMA/PR 1341	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -		
C 300/340 TI (6x4)	•		E 5A-4E	VKBA 5221	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	52)
	•		E 5A-4E	VKBA 5315	•	VKHB 2051 VKHB 2068	33213/Q 33210/Q	VKS 6175 -	43)
	•		E 6A - 4C	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	23)
	•		E 6A - 4C	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	24)
	•		E 6A - 711	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
	○	○	PMA/PR 1141-A	-	•	VKHB 2161 -	32019 X/Q -	VKS 6201 -	

# RENAULT - R V I



C 300/340 TI (6x4) .../...	• •	○	PMA/PR 1321	VKBA 5214	• •	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -
		○	PMA/PR 1341	VKBA 5218	• •	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -
CBH 280/340/350/380 (6x4)	• •	○	E 6A	VKBA 5216	• •	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -
		○	P/PMA 1532	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -
CBH 280/340/350 (6x6)	• •	○	PA 721	-	• •	- VKHB 2080	- 32217 J2/Q	VKS 6234 -
		○	P/PMA 1532	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -
CBH 320/385 (6x4)	• •	○	E6B - 811	VKBA 5216	• •	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -
		○	PMA/P 1532-01	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -
CBH 320/385 (6x6)	• •	○	PA 721 - 02	-	• •	- VKHB 2080	- 32217 J2/Q	VKS 6234 -
		○	PMA/P 1532-01	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -
CE 160 Maroc	• • • • • • • • • •	○	E 400-04/14	-	• •	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6239 -
		○	E 408-AA	VKBA 5342	• •	VKHB 2066 VKHB 2068	33214/Q 33210/Q	VKS 6303 -
		○	E 408-05/ 13/15/24	-	• •	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6239 -
		○	-	-	• •	VKHB 2169 VKHB 2169	32017 X/Q 32017 X/Q	- -
		○	P 821-13/17	-	• •	- VKHB 2080	- 32217 J2/Q	VKS 6234 -
		○	P 1021-03	-	• •	- VKHB 2080	- 32217 J2/Q	VKS 6234 -
		○	P 1040 F	VKBA 5311	• •	VKHB 2161 VKHB 2158	32019 X/Q 33117/Q	VKS 6201 -
		○	P 1041 F	-	• •	VKHB 2161 -	32019 X/Q -	VKS 6201 -
		○	P 1140 F	VKBA 5311	• •	VKHB 2161 VKHB 2158	32019 X/Q 33117/Q	VKS 6201 -
		○	P 1141 F	-	• •	VKHB 2161 -	32019 X/Q -	VKS 6201 -
CLM 280/340/350/380	• •	○	E 6A - 511	VKBA 5216	• •	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -
		○	P 1532-11/12	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -

									
CLM 320/385 (4x2)	• •	○ ○	E6A - 511/811	VKBA 5216	• •	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
			P 1532 - 01/11	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
CLR 220 (4x2)	• •	○ ○	E 6A - 711	VKBA 5216	• •	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
			P 1332	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
CLR 220 (4x4)	• •	○ ○	PA 721 B	-	• •	- VKHB 2080	- 32217 J2/Q	VKS 6234 -	
			P 1332	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
CLR 230	• • • • ○ ○ ○ ○	○ ○ ○ ○ ○ ○	E 5A	VKBA 5221	• •	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	52)
			E 5A	VKBA 5315	• •	VKHB 2051 VKHB 2068	33213/Q 33210/Q	VKS 6175 -	43)
			E 6A	VKBA 5216	• •	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
			P 1332	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
			PR/PMA 1341	VKBA 5218	• •	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
			PR/PMA 1141 A	-	• •	VKHB 2161 -	32019 X/Q -	VKS 6201 -	
G 170-11/13/15	• • • •	○ ○	E 4A	-	• •	VKHB 2173 VKHB 2056	33212/Q 33109/Q	VKS 6202 -	27)
			E 5A - 921	VKBA 5220	• •	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	25)
			E 5A	VKBA 5221	• •	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	26)
			P 1141	VKBA 5218	• •	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
G 170-16/17	• • •	○ ○	E 5A	VKBA 5220	• •	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	28
			E 5A	VKBA 5221	• •	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	26)
			P 1141	VKBA 5218	• •	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
G 200	• • • •	○ ○	E 5	VKBA 5221	• •	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	48)
			E 5	VKBA 5220	• •	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	49)
			E 5	VKBA 5221	• •	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	50)
			E 6	VKBA 5216	• •	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	48)

# RENAULT - R V I



G 200 .../...	•	E 6	VKBA 5317	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6202 -	49)
	•	E 6	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	51)
	○	P 1140	VKBA 5309	•	VKHB 2192 VKHB 2158	JF 9549/9510 33117/Q	VKS 6201 -	
	○	P 1141, P 1341	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
	○	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
	○	P 1345	-	•	VKHB 2192 -	JF 9549/9510 -	VKS 6201 -	
G 210	•	E 5A - 4C	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	28)
	•	E 5A - 4C	VKBA 5221	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	26)
	•	E 5A - 23	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	
	•	E 5A - 821	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	80)
	•	E 5A - 821	VKBA 5221	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	74)
	•	E 5A - 921	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	81)
	•	E 6A - 4D	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	23)
	•	E 6A - 4D	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	24)
	○	P 1141, P 1341	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
	○	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
G 210 Manager	•	E 5	VKBA 5221	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	48)
	•	E 5	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	49)
	•	E 5	VKBA 5221	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	50)
	•	E 6	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	48)
	•	E 6	VKBA 5317	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6202 -	49)
	•	E 6	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	51)
	○	P 1140	VKBA 5309	•	VKHB 2192 VKHB 2158	JF 9549/9510 33117/Q	VKS 6201 -	



G 210 Manager .../...	○	P 1141, P 1341	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○			•	VKHB 2194	33216/Q	-	
	○	P 1332	VKBA 5217	•	VKHB 2186	JHM 720249/JHM 720210	VKS 6201	
	○			•	VKHB 2187	64432/64708	-	
	○	P 1345	-	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○			•	-	-	-	
G 220 BOM	•	E 5A - 23	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	53)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A - 23	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	50)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A - 23	VKBA 5315	•	VKHB 2051	33213/Q	VKS 6175	43)
	•			•	VKHB 2068	33210/Q	-	
	•	E 5B - 4C	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	48)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5B - 4C	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	49)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5B - 4C	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	50)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5B - 4C	VKBA 5315	•	VKHB 2051	33213/Q	VKS 6175	43)
•			•	VKHB 2068	33210/Q	-		
•	E 6B - 4D	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	48)	
•			•	VKHB 2184	T2ED 045	-		
•	E 6B - 4D	VKBA 5317	•	VKHB 2066	33214/Q	VKS 6202	49)	
•			•	VKHB 2184	T2ED 045	-		
•	E 6B - 4D	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	51)	
•			•	VKHB 2184	T2ED 045	-		
	○	P 1332	VKBA 5217	•	VKHB 2186	JHM 720249/JHM 720210	VKS 6201	
	○			•	VKHB 2187	64432/64708	-	
	○	P 1341 C	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○			•	VKHB 2194	33216/Q	-	
	○	P 1345	-	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○			•	-	-	-	
G 230	•	E 5A - 4C	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	28)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A - 4C	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	26)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A - 23	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A - 821	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	80)
	•			•	VKHB 2067	33209/Q	-	
•	E 5A - 821	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	74)	
•			•	VKHB 2067	33209/Q	-		
•	E 5A - 921	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	81)	
•			•	VKHB 2067	33209/Q	-		
•	E 6A - 4D	VKBA 5215	•	VKHB 2066	33214/Q	VKS 6175	23)	
•			•	VKHB 2067	33209/Q	-		

# RENAULT - R V I



G 230 .../...	•	E 6A - 4D	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	24)
	•	P 1141, P 1341	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
	•	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
G 230 Incendie	•	E 5A - 921	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	
	•	E 5A - 4C	VKBA 5221	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	52)
	•	E 5A - 4C	VKBA 5315	•	VKHB 2051 VKHB 2068	33213/Q 33210/Q	VKS 6175 -	43)
	•	P 1141	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
G 230 TI	•	E 5	VKBA 5221	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	48)
	•	E 5	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	49)
	•	E 5	VKBA 5221	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	50)
	•	E 6	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	48)
	•	E 6	VKBA 5317	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6202 -	49)
	•	E 6	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	51)
	•	P 1140	VKBA 5309	•	VKHB 2192 VKHB 2158	JF 9549/9510 33117/Q	VKS 6201 -	
	•	P 1141, P 1341	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
	•	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
	•	P 1345	-	•	VKHB 2192 -	JF 9549/9510 -	VKS 6201 -	
G 235 Maxter 4x2	•		VKBA 5308	•	-	BTF-0034 -	- -	
	•	P 1541 A	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
	•	P 1545 A	-	•	VKHB 2192 -	JF 9549/9510 -	VKS 6201 -	
G 260 11/13 T	•	E 4A	-	•	VKHB 2173 VKHB 2056	33212/Q 33109/Q	VKS 6202 -	27)
	•	E 5A	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	29)
	•	P 1141	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	



G 260 15 T	•		E 4A	-	•	VKHB 2173	33212/Q	VKS 6202	30)
	•		E 5A	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	31)
	•	○	P 1141	VKBA 5218	•	VKHB 2067	33209/Q	-	
						VKHB 2192	JF 9549/9510	VKS 6201	
						VKHB 2194	33216/Q	-	
G 260 16/17 T	•		E 5A	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	28)
	•		E 5A - 4C	VKBA 5221	•	VKHB 2067	33209/Q	-	
	•	○	P 1141	VKBA 5218	•	VKHB 2051	33213/Q	VKS 6175	26)
						VKHB 2067	33209/Q	-	
						VKHB 2192	JF 9549/9510	VKS 6201	
						VKHB 2194	33216/Q	-	
G 260 19 T	•		E 5A	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	
	•		E 5A - 821	VKBA 5221	•	VKHB 2067	33209/Q	-	
	•		E 6A	VKBA 5215	•	VKHB 2051	33213/Q	VKS 6175	74)
	•		E 6A	VKBA 5216	•	VKHB 2067	33209/Q	-	
	•		E 6A	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	23)
	•		E 6A	VKBA 5216	•	VKHB 2067	33209/Q	-	
	•		E 62 - CB	VKBA 5316	•	VKHB 2066	33214/Q	VKS 6175	24)
						VKHB 2184	T2ED 045	-	
						-	-	-	69)
						-	-	-	
		○	P 1332	VKBA 5217	•	VKHB 2186	JHM 720249/JHM 720210	VKS 6201	
		○	P 1341, PR 1341	VKBA 5218	•	VKHB 2187	64432/64708	-	
		○			•	VKHB 2192	JF 9549/9510	VKS 6201	
		○			•	VKHB 2194	33216/Q	-	
G 260 22 T	•		E 5A	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	28)
	•		E 5A	VKBA 5220	•	VKHB 2067	33209/Q	-	
		○	P 1141	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201	
		○			•	VKHB 2194	33216/Q	-	
G 260 26 T	•		E 6A	VKBA 5215	•	VKHB 2066	33214/Q	VKS 6175	23)
	•		E 6A	VKBA 5216	•	VKHB 2067	33209/Q	-	
	•		E 6A	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	24)
	•		E 6A	VKBA 5216	•	VKHB 2184	T2ED 045	-	
						VKHB 2051	33213/Q	VKS 6202	
						VKHB 2067	33209/Q	-	
		○	P/PR 1341	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201	
		○			•	VKHB 2194	33216/Q	-	
G 270 BOM	•		E 5A - 23	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	53)
	•		E 5A - 23	VKBA 5221	•	VKHB 2067	33209/Q	-	
	•		E 5A - 23	VKBA 5315	•	VKHB 2051	33213/Q	VKS 6175	50)
	•		E 5A - 23	VKBA 5315	•	VKHB 2068	33210/Q	-	
						VKHB 2051	33213/Q	VKS 6175	43)
						VKHB 2067	33209/Q	-	
						VKHB 2051	33213/Q	VKS 6175	48)
						VKHB 2067	33209/Q	-	



# RENAULT - R V I



G 270 BOM .../...	•	E 5B - 4C	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	49)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5B - 4C	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	50)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5B - 4C	VKBA 5315	•	VKHB 2051	33213/Q	VKS 6175	43)
	•			•	VKHB 2068	33210/Q	-	
	•	E 6B - 4D	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	48)
	•			•	VKHB 2184	T2ED 045	-	
G 270 Incendie	•	E 5A - 921	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A - 4C	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	52)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A - 4C	VKBA 5315	•	VKHB 2051	33213/Q	VKS 6175	43)
	•			•	VKHB 2068	33210/Q	-	
G 270 Maxter 4x2	•		VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201	
	•	P 1541 A	VKBA 5218	•	VKHB 2194	33216/Q	-	
	•	P 1545 A	-	•	VKHB 2192	JF 9549/9510	VKS 6201	
G 270/280 Manager 4x2, 6x2/4	•	E 5A - 23	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	53)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A - 23	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	50)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A - 23	VKBA 5315	•	VKHB 2051	33213/Q	VKS 6175	43)
	•			•	VKHB 2068	33210/Q	-	
	•	E 5A - 4C, E 5B - 4C, E 5A - 821	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	48)
•			•	VKHB 2067	33209/Q	-		
G 270/280 Manager 4x2, 6x2/4	•	E 5A - 4C, E 5B - 4C, E 5A - 821	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	49)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A - 4C, E 5B - 4C, E 5A - 821	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	50)
			•	VKHB 2067	33209/Q	-		



	•	E 5A - 4C, E 5B - 4C, E 5A - 821	VKBA 5315	•	VKHB 2051 VKHB 2068	33213/Q 33210/Q	VKS 6175 -	43)
	•	E 6A - 4D, E 6B - 4D	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
	•	E 6A, E 6B	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	48)
	•	E 6A, E 6B	VKBA 5317	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6202 -	49)
	•	E 6A, E 6B	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	51)
	○	P 1141, P 1341	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	53)
	○	P 1142, P 1345	-	•	VKHB 2192 -	JF 9549/9510 -	VKS 6201 -	
	○	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
G 270/280 Manager 4x4	•		-	•	- VKHB 2080	- 32217 J2/Q	VKS 6234 -	
	○	P 1141, P 1341	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	53)
	○	P 1142, P 1345	-	•	VKHB 2192 -	JF 9549/9510 -	VKS 6201 -	
	○	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
G 270/280 Manager 6x2, 6x4, 8x4	•	E 5A - 821	VKBA 5221	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	75)
	•	E 5A - 821	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	76)
	•	E 5A - 821	VKBA 5221	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	79)
	•	E 5A - 821	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	77)
	•	E 5A - 821	VKBA 5221	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	78)
	•	E 5A - 821	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	43)
	•	E 6A, E 6B	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	48)
	•	E 6A, E 6B	VKBA 5317	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6202 -	49)
	•	E 6A, E 6B	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	51)
	•	E 6A - 4D, E 6B - 4D	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
	○	PR 1141 A, PMA 1141 A	-	•	VKHB 2161 -	32019 X/Q -	VKS 6201 -	

# RENAULT - R V I



G 270/280 Manager 6x2, 6x4, 8x4 .../...		○	P 1332	VKBA 5217	●	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
		○	PMA 1341	VKBA 5218	●	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
		○	P 1345	-	●	VKHB 2192 -	JF 9549/9510 -	VKS 6201 -	
G 290 (VTL) 6x4	● ●	●	E 6A	VKBA 5216	●	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
			E 6A	VKBA 5317	●	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6202 -	70)
		○	1341	VKBA 5218	●	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
G 290 16/17 T	● ●	●	E 5A	VKBA 5220	●	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	28)
			E 5A - 4C	VKBA 5221	●	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	26)
		○	P 1141	VKBA 5218	●	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
G 290 19 T	● ●	●	E 5A - 23	VKBA 5220	●	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	28)
			E 6A	VKBA 5215	●	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	23)
		E 6A	VKBA 5216	●	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	24)	
		○	P 1332	VKBA 5217	●	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
		○	P 1341, PR 1341	VKBA 5218	●	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
G 290 VTL	● ●	○	E 6A - 4D	VKBA 5216	●	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
			PR/PMA 1341	VKBA 5218	●	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
G 300 Maxter 4x2	● ●	○		VKBA 5308	●	- -	BTF-0034 -	- -	
			P 1541 A	VKBA 5218	●	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
			P 1545 A	-	●	VKHB 2192 -	JF 9549/9510 -	VKS 6201 -	
G 300 Maxter 6x4, 8x4	● ●	●	ESS - 83	VKBA 5316	●	- -	- -	- -	46)
			ESS - 83	VKBA 5308	●	- -	BTF-0034 -	- -	47)
		○	PMA/PR 1141 A	-	●	VKHB 2161 -	32019 X/Q -	VKS 6201 -	
		○	PMA/PR 1841 B	VKBA 5218	●	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	



	○	PMA/PR 1845 B	-	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○			•	-	-	-	
G 300/330/340 TI Manager 4x2, 6x2/4	•	E 5A - 23	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	53)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A - 23	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	50)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A - 23	VKBA 5315	•	VKHB 2051	33213/Q	VKS 6175	43)
	•			•	VKHB 2068	33210/Q	-	
	•	E 5A - 4C, E 5B - 4C, E 5A - 821	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	48)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A - 4C, E 5B - 4C, E 5A - 821	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	49)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A - 4C, E 5B - 4C, E 5A - 821	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	50)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A - 4C, E 5B - 4C, E 5A - 821	VKBA 5315	•	VKHB 2051	33213/Q	VKS 6175	43)
	•			•	VKHB 2068	33210/Q	-	
	•	E 6A - 4D, E 6B - 4D	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	
	•			•	VKHB 2184	T2ED 045	-	
	•	E 6A, E 6B	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	48)
	•			•	VKHB 2184	T2ED 045	-	
	•	E 6A, E 6B	VKBA 5317	•	VKHB 2066	33214/Q	VKS 6202	49)
	•			•	VKHB 2184	T2ED 045	-	
	•	E 6A, E 6B	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	51)
	•			•	VKHB 2184	T2ED 045	-	
	○	P 1141, P 1341	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201	53)
	○			•	VKHB 2194	33216/Q	-	
	○	P 1142, P 1345	-	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○			•	-	-	-	
	○	P 1332	VKBA 5217	•	VKHB 2186	JHM 720249/JHM 720210	VKS 6201	
	○			•	VKHB 2187	64432/64708	-	
G 300/330/340 TI Manager 4x4	•		-	•	-	-	VKS 6234	
	•			•	VKHB 2080	32217 J2/Q	-	
	○	P 1141, P 1341	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201	53)
	○			•	VKHB 2194	33216/Q	-	
	○	P 1142, P 1345	-	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○			•	-	-	-	
	○	P 1332	VKBA 5217	•	VKHB 2186	JHM 720249/JHM 720210	VKS 6201	
	○			•	VKHB 2187	64432/64708	-	

# RENAULT - R V I



G 300/330/340 TI  
Manager 6x2, 6x4, 8x4

•	•	E 5A - 821	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	75)	
•	•			•	VKHB 2067	33209/Q	-		
•	•	E 5A - 821	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	76)	
•	•			•	VKHB 2067	33209/Q	-		
•	•	E 5A - 821	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	79)	
•	•			•	VKHB 2067	33209/Q	-		
•	•	E 5A - 821	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	77)	
•	•			•	VKHB 2067	33209/Q	-		
•	•	E 5A - 821	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	78)	
•	•			•	VKHB 2067	33209/Q	-		
•	•	E 5A - 821	VKBA 5315	•	VKHB 2051	33213/Q	VKS 6175	43)	
•	•			•	VKHB 2068	33210/Q	-		
•	•	E 6A, E 6B	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	48)	
•	•			•	VKHB 2184	T2ED 045	-		
•	•	E 6A, E 6B	VKBA 5317	•	VKHB 2066	33214/Q	VKS 6202	49)	
•	•			•	VKHB 2184	T2ED 045	-		
•	•	E 6A, E 6B	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	51)	
•	•			•	VKHB 2184	T2ED 045	-		
•	•	E 6A - 4D	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175		
•	•			•	VKHB 2184	T2ED 045	-		
•	○	PMA/PR 1141 A	-	•	VKHB 2161	32019 X/Q	VKS 6201		
•	○			•	-	-	-		
•	○	P 1332	VKBA 5217	•	VKHB 2186	JHM 720249/JHM 720210	VKS 6201		
•	○			•	VKHB 2187	64432/64708	-		
•	○	PMA 1341	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201		
•	○			•	VKHB 2194	33216/Q	-		
•	○	P 1345	-	•	VKHB 2192	JF 9549/9510	VKS 6201		
•	○			•	-	-	-		
<hr/>									
G 320-19 (VF6-BA)	•	E 6A - 4D	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175		
	•			•	VKHB 2184	T2ED 045	-		
	○	P 1332	VKBA 5217	•	VKHB 2186	JHM 720249/JHM 720210	VKS 6201		
	○			•	VKHB 2187	64432/64708	-		
<hr/>									
G 320-19 T (VF6-BG)	•	E 5A - 821	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175		
	•			•	VKHB 2067	33209/Q	-		
	○	P 1332	VKBA 5217	•	VKHB 2186	JHM 720249/JHM 720210	VKS 6201		
	○			•	VKHB 2187	64432/64708	-		
<hr/>									
G 340 TI 4x4 (VF6-BH02)	•		-	•	-	-	VKS 6234		
	•			•	VKHB 2080	32217 J2/Q	-		
	○		VKBA 5217	•	VKHB 2186	JHM 720249/JHM 720210	VKS 6201		
	○			•	VKHB 2187	64432/64708	-		
<hr/>									
G 340 TI Maxter 4x2	•		VKBA 5308	•	-	BTF-0034	-		
	•			•	-	-	-		
	○	P 1541 A	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201		
	○			•	VKHB 2194	33216/Q	-		
	○	P 1545 A	-	•	VKHB 2192	JF 9549/9510	VKS 6201		
	○			•	-	-	-		



G 340 TI Maxter 6x4, 8x4	•		ESS - 83	VKBA 5316	•	-	-	-	46)
	•		ESS - 83	VKBA 5308	•	-	BTF-0034	-	47)
	•	○	PMA/PR 1141 A	-	•	VKHB 2161	32019 X/Q	VKS 6201	
	•	○	PMA/PR 1841 B	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201	
	•	○	PMA/PR 1845 B	-	•	VKHB 2194	33216/Q	-	
G 340 TI Maxter 6x6	•			-	•	VKHB 2192	JF 9549/9510	VKS 6201	
	•	○		-	•	VKHB 2192	JF 9549/9510	VKS 6201	
GB 131-HR15	•		E4A	-	•	VKHB 2173	33212/Q	VKS 6202	
	•			-	•	VKHB 2056	33109/Q	-	
	•	○	P 920-B1/F/G/H	-	•	-	-	VKS 6234	
GB 191	•	○	P 921 - B1/G	-	•	-	-	VKS 6234	
	•	○		-	•	-	-	-	
GB 231	•		E4A	-	•	VKHB 2173	33212/Q	VKS 6202	
	•			-	•	VKHB 2056	33109/Q	-	
GBC 180	•	○	Forward rear	-	•	VKHB 2080	32217 J2/Q	-	
	•	○	Rear rear	-	•	VKHB 2026	32216 J2/Q	-	
GBH 260 (6x6)	•		PKBS 3	VKBA 5223	•	VKHB 2170	32018 X/Q	VKS 6232	
	•				•	VKHB 2169	32017 X/Q	VKS 6232	
	•	○	PMA/PR 1032	VKBA 5217	•	VKHB 2186	JHM 720249/JHM 720210	VKS 6201	
GBH 260 (6x4)	•	○			•	VKHB 2187	64432/64708	-	
	•		E 6A	VKBA 5215	•	VKHB 2066	33214/Q	VKS 6175	73)
GBH 280 E (6x6)	•		PA 721	-	•	VKHB 2067	33209/Q	-	
	•	○	PMA/P 1532	VKBA 5217	•	VKHB 2186	JHM 720249/JHM 720210	VKS 6201	
	•	○			•	VKHB 2187	64432/64708	-	

# RENAULT - R V I



GBH 280 (6x4 D)	•	E 6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKBS 6175 -	73)
	•			•				
	•			•				
GBH 280 (6x4)	•	E 6A - 511	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKBS 6175 -	24)
	•			•				
	•			•				
GBH 280 (6x6)	•	PMA/PR 1032	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKBS 6201 -	
	•			•				
	•			•				
GBH 280 (6x4)	•	E 6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKBS 6175 -	73)
	•			•				
	•			•				
GBH 280 (6x4)	•	E 6A	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKBS 6175 -	24)
	•			•				
	•			•				
GBH 280 (6x6)	•	PMA/PR 1532	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKBS 6201 -	
	•			•				
	•			•				
GBH 280 (6x6)	•	PKBS 3	VKBA 5223	•	VKHB 2170 VKHB 2169	32018 X/Q 32017 X/Q	VKBS 6232 VKBS 6232	
	•			•				
	•			•				
GC 191	•	PMA/PR 1032	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKBS 6201 -	
	•			•				
	•			•				
GC 191	•	E 5A	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKBS 6202 -	
	•			•				
	•			•				
GC 231	•	P 1021	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKBS 6201 -	
	•			•				
	•			•				
GC 231	•	E 5A	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKBS 6202 -	
	•			•				
	•			•				
GC 231	•	P 1021	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKBS 6201 -	
	•			•				
	•			•				
GF 191	•	E 5A	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKBS 6202 -	
	•			•				
	•			•				
GF 191	•	P 1021	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKBS 6201 -	
	•			•				
	•			•				
GF 231	•	E 5A	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKBS 6202 -	
	•			•				
	•			•				
GF 231	•	P 1021	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKBS 6201 -	
	•			•				
	•			•				
GLC 190	•	E 5A	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKBS 6202 -	
	•			•				
	•			•				
GLC 190	•	P 1021	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKBS 6201 -	33)
	•			•				
	•			•				
GLC 190	•	P 1321	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKBS 6201 -	34)
	•			•				
	•			•				
GLM 280	•	E 6A - 51	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKBS 6175 -	23)
	•			•				
	•			•				
GLM 280	•	E 6A - 51	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKBS 6175 -	24)
	•			•				
	•			•				
GLM 280	•	P 1532	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKBS 6201 -	
	•			•				
	•			•				



GLR 190/230	•		E 6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175	23)
	•		E 6A	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175	24)
	○	○	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201	-
GLR 230 (4x4)	•		PA 721	-	•	- VKHB 2080	- 32217 J2/Q	VKS 6234	-
	○	○	PMA/P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201	-
GR 191	•		E 6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175	23)
	•		E 6A	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175	24)
	○	○	P 1321	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201	-
	○	○	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201	-
GR 231	•		E 6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175	23)
	•		E 6A	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175	24)
	○	○	P 1321	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201	-
	○	○	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201	-
GR 280/350	•		E 6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175	-
	○	○	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201	-
GR 305	•		E 6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175	-
	○	○	P 1332, P1332 B	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201	-
GRH 235	•		E 6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175	-
	○	○	PMA/P 1021	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201	-
GRH 235 R	•		E 6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175	23)
	○	○	PMA/P 1321	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201	-



# RENAULT - R V I



GRH 305 (6x4)	•	E 6A - 21	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	
	•	PMA 1021, PMA 1321	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -	
	•	PMA 1032 B, PMA 1532	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
GRH 350 6x4 GRH 350 TS	•	E 6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	
	•	PMA/PR 1032 B, PMA/P 1532	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
	•	PMA/PR/P 1021 PMA/PR 1321	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -	
JK 50/55/60/65/75	•	402	-	•	VKHB 2067 VKHB 2016	33209/Q 32206 J2/Q	VKS 6130 -	12)
	•	402	-	•	VKHB 2067 VKHB 2179	33209/Q 33206/Q	VKS 6130 -	13)
	•	669	-	•	VKHB 2044 VKHB 2045	33014 33012/Q	VKS 6237 VKS 6219	
	•	70 HD	-	•	VKHB 2044 VKHB 2045	33014 33012/Q	VKS 6237 VKS 6230	
	•							
JN 60/75/85/90/95	•	E 401	-	•	VKHB 2017 VKHB 2018	32210 J2/Q 32207 J2/Q	VKS 6235 -	
	•	SOMA 95	-	•	VKHB 2046 VKHB 2047	33015/Q 33013/Q	VKS 6237 VKS 6236	
JP 11	•	400	-	•	VKHB 2019 VKHB 2020	32211 J2/Q 32208 J2/Q	VKS 6239 -	
	•	P 620 F	VKBA 5201	•	VKHB 2048 VKHB 2046	33018/Q 33015/Q	VKS 6233 -	14)
	•	P 620 F1	-	•	VKHB 2048 VKHB 2046	33018/Q 33015/Q	VKS 6234 -	15)
	•	15 M	-	•	VKHB 2048 VKHB 2046	33018/Q 33015/Q	VKS 6233 VKS 6231	
JP 13 A/B/C	•	400	-	•	VKHB 2019 VKHB 2020	32211 J2/Q 32208 J2/Q	VKS 6239 -	
	•	P 820 F	VKBA 5201	•	VKHB 2048 VKHB 2046	33018/Q 33015/Q	VKS 6233 -	14)
	•	P 820 F1	-	•	VKHB 2048 VKHB 2046	33018/Q 33015/Q	VKS 6234 -	15)
	•	15 M/MHD, 17 M	-	•	VKHB 2048 VKHB 2046	33018/Q 33015/Q	VKS 6233 VKS 6231	



JP 14 BOM	•		400	-	•	VKHB 2019	32211 J2/Q	VKS 6239	
	•				•	VKHB 2020	32208 J2/Q	-	
		○	P 820 F	VKBA 5201	•	VKHB 2048	33018/Q	VKS 6233	14)
		○			•	VKHB 2046	33015/Q	-	
	○	P 820 F1	-	•	VKHB 2048	33018/Q	VKS 6234	15)	
	○			•	VKHB 2046	33015/Q	-		
	○	15 M/MHD, 17 M	-	•	VKHB 2048	33018/Q	VKS 6233		
	○			•	VKHB 2046	33015/Q	VKS 6231		
JR 19/21	•		400	-	•	VKHB 2019	32211 J2/Q	VKS 6239	
	•				•	VKHB 2020	32208 J2/Q	-	
		○	P 17 M	-	•	VKHB 2048	33018/Q	VKS 6233	
		○			•	VKHB 2046	33015/Q	VKS 6231	
	○	P 821 F	-	•	-	-	VKS 6233	14)	
	○			•	-	-	-		
	○	P 821 F1	-	•	-	-	VKS 6234	15)	
	○			•	-	-	-		
JX 21	•		400	-	•	VKHB 2019	32211 J2/Q	VKS 6239	
	•				•	VKHB 2020	32208 J2/Q	-	
		○	P 17 M	-	•	VKHB 2048	33018/Q	VKS 6233	
		○			•	VKHB 2046	33015/Q	VKS 6231	
	○	P 821 F	-	•	-	-	VKS 6233	14)	
	○			•	-	-	-		
	○	P 821 F1	-	•	-	-	VKS 6234	15)	
	○			•	-	-	-		
KERAX	•			VKBA 5308	•	-	BTF-0034	-	
	•				•	-	-	-	
		○	1141 A	-	•	VKHB 2161	32019 X/Q	VKS 6201	
		○			•	-	-	-	
		○	1541 A	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201	
		○			•	VKHB 2194	33216/Q	-	
	○	1545 A	-	•	VKHB 2192	JF 9549/9510	VKS 6201		
	○			•	-	-	-		
	○	1841 B	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201		
	○			•	VKHB 2194	33216/Q	-		
	○	1845 B	-	•	VKHB 2192	JF 9549/9510	VKS 6201		
	○			•	-	-	-		
M 140/160	•		E 400	-	•	VKHB 2061	33211/Q	VKS 6239	54)
	•				•	VKHB 2065	33208/Q	-	
	•		E 400	VKBA 5335	•	VKHB 2061	33211/Q	VKS 6238	55)
	•				•	VKHB 2065	33208/Q	-	
	•		E 5A - 221	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	53)
•				•	VKHB 2067	33209/Q	-		
•		E 5A - 221	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	50)	
•				•	VKHB 2067	33209/Q	-		
•		E 5A - 221	VKBA 5315	•	VKHB 2051	33213/Q	VKS 6175	43)	
•				•	VKHB 2068	33210/Q	-		

# RENAULT - R V I



M 140/160 .../...	○	P 1140 D	-	●	VKHB 2161	32019 X/Q	VKS 6201	
	○			●	-	-	-	
	○	P 1141 D	-	●	VKHB 2161	32019 X/Q	VKS 6201	
	○			●	-	-	-	
	○	P 1340 - A02	VKBA 5309	●	VKHB 2192	JF 9549/9510	VKS 6201	
	○			●	VKHB 2158	33117/Q	-	
	○	P 1341 - A02	VKBA 5218	●	VKHB 2192	JF 9549/9510	VKS 6201	
	○			●	VKHB 2194	33216/Q	-	
	○	P 769 - 02	VKBA 5332	●	VKHB 2161	32019 X/Q	VKS 6234	56)
○			●	VKHB 2169	32017 X/Q	-		
○	P 769 - 02	VKBA 5333	●	VKHB 2161	32019 X/Q	VKS 6201	57)	
○			●	VKHB 2169	32017 X/Q	-		
○	P 941 - A01	-	●	VKHB 2161	32019 X/Q	VKS 6234	56)	
○			●	-	-	-		
○	P 941 - A01	-	●	VKHB 2161	32019 X/Q	VKS 6201	57)	
○			●	-	-	-		
M 150/180	●	E 408 - 05	-	●	VKHB 2061	33211/Q	VKS 6239	
	●			●	VKHB 2065	33208/Q	-	
	○	P 821, P 1021	-	●	-	-	VKS 6234	
	○			●	-	-	-	
M 150/180 (VF6 40-ACA/ACC), M 180 (VF6 40-ACB/ACD)	●	E 400	VKBA 5335	●	VKHB 2061	33211/Q	VKS 6238	
	●			●	VKHB 2065	33208/Q	-	
	●	E 401	-	●	VKHB 2068	33210/Q	-	
	●			●	VKHB 2182	33207/Q	-	
	●	E 402	-	●	VKHB 2067	33209/Q	-	
	●			●	VKHB 2182	33207/Q	-	
	●	E 5A	VKBA 5221	●	VKHB 2051	33213/Q	VKS 6175	52)
	●			●	VKHB 2067	33209/Q	-	
	●	E5A	VKBA 5315	●	VKHB 2051	33213/Q	VKS 6175	43)
	●			●	VKHB 2068	33210/Q	-	
	○	1140	VKBA 5311	●	VKHB 2161	32019 X/Q	VKS 6201	
	○			●	VKHB 2158	33117/Q	-	
	○	1141	-	●	VKHB 2161	32019 X/Q	VKS 6201	
	○			●	-	-	-	
	○	1340	VKBA 5309	●	VKHB 2192	JF 9549/9510	VKS 6201	
	○			●	VKHB 2158	33117/Q	-	
	○	1341	VKBA 5218	●	VKHB 2192	JF 9549/9510	VKS 6201	
○			●	VKHB 2194	33216/Q	-		
○	669	VKBA 5355	●	VKHB 2044	33014	VKS 6237	61)	
○			●	VKHB 2045	33012/Q	-		
○	669	VKBA 5356	●	VKHB 2282	32015 X/Q	VKS 6306	62)	
○			●	VKHB 2199	32013 X/Q	-		
○	769 - 02	VKBA 5333	●	VKHB 2161	32019 X/Q	VKS 6201		
○			●	VKHB 2169	32017 X/Q	-		
○	769 - 05	-	●	VKHB 2046	33015/Q	VKS 6237		
○			●	VKHB 2047	33013/Q	VKS 6236		



M 150/180 (VF6 40-ACA/ACC), M 180 (VF6 40-ACB/ACD) .../...	○	769 - 06	VKBA 5356	•	VKHB 2282 VKHB 2199	32015 X/Q 32013 X/Q	VKS 6306 -	
	○	940	VKBA 5333	•	VKHB 2161 VKHB 2169	32019 X/Q 32017 X/Q	VKS 6201 -	
	○	941	-	•	VKHB 2161 -	32019 X/Q -	VKS 6201 -	
M 180/210	•	E 408 - 05	-	•	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6239 -	
	○	P 821, P 1021	-	•	- -	- -	VKS 6234 -	
M 200/230	•	E 400	-	•	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6239 -	54)
	•	E 400	VKBA 5335	•	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6238 -	55)
	•	E 5A - 221	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	53)
	•	E 5A - 221	VKBA 5221	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	50)
	•	E 5A - 221	VKBA 5315	•	VKHB 2051 VKHB 2068	33213/Q 33210/Q	VKS 6175 -	43)
	○	P 1140 D	-	•	VKHB 2161 -	32019 X/Q -	VKS 6201 -	
	○	P 1141 D	-	•	VKHB 2161 -	32019 X/Q -	VKS 6201 -	
	○	P 1340 - A02	VKBA 5309	•	VKHB 2192 VKHB 2158	JF 9549/9510 33117/Q	VKS 6201 -	
	○	P 1341 - A02	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
	○	P 769 - 02	VKBA 5332	•	VKHB 2161 VKHB 2169	32019 X/Q 32017 X/Q	VKS 6234 -	56)
	○	P 769 - 02	VKBA 5333	•	VKHB 2161 VKHB 2169	32019 X/Q 32017 X/Q	VKS 6201 -	57)
	○	P 941 - A01	-	•	VKHB 2161 -	32019 X/Q -	VKS 6234 -	56)
	○	P 941 - A01	-	•	VKHB 2161 -	32019 X/Q -	VKS 6201 -	57)

# RENAULT - R V I



M 210/230 TI (VF6- 40)

- 
- 
- 
- 
- 
- 
- 
- 

- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 

E 400  
E 401  
E 402  
E 5A  
E 5A  
1140  
1141  
1340  
1341  
669  
669  
769 - 06  
769 - 05  
769 - 02  
940  
941

VKBA 5335  
-  
-  
VKBA 5221  
VKBA 5315  
VKBA 5311  
-  
VKBA 5309  
VKBA 5218  
VKBA 5355  
VKBA 5356  
VKBA 5356  
-  
VKBA 5333  
VKBA 5333  
-

- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 

VKHB 2061  
VKHB 2065  
VKHB 2068  
VKHB 2182  
VKHB 2067  
VKHB 2182  
VKHB 2051  
VKHB 2067  
VKHB 2051  
VKHB 2068  
VKHB 2161  
VKHB 2158  
VKHB 2161  
-  
VKHB 2192  
VKHB 2158  
VKHB 2192  
VKHB 2194  
VKHB 2044  
VKHB 2045  
VKHB 2282  
VKHB 2199  
VKHB 2282  
VKHB 2199  
-  
VKHB 2046  
VKHB 2047  
VKHB 2161  
VKHB 2169  
VKHB 2161  
VKHB 2169  
VKHB 2161  
-

33211/Q  
33208/Q  
33210/Q  
33207/Q  
33209/Q  
33207/Q  
33213/Q  
33209/Q  
33213/Q  
33210/Q  
32019 X/Q  
33117/Q  
32019 X/Q  
-  
JF 9549/9510  
33117/Q  
JF 9549/9510  
33216/Q  
33014  
33012/Q  
32015 X/Q  
32013 X/Q  
32015 X/Q  
32013 X/Q  
33015/Q  
33013/Q  
32019 X/Q  
32017 X/Q  
32019 X/Q  
32017 X/Q  
32019 X/Q  
-

VKS 6238  
-  
-  
-  
-  
-  
VKS 6175  
-  
VKS 6175  
-  
VKS 6201  
-  
VKS 6201  
-  
VKS 6201  
-  
VKS 6201  
-  
VKS 6237  
-  
VKS 6306  
-  
VKS 6306  
-  
VKS 6237  
VKS 6236  
VKS 6201  
-  
VKS 6201  
-

52)  
43)

61)  
62)

M250

- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 

E5A  
E5A  
1140  
1140  
1141  
1340  
1341

VKBA 5221  
VKBA 5315  
-  
VKBA 5311  
-  
VKBA 5309  
VKBA 5218

- 
- 
- 
- 
- 
- 
- 
- 
- 
- 
- 

VKHB 2051  
VKHB 2067  
VKHB 2051  
VKHB 2068  
VKHB 2161  
-  
VKHB 2161  
VKHB 2158  
VKHB 2161  
-  
VKHB 2192  
VKHB 2158  
VKHB 2192  
VKHB 2194

33213/Q  
33209/Q  
33213/Q  
33210/Q  
32019 X/Q  
-  
32019 X/Q  
33117/Q  
32019 X/Q  
-  
JF 9549/9510  
33117/Q  
JF 9549/9510  
33216/Q

VKS 6175  
-  
VKS 6175  
-  
-  
-  
VKS 6201  
-  
VKS 6201  
-  
VKS 6201  
-  
VKS 6201  
-

84)  
85)



M250 .../...	○ ○	669-03	-	• •	VKHB 2044 VKHB 2045	33014 33012/Q	- -	86)	
		○ ○	669-03	VKBA 5356	• •	VKHB 2282 VKHB 2199	32015 X/Q 32013 X/Q	VKS 6306 -	87)
			669-05	VKBA 5356	• •	VKHB 2282 VKHB 2199	32015 X/Q 32013 X/Q	VKS 6306 -	
		○ ○	769-02	VKBA 5333	• •	VKHB 2161 VKHB 2169	32019 X/Q 32017 X/Q	VKS 6201 -	
			769-05	-	• •	VKHB 2046 VKHB 2047	33015/Q 33013/Q	VKS 6237 VKS 6236	
		○ ○	769-06	VKBA 5356	• •	VKHB 2282 VKHB 2199	32015 X/Q 32013 X/Q	VKS 6306 -	
			940	VKBA 5333	• •	VKHB 2161 VKHB 2169	32019 X/Q 32017 X/Q	VKS 6201 -	
		○ ○	941	-	• •	VKHB 2161 -	32019 X/Q -	VKS 6201 -	
ME 160 (VF6-JE 13) 4x2	• •	E 400-04/14	-	• •	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6239 -		
		• •	E 408-AA	VKBA 5342	• •	VKHB 2066 VKHB 2068	33214/Q 33210/Q	VKS 6303 -	
			E 408-05/ 13/15/24	-	• •	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6239 -	
ME 160 (VF6-JE 13) 4x4	• •		-	• •	VKHB 2169 VKHB 2169	32017 X/Q 32017 X/Q	- -		
ME 160 (VF6-JE 13) 4x2, 4x4	○ ○ ○ ○ ○ ○ ○	P 821-13/17	-	• •	- VKHB 2080	- 32217 J2/Q	VKS 6234 -		
		○ ○	P 1021-03	-	• •	- VKHB 2080	- 32217 J2/Q	VKS 6234 -	
			P 1040 F	VKBA 5311	• •	VKHB 2161 VKHB 2158	32019 X/Q 33117/Q	VKS 6201 -	
		○ ○	P 1041 F	-	• •	VKHB 2161 -	32019 X/Q -	VKS 6201 -	
			P 1140 F	VKBA 5311	• •	VKHB 2161 VKHB 2158	32019 X/Q 33117/Q	VKS 6201 -	
		○ ○	P 1141 F	-	• •	VKHB 2161 -	32019 X/Q -	VKS 6201 -	
ME 160/180 (VF6-JE 15) 4x2	• • • • ○ ○	E 400-04/14	-	• •	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6239 -		
		• •	E 408-AA	VKBA 5342	• •	VKHB 2066 VKHB 2068	33214/Q 33210/Q	VKS 6303 -	
			E 408-05/ 13/15/24	-	• •	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6239 -	
		○ ○	P 821-13/17	-	• •	- VKHB 2080	- 32217 J2/Q	VKS 6234 -	
			P 1021-03	-	• •	- VKHB 2080	- 32217 J2/Q	VKS 6234 -	

# RENAULT - R V I



ME 160/180 (VF6-JE 15) 4x2 .../...		○	P 1040 F	VKBA 5311	●	VKHB 2161 VKHB 2158	32019 X/Q 33117/Q	VKS 6201 -	
		○	P 1041 F	-	●	VKHB 2161 -	32019 X/Q -	VKS 6201 -	
		○	P 1140 F	VKBA 5311	●	VKHB 2161 VKHB 2158	32019 X/Q 33117/Q	VKS 6201 -	
		○	P 1141 F	-	●	VKHB 2161 -	32019 X/Q -	VKS 6201 -	
PA 160/180 Maroc		●	E 400	-	●	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6239 -	54)
		●	E 400	VKBA 5335	●	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6238 -	55)
		●	E 5A - 221	VKBA 5220	●	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	53)
		●	E 5A - 221	VKBA 5221	●	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6175 -	50)
		●	E 5A - 221	VKBA 5315	●	VKHB 2051 VKHB 2068	33213/Q 33210/Q	VKS 6175 -	43)
		○	P 1140 D	-	●	VKHB 2161 -	32019 X/Q -	VKS 6201 -	
		○	P 1141 D	-	●	VKHB 2161 -	32019 X/Q -	VKS 6201 -	
		○	P 1340 - A02	VKBA 5309	●	VKHB 2192 VKHB 2158	JF 9549/9510 33117/Q	VKS 6201 -	
		○	P 1341 - A02	VKBA 5218	●	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
		○	P 769 - 02	VKBA 5332	●	VKHB 2161 VKHB 2169	32019 X/Q 32017 X/Q	VKS 6234 -	56)
		○	P 769 - 02	VKBA 5333	●	VKHB 2161 VKHB 2169	32019 X/Q 32017 X/Q	VKS 6201 -	57)
		○	P 941 - A01	-	●	VKHB 2161 -	32019 X/Q -	VKS 6234 -	56)
		○	P 941 - A01	-	●	VKHB 2161 -	32019 X/Q -	VKS 6201 -	57)
PC 27 S		●	401	VKBA 5208	●	VKHB 2068 VKHB 2182	33210/Q 33207/Q	VKS 6235 -	58)
		○	769	-	●	VKHB 2046 VKHB 2047	33015/Q 33013/Q	VKS 6237 VKS 6236	58)
PP 160/180		●	E 400 - 06/16	-	●	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6239 -	
		●	E 401 - 03	VKBA 5208	●	VKHB 2068 VKHB 2182	33210/Q 33207/Q	VKS 6235 -	
		○	R 769 - 01	-	●	VKHB 2046 VKHB 2047	33015/Q 33013/Q	VKS 6237 VKS 6236	
		○	R 769 - 02	VKBA 5333	●	VKHB 2161 VKHB 2169	32019 X/Q 32017 X/Q	VKS 6201 -	



Premium 6x2, 6x2/4	• •		VKBA 5308	• •	- -	BTF-0034 -	- -	
	○ ○	P 1341	VKBA 5218	• •	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
	○ ○	P 1342	-	• •	VKHB 2192 -	JF 9549/9510 -	VKS 6201 -	
	○ ○	P 1345	-	• •	VKHB 2192 -	JF 9549/9510 -	VKS 6201 -	
	○ ○	16902/04	VKBA 5311	• •	VKHB 2161 VKHB 2158	32019 X/Q 33117/Q	VKS 6201 -	
	○ ○	16903/05	VKBA 5309	• •	VKHB 2192 VKHB 2158	JF 9549/9510 33117/Q	VKS 6201 -	
Premium PR/TR	• •		VKBA 5308	• •	- -	BTF-0034 -	- -	
	○ ○	P 1340	VKBA 5309	• •	VKHB 2192 VKHB 2158	JF 9549/9510 33117/Q	VKS 6201 -	
	○ ○	P 1341	VKBA 5218	• •	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
	○ ○	P 1342	-	• •	VKHB 2192 -	JF 9549/9510 -	VKS 6201 -	
	○ ○	P 1345	-	• •	VKHB 2192 -	JF 9549/9510 -	VKS 6201 -	
PS 130-09/150-09	• •	401	VKBA 5208	• •	VKHB 2068 VKHB 2182	33210/Q 33207/Q	VKS 6235 -	66)
	○ ○	769	-	• •	VKHB 2046 VKHB 2047	33015/Q 33013/Q	VKS 6237 VKS 6236	
	○ ○	SOMA 95 HD	-	• •	VKHB 2046 VKHB 2047	33015/Q 33013/Q	VKS 6237 VKS 6236	
PS 150 Carrier	• •	401	VKBA 5208	• •	VKHB 2068 VKHB 2182	33210/Q 33207/Q	VKS 6235 -	58)
	○ ○	769	-	• •	VKHB 2046 VKHB 2047	33015/Q 33013/Q	VKS 6237 VKS 6236	58)
PS 150/160	• •	E 400 - 06/16	-	• •	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6239 -	
	• •	E 401 - 03	VKBA 5208	• •	VKHB 2068 VKHB 2182	33210/Q 33207/Q	VKS 6235 -	
	○ ○	R 769 - 01	-	• •	VKHB 2046 VKHB 2047	33015/Q 33013/Q	VKS 6237 VKS 6236	
	○ ○	R 769 - 02	VKBA 5333	• •	VKHB 2161 VKHB 2169	32019 X/Q 32017 X/Q	VKS 6201 -	
PX 28/28 T	• •	E 6A	VKBA 5215	• •	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	
	○ ○	P 1332	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	



# RENAULT - R V I



PX 30 VVT	•	E 6A - 21	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -		
	•	○ PMA 1021, ○ PMA 1321	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -		
	•	○ PMA 1032 B, ○ PMA 1532	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -		
PX 30/30 T	•	E 6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -		
	•	○ P 1332, P 1332 B	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -		
PX 40 VVT/VTS	•	E 6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -		
	•	○ PMA/PR 1032 B, ○ PMA/P 1532	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -		
	•	○ PMA/PR/P 1021, ○ PMA/PR 1321	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -		
R 310/310 T 6x4	•	E6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	23)	
	•	E6A	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	24)	
	•	○ PMA/PR 1321	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -		
	•	○ PMA/P 1532	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -		
R 310/330/340/365	•	E 6A	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -		
	•	○ P 1332, ○ PMA/P 1532	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -		
	•	○ P 1345	-	•	VKHB 2192 -	JF 9549/9510 -	VKS 6201 -		
	•	○ PR 1341	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -		
R 340 TI	•	E 6A - 32	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	48)	
	•	E 6A - 32, E 6A - 33	VKBA 5317	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6202 -	49)	
	•	E 6A - 32/33/ 1 211/311, E 6B - 211/31	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	51)	
	•	E 84 - AG/EG/ GG, E 85 - CM	VKBA 5316	•	-	-	-	-	46)
	•	E 84 - AG/EG/ GG, E 85 - CM	VKBA 5308	•	-	BTF-0034	-	-	47)
	•	E 85 - JH	VKBA 5308	•	-	BTF-0034	-	-	



# RENAULT - R V I



R 370 .../...		○	P 1332	VKBA 5217	•	VKHB 2186	JHM 720249/JHM 720210	VKS 6201	
		○			•	VKHB 2187	64432/64708	-	
		○	P 1345	-	•	VKHB 2192	JF 9549/9510	VKS 6201	
		○			•	-	-	-	
R 370 (6x4)	•	•	E 6A	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	
					•	VKHB 2184	T2ED 045	-	
		•	E 6A	VKBA 5317	•	VKHB 2066	33214/Q	VKS 6202	
					•	VKHB 2184	T2ED 045	-	
○	PMA/P 1341	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201			
			•	VKHB 2194	33216/Q	-			
○	PMA/PR 1532	VKBA 5217	•	VKHB 2186	JHM 720249/JHM 720210	VKS 6201			
			•	VKHB 2187	64432/64708	-			
R 370 T	•	•	E 6A	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	
					•	VKHB 2184	T2ED 045	-	
		•	E 6A	VKBA 5317	•	VKHB 2066	33214/Q	VKS 6202	
					•	VKHB 2184	T2ED 045	-	
○	P 1332	VKBA 5217	•	VKHB 2186	JHM 720249/JHM 720210	VKS 6201			
			•	VKHB 2187	64432/64708	-			
○	P 1345	-	•	VKHB 2192	JF 9549/9510	VKS 6201			
			•	-	-	-			
R 380	•	•	E 6A - 32	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	48)
					•	VKHB 2184	T2ED 045	-	
		•	E 6A - 32,	VKBA 5317	•	VKHB 2066	33214/Q	VKS 6202	49)
			E 6A - 33		•	VKHB 2184	T2ED 045	-	
		•	E 6A - 32/33/1	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	51)
			211/311,		•	VKHB 2184	T2ED 045	-	
		•	E 84 - AG/EG/	VKBA 5316	•	-	-	-	46)
			GG, E 85 - CM		•	-	-	-	
		•	E 84 - AG/EG/	VKBA 5316	•	-	-	-	47)
			GG, E 85 - CM		•	-	-	-	
•	E 85 JH	VKBA 5308	•	-	BTF-0034	-			
			•	-	-	-			
○	P 1332,	VKBA 5217	•	VKHB 2186	JHM 720249/JHM 720210	VKS 6201			
	PMA/P 1532		•	VKHB 2187	64432/64708	-			
	PMA/PR 1341	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201			
			•	VKHB 2194	33216/Q	-			
○	P 1345	-	•	VKHB 2192	JF 9549/9510	VKS 6201			
			•	-	-	-			
R 385 TI	•	•	E 6A - 32	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	48)
					•	VKHB 2184	T2ED 045	-	
		•	E 6A - 32,	VKBA 5317	•	VKHB 2066	33214/Q	VKS 6202	49)
E 6A - 33			•	VKHB 2184	T2ED 045	-			
•	E 6A - 32/33/ 1	VKBA 5216	•	VKHB 2066	33214/Q	VKS 6175	51)		
	211/311,		•	VKHB 2184	T2ED 045	-			
	E 6B - 211/31								



	•	E 84 - AG/EG/ GG, E 85 - CM	VKBA 5316	•	-	-	-	46)
	•	E 84 AG/EG/ GG, E 85 CM	VKBA 5308	•	-	BTF-0034	-	47)
	•	E 85 - JH	VKBA 5308	•	-	BTF-0034	-	
	•			•				
	○	P 1332, PMA/P 1532	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
	○	PMA/PR 1341	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
	○	P 1345	-	•	VKHB 2192	JF 9549/9510	VKS 6201 -	
	○			•				
R 390	•	E 6A	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
	•	E 6A	VKBA 5317	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6202 -	
	○	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
	○	P 1345	-	•	VKHB 2192	JF 9549/9510	VKS 6201 -	
	○			•				
R 390 (6x4)	•	E 6A	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
	•	E 6A	VKBA 5317	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6202 -	
	○	PMA/PR 1341	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
	○	PMA/PR 1532	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
	○			•				
R 390 T	•	E 6A	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
	•	E 6A	VKBA 5317	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6202 -	
	○	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
	○	P 1345	-	•	VKHB 2192	JF 9549/9510	VKS 6201 -	
	○			•				
R 420	•	E 6A	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
	•	E 6A	VKBA 5317	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6202 -	
	○	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
	○	P 1345	-	•	VKHB 2192	JF 9549/9510	VKS 6201 -	
	○			•				

# RENAULT - R V I



R 420 6x4	•	E 6A	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	
	•	E 6A	VKBA 5317	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6202 -	
	○	PMA/PR 1341	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
	○	PMA/PR 1532	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
R 420 T	•	E 84 - AG	VKBA 5316	•	-	-	-	
	○	P 1332	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
	○	P 1345	-	•	VKHB 2192 -	JF 9549/9510 -	VKS 6201 -	
R 420 TI	•	E 6A - 32	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	48)
	•	E 6A - 32, E 6A - 33	VKBA 5317	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6202 -	49)
	•	E 6A - 32/33/ 211/311, E 6B - 211/31	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	51)
	•	E 84 - AG/EG/ GG, E 85 - CM	VKBA 5316	•	-	-	-	46)
	•	E 84 - AG/EG/ GG, E 85 - CM	VKBA 5308	•	-	BTF-0034 -	-	47)
	•	E 85 - JH	VKBA 5308	•	-	BTF-0034 -	-	
	○	P 1332, PMA/P 1532	VKBA 5217	•	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
	○	PMA/PR 1341	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	
	○	P 1345	-	•	VKHB 2192 -	JF 9549/9510 -	VKS 6201 -	
	R 6x4 TS	•	E 6A - 32	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -
•		E 6A - 32, E 6A - 33	VKBA 5317	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6202 -	49)
•		E 6A - 32/33/ 211/311, E 6B - 211/31	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	51)
•		E 84 - AG/EG/ GG, E 85 - CM	VKBA 5316	•	-	-	-	46)
•		E 84 - AG/EG/ GG, E 85 - CM	VKBA 5308	•	-	BTF-0034 -	-	47)
•		E 85 - JH	VKBA 5308	•	-	BTF-0034 -	-	
•								



	<ul style="list-style-type: none"> <li>○</li> <li>○</li> <li>○</li> <li>○</li> <li>○</li> </ul>	<ul style="list-style-type: none"> <li>P 1332, PMA/P 1532</li> <li>PMA/PR 1341</li> <li>P 1345</li> </ul>	<ul style="list-style-type: none"> <li>VKBA 5217</li> <li>VKBA 5218</li> <li>-</li> </ul>	<ul style="list-style-type: none"> <li>•</li> <li>•</li> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2186 VKHB 2187</li> <li>VKHB 2192 VKHB 2194</li> <li>VKHB 2192 -</li> </ul>	<ul style="list-style-type: none"> <li>JHM 720249/JHM 720210 64432/64708</li> <li>JF 9549/9510 33216/Q</li> <li>JF 9549/9510 -</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6201 -</li> <li>VKS 6201 -</li> <li>VKS 6201 -</li> </ul>	
RI 357	<ul style="list-style-type: none"> <li>•</li> <li>•</li> <li>○</li> <li>○</li> <li>○</li> <li>○</li> </ul>	<ul style="list-style-type: none"> <li>E 6A</li> <li>P 1332, PMA/P 1532</li> <li>P 1345</li> <li>PMA/PR 1341</li> </ul>	<ul style="list-style-type: none"> <li>VKBA 5216</li> <li>VKBA 5217</li> <li>-</li> <li>VKBA 5218</li> </ul>	<ul style="list-style-type: none"> <li>•</li> <li>•</li> <li>•</li> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2066 VKHB 2184</li> <li>VKHB 2186 VKHB 2187</li> <li>VKHB 2192 -</li> <li>VKHB 2192 VKHB 2194</li> </ul>	<ul style="list-style-type: none"> <li>33214/Q T2ED 045</li> <li>JHM 720249/JHM 720210 64432/64708</li> <li>JF 9549/9510 -</li> <li>JF 9549/9510 33216/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6175 -</li> <li>VKS 6201 -</li> <li>VKS 6201 -</li> <li>VKS 6201 -</li> </ul>	
S 90 - 09 (VF6 JN)	<ul style="list-style-type: none"> <li>•</li> <li>•</li> <li>•</li> <li>•</li> <li>○</li> <li>○</li> <li>○</li> <li>○</li> </ul>	<ul style="list-style-type: none"> <li>401</li> <li>401</li> <li>SOMA 95</li> <li>769 - 01</li> </ul>	<ul style="list-style-type: none"> <li>VKBA 5360</li> <li>VKBA 5208</li> <li>-</li> <li>-</li> </ul>	<ul style="list-style-type: none"> <li>•</li> <li>•</li> <li>•</li> <li>•</li> <li>•</li> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2067 VKHB 2294</li> <li>VKHB 2068 VKHB 2182</li> <li>VKHB 2046 VKHB 2047</li> <li>VKHB 2046 VKHB 2047</li> </ul>	<ul style="list-style-type: none"> <li>33209/Q 32305 J2</li> <li>33210/Q 33207/Q</li> <li>33015/Q 33013/Q</li> <li>33015/Q 33013/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6130 -</li> <li>VKS 6235 -</li> <li>VKS 6237 VKS 6236</li> <li>VKS 6237 VKS 6236</li> </ul>	<ul style="list-style-type: none"> <li>65)</li> <li>66)</li> </ul>
S 100 (VF6 JK)	<ul style="list-style-type: none"> <li>•</li> <li>•</li> <li>•</li> <li>•</li> <li>○</li> <li>○</li> <li>○</li> <li>○</li> </ul>	<ul style="list-style-type: none"> <li>401</li> <li>402</li> <li>669</li> <li>SOMA 95</li> <li>769</li> </ul>	<ul style="list-style-type: none"> <li>VKBA 5208</li> <li>-</li> <li>-</li> <li>-</li> <li>-</li> </ul>	<ul style="list-style-type: none"> <li>•</li> <li>•</li> <li>•</li> <li>•</li> <li>•</li> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2068 VKHB 2182</li> <li>VKHB 2067 VKHB 2179</li> <li>VKHB 2044 VKHB 2045</li> <li>VKHB 2046 VKHB 2047</li> <li>VKHB 2046 VKHB 2047</li> </ul>	<ul style="list-style-type: none"> <li>33210/Q 33207/Q</li> <li>33209/Q 33206/Q</li> <li>33014 33012/Q</li> <li>33015/Q 33013/Q</li> <li>33015/Q 33013/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6235 -</li> <li>VKS 6130 -</li> <li>VKS 6237 VKS 6219</li> <li>VKS 6237 VKS 6236</li> <li>VKS 6237 VKS 6236</li> </ul>	<ul style="list-style-type: none"> <li>18)</li> <li>19)</li> </ul>
S 110/130 (VF6 JK)	<ul style="list-style-type: none"> <li>•</li> <li>•</li> <li>○</li> <li>○</li> </ul>	<ul style="list-style-type: none"> <li>402</li> <li>669</li> </ul>	<ul style="list-style-type: none"> <li>-</li> <li>-</li> </ul>	<ul style="list-style-type: none"> <li>•</li> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2067 VKHB 2179</li> <li>VKHB 2044 VKHB 2045</li> </ul>	<ul style="list-style-type: none"> <li>33209/Q 33206/Q</li> <li>33014 33012/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6130 -</li> <li>VKS 6237 VKS 6219</li> </ul>	
S 120/135 (VF6)	<ul style="list-style-type: none"> <li>•</li> <li>•</li> <li>•</li> <li>•</li> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>401</li> <li>401</li> <li>402</li> <li>402</li> </ul>	<ul style="list-style-type: none"> <li>VKBA 5208</li> <li>-</li> <li>-</li> <li>-</li> </ul>	<ul style="list-style-type: none"> <li>•</li> <li>•</li> <li>•</li> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>VKHB 2068 VKHB 2182</li> <li>VKHB 2068 VKHB 2182</li> <li>VKHB 2067 VKHB 2179</li> <li>VKHB 2067 VKHB 2182</li> </ul>	<ul style="list-style-type: none"> <li>33210/Q 33207/Q</li> <li>33210/Q 33207/Q</li> <li>33209/Q 33206/Q</li> <li>33209/Q 33207/Q</li> </ul>	<ul style="list-style-type: none"> <li>VKS 6235 -</li> <li>- -</li> <li>VKS 6130 -</li> <li>- -</li> </ul>	<ul style="list-style-type: none"> <li>59)</li> <li>60)</li> <li>59)</li> <li>60)</li> </ul>

# RENAULT - R V I



S 120/135 (VF6) .../...		○	669	VKBA 5355	•	VKHB 2044	33014	VKS 6237	61)
		○			•	VKHB 2045	33012/Q	-	
		○	669	VKBA 5356	•	VKHB 2282	32015 X/Q	VKS 6306	62)
		○			•	VKHB 2199	32013 X/Q	-	
		○	769	-	•	VKHB 2046	33015/Q	VKS 6237	
		○			•	VKHB 2047	33013/Q	VKS 6236	
S 130 - 06/08/09 (VF6 JN)	•		401	VKBA 5360	•	VKHB 2067	33209/Q	VKS 6130	65)
					•	VKHB 2294	33205 J2	-	
	•		401	VKBA 5208	•	VKHB 2068	33210/Q	VKS 6235	66)
					•	VKHB 2182	33207/Q	-	
		○	SOMA 95	-	•	VKHB 2046	33015/Q	VKS 6237	
		○			•	VKHB 2047	33013/Q	VKS 6236	
		○	769 - 01	-	•	VKHB 2046	33015/Q	VKS 6237	
		○			•	VKHB 2047	33013/Q	VKS 6236	
S 130/150/170 (VF6 JP)	•		400	-	•	VKHB 2061	33211/Q	VKS 6239	
					•	VKHB 2065	33208/Q	-	
			○	P 620, P 820	-	•	VKHB 2048	33018/Q	VKS 6234
		○			•	VKHB 2046	33015/Q	-	
		○	P 821	-	•	-	-	VKS 6234	
		○			•	-	-	-	
S 135/150 (VF6 AE)	•		401	-	•	VKHB 2068	33210/Q	-	
					•	VKHB 2182	33207/Q	-	
	•		402	-	•	VKHB 2067	33209/Q	-	
					•	VKHB 2182	33207/Q	-	
		○	669	VKBA 5356	•	VKHB 2282	32015 X/Q	VKS 6306	
		○			•	VKHB 2199	32013 X/Q	-	
		○	769	-	•	VKHB 2046	33015/Q	VKS 6237	
		○			•	VKHB 2047	33013/Q	VKS 6236	
S 140/160 (VF6)	•		401	VKBA 5208	•	VKHB 2068	33210/Q	VKS 6235	63)
					•	VKHB 2182	33207/Q	-	
	•		401	-	•	VKHB 2068	33210/Q	-	64)
					•	VKHB 2182	33207/Q	-	
	•		402	-	•	VKHB 2067	33209/Q	VKS 6130	63)
					•	VKHB 2179	33206/Q	-	
	•		402	-	•	VKHB 2067	33209/Q	-	64)
				•	VKHB 2182	33207/Q	-		
		○	669	VKBA 5355	•	VKHB 2044	33014	VKS 6237	
		○			•	VKHB 2045	33012/Q	-	
		○	769	-	•	VKHB 2046	33015/Q	VKS 6237	
		○			•	VKHB 2047	33013/Q	VKS 6236	
S 150 - 06/08/09 (VF6 JN)	•		401	VKBA 5360	•	VKHB 2067	33209/Q	VKS 6130	65)
					•	VKHB 2294	33205 J2	-	
		•	401	VKBA 5208	•	VKHB 2068	33210/Q	VKS 6235	66)
		•			•	VKHB 2182	33207/Q	-	



	○	SOMA 95	-	•	VKHB 2046	33015/Q	VKS 6237	
	○			•	VKHB 2047	33013/Q	VKS 6236	
	○	769 - 01	-	•	VKHB 2046	33015/Q	VKS 6237	
	○			•	VKHB 2047	33013/Q	VKS 6236	
S 150 (VF6 JK-SC, VF6 JN-1E), S150/180 (VF6 40-ACF/ACE)	•	E 400	VKBA 5335	•	VKHB 2061	33211/Q	VKS 6238	
	•			•	VKHB 2065	33208/Q	-	
	•	E 401	-	•	VKHB 2068	33210/Q	-	
	•			•	VKHB 2182	33207/Q	-	
	•	E 402	-	•	VKHB 2067	33209/Q	-	
	•			•	VKHB 2182	33207/Q	-	
	•	E 5A	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	52)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A	VKBA 5315	•	VKHB 2051	33213/Q	VKS 6175	43)
	•			•	VKHB 2068	33210/Q	-	
	○	1140	VKBA 5311	•	VKHB 2161	32019 X/Q	VKS 6201	
	○			•	VKHB 2158	33117/Q	-	
	○	1141	-	•	VKHB 2161	32019 X/Q	VKS 6201	
	○			•	-	-	-	
	○	1340	VKBA 5309	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○			•	VKHB 2158	33117/Q	-	
	○	1341	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○			•	VKHB 2194	33216/Q	-	
	○	669	VKBA 5355	•	VKHB 2044	33014	VKS 6237	61)
	○			•	VKHB 2045	33012/Q	-	
	○	669	VKBA 5356	•	VKHB 2282	32015 X/Q	VKS 6306	62)
	○			•	VKHB 2199	32013 X/Q	-	
	○	769 - 02	VKBA 5333	•	VKHB 2161	32019 X/Q	VKS 6201	
	○			•	VKHB 2169	32017 X/Q	-	
	○	769 - 05	-	•	VKHB 2046	33015/Q	VKS 6237	
	○			•	VKHB 2047	33013/Q	VKS 6236	
	○	769 - 06	VKBA 5356	•	VKHB 2282	32015 X/Q	VKS 6306	
	○			•	VKHB 2199	32013 X/Q	-	
	○	940	VKBA 5333	•	VKHB 2161	32019 X/Q	VKS 6201	
	○			•	VKHB 2169	32017 X/Q	-	
	○	941	-	•	VKHB 2161	32019 X/Q	VKS 6201	
	○			•	-	-	-	
S 170 4x4	•	E 408 - 05	-	•	VKHB 2061	33211/Q	VKS 6239	
	•			•	VKHB 2065	33208/Q	-	
	•	SINPAR MD 3000	-	•	VKHB 2046	33015/Q	-	82)
	•			•	VKHB 2282	32015 X/Q	-	
	•	SINPAR MD 3000	-	•	VKHB 2044	33014	-	83)
	•			•	VKHB 2154	32014 X/Q	-	
	•	SINPAR MD 4000	-	•	VKHB 2170	32018 X/Q	-	41)
	•			•	VKHB 2170	32018 X/Q	-	



# RENAULT - R V I



S 170 4x4 .../...	•	3MRDIF-155/ 156/158/171/ 214/216/219	-	•	VKHB 2282	32015 X/Q	-	41)	
	•		-	•	VKHB 2169	32017 X/Q	-		
	•		3MRDIF-8274	-	•	VKHB 2169	32017 X/Q	-	41)
	•			-	•	VKHB 2169	32017 X/Q	-	
	•		3MRDIS- 8500 FW	-	•	VKHB 2169	32017 X/Q	-	41)
•	-	•		VKHB 2169	32017 X/Q	-			
	○	P 1021 K	-	•	-	-	VKS 6234	41)	
	○		-	•	VKHB 2080	32217 J2/Q	-		
	○	P 821, P 1021	-	•	-	-	VKS 6234		
	○		-	•	-	-	-	-	
S 170/220 (VF6 JS)	•	408 - 05	-	•	VKHB 2061	33211/Q	VKS 6239		
	•		-	•	VKHB 2065	33208/Q	-		
		○	P 1020	-	•	-	-	VKS 6234	22)
	○		-	•	-	-	-		
	○	P 1021	-	•	-	-	VKS 6234		
	○		-	•	-	-	-	-	
S 90/130/150 (VF6 JN)	•	401	VKBA 5208	•	VKHB 2068	33210/Q	VKS 6235	66)	
	•		-	•	VKHB 2182	33207/Q	-		
		○	769	-	•	VKHB 2046	33015/Q	VKS 6237	
		○		-	•	VKHB 2047	33013/Q	VKS 6236	
	○	SOMA 95	-	•	VKHB 2046	33015/Q	VKS 6237		
	○		-	•	VKHB 2047	33013/Q	VKS 6236		
S 210	•	E5A	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	52)	
	•		-	•	VKHB 2067	33209/Q	-		
	•	E5A	VKBA 5315	•	VKHB 2051	33213/Q	VKS 6175	43)	
	•		-	•	VKHB 2068	33210/Q	-		
		○	1140	-	•	VKHB 2161	32019 X/Q	-	84)
		○		-	•	-	-	-	
		○	1140	VKBA 5311	•	VKHB 2161	32019 X/Q	VKS 6201	85)
		○		-	•	VKHB 2158	33117/Q	-	
		○	1141	-	•	VKHB 2161	32019 X/Q	VKS 6201	
		○		-	•	-	-	-	
		○	1340	VKBA 5309	•	VKHB 2192	JF 9549/9510	VKS 6201	
		○		-	•	VKHB 2158	33117/Q	-	
		○	1341	VKBA 5218	•	VKHB 2192	JF 9549/9510	VKS 6201	
	○	-		•	VKHB 2194	33216/Q	-		
	○	669-03	-	•	VKHB 2044	33014	-	86)	
	○		-	•	VKHB 2045	33012/Q	-		
	○	669-03	VKBA 5356	•	VKHB 2282	32015 X/Q	VKS 6306	87)	
	○		-	•	VKHB 2199	32013 X/Q	-		
	○	669-05	VKBA 5356	•	VKHB 2282	32015 X/Q	VKS 6306		
	○		-	•	VKHB 2199	32013 X/Q	-		
	○	769-02	VKBA 5333	•	VKHB 2161	32019 X/Q	VKS 6201		
	○		-	•	VKHB 2169	32017 X/Q	-		



S 210 .../...	○ ○	769-05	-	● ●	VKHB 2046 VKHB 2047	33015/Q 33013/Q	VKS 6237 VKS 6236		
		○ ○	769-06	VKBA 5356	● ●	VKHB 2282 VKHB 2199	32015 X/Q 32013 X/Q	VKS 6306 -	
			○ ○	940	VKBA 5333	● ●	VKHB 2161 VKHB 2169	32019 X/Q 32017 X/Q	VKS 6201 -
		○ ○		941	-	● ●	VKHB 2161 -	32019 X/Q -	VKS 6201 -
SE 160/180 Maroc	● ●	E 400-04/14	-	● ●	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6239 -		
		● ●	E 408-AA	VKBA 5342	● ●	VKHB 2066 VKHB 2068	33214/Q 33210/Q	VKS 6303 -	
	● ●		E 408- 05/13/ 15/24	-	● ●	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6239 -	
		● ●	-	-	● ●	VKHB 2169 VKHB 2169	32017 X/Q 32017 X/Q	- -	
	○ ○		P 821-13/17	-	● ●	- VKHB 2080	- 32217 J2/Q	VKS 6234 -	
		○ ○	P 1021-03	-	● ●	- VKHB 2080	- 32217 J2/Q	VKS 6234 -	
	○ ○		P 1040 F	VKBA 5311	● ●	VKHB 2161 VKHB 2158	32019 X/Q 33117/Q	VKS 6201 -	
		○ ○	P 1041 F	-	● ●	VKHB 2161 -	32019 X/Q -	VKS 6201 -	
	○ ○		P 1140 F	VKBA 5311	● ●	VKHB 2161 VKHB 2158	32019 X/Q 33117/Q	VKS 6201 -	
		○ ○	P 1141 F	-	● ●	VKHB 2161 -	32019 X/Q -	VKS 6201 -	
SG 2	● ●	79	VKBA 5345	● ●	VKHB 2020 VKHB 2294	32208 J2/Q 32305 J2	VKS 6305 -		
		○ ○	362 - 16BR - 17MR - 26BR	-	● ●	VKHB 2017 VKHB 2296	32210 J2/Q 30209 J2/Q	- -	
SG 3	● ●	603	VKBA 5345	● ●	VKHB 2020 VKHB 2294	32208 J2/Q 32305 J2	VKS 6305 -	90)	
		○ ○	212-01	-	● ●	- VKHB 2296	- 30209 J2/Q	- -	90)
SG 4	● ●		-	● ●	VKHB 2067 VKHB 2294	33209/Q 32305 J2	- -		
TB 191	● ●	E4A	-	● ●	VKHB 2173 VKHB 2056	33212/Q 33109/Q	VKS 6202 -		
		○ ○	P 921 - B1/G	-	● ●	- -	- -	VKS 6234 -	
TB 231	● ●	E4A	-	● ●	VKHB 2173 VKHB 2056	33212/Q 33109/Q	VKS 6202 -		
		○ ○	P 921 - B1/G	-	● ●	- -	- -	VKS 6234 -	

# RENAULT - R V I



TBH 260 (6x4)	• •	E 6A	VKBA 5215	• •	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	73)	
		○ ○	PMA/PR 1032	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708		VKS 6201 -
TBH 280 E (6x6)	• •	PA 721	-	• •	- VKHB 2080	- 32217 J2/Q	VKS 6234 -		
		○ ○	PMA/P 1532	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708		VKS 6201 -
TBH 280 (6x4 D)	• • • •	E 6A	VKBA 5215	• •	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	73)	
		E 6A - 511	VKBA 5216	• •	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -		24)
		○ ○	PMA/PR 1032	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708		
TBH 280 (6x4)	• • • •	E 6A	VKBA 5215	• •	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	73)	
		E 6A	VKBA 5216	• •	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -		24)
		○ ○	PMA/P 1532	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708		
TBH 280 (6x6)	• •	PKBS 3	VKBA 5223	• •	VKHB 2170 VKHB 2169	32018 X/Q 32017 X/Q	VKS 6232 VKS 6232		
		○ ○	PMA/PR 1032	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708		VKS 6201 -
TR 280/350	• •	E 6A	VKBA 5215	• •	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -		
		○ ○	P 1332	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708		VKS 6201 -
TLM 280	• • • •	E 6A - 51	VKBA 5215	• •	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	23)	
		E 6A - 51	VKBA 5216	• •	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -		24)
		○ ○	P 1532	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708		
TR 305	• •	E 6A	VKBA 5215	• •	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -		
		○ ○	P 1332, P1332 B	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708		VKS 6201 -
TRH 305 (6x4)	• •	E 6A - 21	VKBA 5215	• •	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -		
		○ ○	PMA 1021, PMA 1321	VKBA 5214	• •	VKHB 2185 VKHB 2042	52375/52618 683/672		VKS 6201 -
		○ ○	PMA 1032 B, PMA 1532	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708		VKS 6201 -



TRH 350 6x4 TRH 350 TS	• •	E 6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	
	○ ○	PMA/PR 1032 B, PMA/P 1532	VKBA 5217	• •	VKHB 2186 VKHB 2187	JHM 720249/JHM 720210 64432/64708	VKS 6201 -	
	○ ○	PMA/PR/P 1021, PMA/PR 1321	VKBA 5214	• •	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -	
TRM 2000	• •	SOMA 3 MRDIPF- 8250	-	• •	VKHB 2243 VKHB 2154	JM 511946/Q/JM 511910/Q 32014 X/Q	- -	88)
	• •	SOMA 3 MRDISP- 8500	-	• •	VKHB 2243 VKHB 2154	JM 511946/Q/JM 511910/Q 32014 X/Q	- -	89)
	○ ○	SOMA 3 MRPF- 8250	-	• •	VKHB 2243 VKHB 2154	JM 511946/Q/JM 511910/Q 32014 X/Q	- -	88)
	○ ○	SOMA 3 MRSP- 8500	-	• •	VKHB 2243 VKHB 2154	JM 511946/Q/JM 511910/Q 32014 X/Q	- -	89)
TRM 4000	• •	HWT 1093	-	• •	VKHB 2041 VKHB 2208	580/572/Q 567/563	- -	
	• •	SOMA 12	-	• •	- VKHB 2282	- 32015 X/Q	- -	
110.130 6x6	• •	MDRFP 4000	-	• •	VKHB 2044 VKHB 2154	33014 32014 X/Q	- -	
	○ ○	MRFP 4000	-	• •	VKHB 2044 VKHB 2154	33014 32014 X/Q	- -	
110.150 4x4	• •	SINPAR MD 3000	-	• •	VKHB 2046 VKHB 2282	33015/Q 32015 X/Q	- -	82)
	• •	SINPAR MD 3000	-	• •	VKHB 2044 VKHB 2154	33014 32014 X/Q	- -	83)
	• •	SINPAR MD 4000	-	• •	VKHB 2170 VKHB 2170	32018 X/Q 32018 X/Q	- -	41)
	• •	3MRDIF-155/ 156/ 158/171/ 214/ 216/219	-	• •	VKHB 2282 VKHB 2169	32015 X/Q 32017 X/Q	- -	41)
	• •	3MRDIF-8274	-	• •	VKHB 2169 VKHB 2169	32017 X/Q 32017 X/Q	- -	41)
	• •	3MRDIS-8500 FW	-	• •	VKHB 2169 VKHB 2169	32017 X/Q 32017 X/Q	- -	41)
	○ ○	P 620 D1	-	• •	VKHB 2044 VKHB 2140	33014 33016/Q	- -	41)
	○ ○	P 620 F	-	• •	VKHB 2048 VKHB 2046	33018/Q 33015/Q	VKS 6234 -	41)
	○ ○	P 1021 K	-	• •	- VKHB 2080	- 32217 J2/Q	VKS 6234 -	41)

# RENAULT - R V I



110/150, 110/170 4x4	•	E 408-05	-	•	VKHB 2061	33211/Q	VKS 6239	
	•			•	VKHB 2065	33208/Q	-	
	○	P 821, P 1021	-	•	-	-	VKS 6234	
	○			•	-	-	-	
110.170 4x4	•	SINPAR MD 3000	-	•	VKHB 2046	33015/Q	-	82)
	•			•	VKHB 2282	32015 X/Q	-	
	•	SINPAR MD 3000	-	•	VKHB 2044	33014	-	83)
	•			•	VKHB 2154	32014 X/Q	-	
	•	SINPAR MD 4000	-	•	VKHB 2170	32018 X/Q	-	41)
	•			•	VKHB 2170	32018 X/Q	-	
	•	3MRDIF-155/ 156/ 158/171/ 214/216/ 219	-	•	VKHB 2282	32015 X/Q	-	41)
	•			•	VKHB 2169	32017 X/Q	-	
	•	3MRDIF-8274	-	•	VKHB 2169	32017 X/Q	-	41)
	•			•	VKHB 2169	32017 X/Q	-	
	•	3MRDIS-8500 FW	-	•	VKHB 2169	32017 X/Q	-	41)
	•			•	VKHB 2169	32017 X/Q	-	
	○	P 620 D1	-	•	VKHB 2044	33014	-	41)
	○			•	VKHB 2140	33016/Q	-	
	○	P 620 F	-	•	VKHB 2048	33018/Q	VKS 6234	41)
	○			•	VKHB 2046	33015/Q	-	
	○	P 1021 K	-	•	-	-	VKS 6234	41)
	○			•	VKHB 2080	32217 J2/Q	-	
130 B6/B6A	•	401	-	•	VKHB 2017	32210 J2/Q	VKS 6235	
	•			•	VKHB 2018	32207 J2/Q	-	
	○	SOMA 95	-	•	VKHB 2046	33015/Q	VKS 6237	
	○			•	VKHB 2047	33013/Q	VKS 6236	
130 B9/B9A	•	401	-	•	VKHB 2017	32210 J2/Q	VKS 6235	
	•			•	VKHB 2018	32207 J2/Q	-	
	○	SOMA 95	-	•	VKHB 2046	33015/Q	VKS 6237	
	○			•	VKHB 2047	33013/Q	VKS 6236	
130 B11/ B13/ B14	•		-	•	VKHB 2019	32211 J2/Q	VKS 6239	
	•			•	VKHB 2020	32208 J2/Q	-	
	○	15 M, 15 MHD, 17 M	-	•	VKHB 2048	33018/Q	VKS 6233	
	○			•	VKHB 2046	33015/Q	VKS 6231	
	○	467-26	-	•	VKHB 2048	33018/Q	VKS 6233	
	○			•	VKHB 2046	33015/Q	VKS 6231	
	○	P 620 F/F1	-	•	VKHB 2048	33018/Q	VKS 6233	14)
	○			•	VKHB 2046	33015/Q	VKS 6231	
	○	P 821 F/F1	-	•	-	-	VKS 6233	14)
	○			•	-	-	-	
150 B11/ B13	•		-	•	VKHB 2019	32211 J2/Q	VKS 6239	
	•			•	VKHB 2020	32208 J2/Q	-	
	○	15 M, 15 MHD, 17 M	-	•	VKHB 2048	33018/Q	VKS 6233	
	○			•	VKHB 2046	33015/Q	VKS 6231	



	○	467-26	-	•	VKHB 2048	33018/Q	VKS 6233	
	○			•	VKHB 2046	33015/Q	VKS 6231	
	○	P 620 F/F1	-	•	VKHB 2048	33018/Q	VKS 6233	14)
	○			•	VKHB 2046	33015/Q	VKS 6231	
	○	P 821 F/F1	-	•	-	-	VKS 6233	14)
	○			•	-	-	-	
75.130 4x4	•	SINPAR MD 3000	-	•	VKHB 2046	33015/Q	-	82)
	•			•	VKHB 2282	32015 X/Q	-	
	•	SINPAR MD 3000	-	•	VKHB 2044	33014	-	83)
	•			•	VKHB 2154	32014 X/Q	-	
	•	SINPAR MD 4000	-	•	VKHB 2170	32018 X/Q	-	41)
	•			•	VKHB 2170	32018 X/Q	-	
	•	3MRDIF-155/ 156/ 158/171/ 214/ 216/219	-	•	VKHB 2282	32015 X/Q	-	41)
	•			•	VKHB 2169	32017 X/Q	-	
	•	3MRDIF-8274	-	•	VKHB 2169	32017 X/Q	-	41)
	•			•	VKHB 2169	32017 X/Q	-	
	•	3MRDIS-8500 FW	-	•	VKHB 2169	32017 X/Q	-	41)
	•			•	VKHB 2169	32017 X/Q	-	
	○	P 620 D1	-	•	VKHB 2044	33014	-	41)
	○			•	VKHB 2140	33016/Q	-	
	○	P 620 F	-	•	VKHB 2048	33018/Q	VKS 6234	41)
	○			•	VKHB 2046	33015/Q	-	
	○	P 1021 K	-	•	-	-	VKS 6234	41)
	○			•	VKHB 2080	32217 J2/Q	-	
85.150 4x4	•	SINPAR MD 3000	-	•	VKHB 2046	33015/Q	-	82)
	•			•	VKHB 2282	32015 X/Q	-	
	•	SINPAR MD 3000	-	•	VKHB 2044	33014	-	83)
	•			•	VKHB 2154	32014 X/Q	-	
	•	SINPAR MD 4000	-	•	VKHB 2170	32018 X/Q	-	
	•			•	VKHB 2170	32018 X/Q	-	
	•	3MRDIF-155/ 156/ 158/171/ 214/216/ 219	-	•	VKHB 2282	32015 X/Q	-	41)
	•			•	VKHB 2169	32017 X/Q	-	
	•	3MRDIF-8274	-	•	VKHB 2169	32017 X/Q	-	41)
	•			•	VKHB 2169	32017 X/Q	-	
	•	3MRDIS-8500 FW	-	•	VKHB 2169	32017 X/Q	-	41)
	•			•	VKHB 2169	32017 X/Q	-	
	○	P 620 D1	-	•	VKHB 2044	33014	-	41)
	○			•	VKHB 2140	33016/Q	-	
	○	P 620 F	-	•	VKHB 2048	33018/Q	VKS 6234	41)
	○			•	VKHB 2046	33015/Q	-	
	○	P 1021 K	-	•	-	-	VKS 6234	41)
	○			•	VKHB 2080	32217 J2/Q	-	

# RENAULT - R V I



85/150 4x4	• •	E 408-05	-	•	VKHB 2061 VKHB 2065	33211/Q 33208/Q	VKS 6239 -		
		○ ○	P 821, P 1021	-	• •	- -	- -	VKS 6234 -	
90 B6/B6A/B6Z/B7	• • • •		-	•	VKHB 2067 VKHB 2016	33209/Q 32206 J2/Q	VKS 6130 -	12)	
			-	•	VKHB 2067 VKHB 2179	33209/Q 33206/Q	VKS 6130 -	13)	
		○ ○	669-01	-	• •	VKHB 2044 VKHB 2045	33014 33012/Q	VKS 6237 VKS 6219	
		○ ○	70 HD	-	• •	VKHB 2044 VKHB 2045	33014 33012/Q	VKS 6237 VKS 6230	
90 B8	• •	401	-	•	VKHB 2017 VKHB 2018	32210 J2/Q 32207 J2/Q	VKS 6235 -		
		○ ○	SOMA 95	-	• •	VKHB 2046 VKHB 2047	33015/Q 33013/Q	VKS 6237 VKS 6236	
95.130 4x4	• • • • • • • •	SINPAR MD 3000	-	•	VKHB 2046 VKHB 2282	33015/Q 32015 X/Q	- -	82)	
		SINPAR MD 3000	-	•	VKHB 2044 VKHB 2154	33014 32014 X/Q	- -	83)	
		SINPAR MD 4000	-	•	VKHB 2170 VKHB 2170	32018 X/Q 32018 X/Q	- -	41)	
		3MRDIF-155/ 156/158/171/ 214/216/219	-	•	VKHB 2282 VKHB 2169	32015 X/Q 32017 X/Q	- -	41)	
		3MRDIF-8274	-	•	VKHB 2169 VKHB 2169	32017 X/Q 32017 X/Q	- -	41)	
		3MRDIS-8500 FW	-	•	VKHB 2169 VKHB 2169	32017 X/Q 32017 X/Q	- -	41)	
		○ ○	P 620 D1	-	• •	VKHB 2044 VKHB 2140	33014 33016/Q	- -	41)
		○ ○	P 620 F	-	• •	VKHB 2048 VKHB 2046	33018/Q 33015/Q	VKS 6234 -	41)
○ ○	P 1021 K	-	• •	- VKHB 2080	- 32217 J2/Q	VKS 6234 -	41)		
770 KB6	• • • •	E3A-10	-	•	VKHB 2173 VKHB 2056	33212/Q 33109/Q	- -		
		E3A-11	-	•	VKHB 2173 VKHB 2056	33212/Q 33109/Q	- -		
		○ ○	P 620 D1	-	• •	VKHB 2044 VKHB 2140	33014 33016/Q	- -	
		○ ○	P 621 B1	-	• •	VKHB 2140 VKHB 2180	33016/Q 593 X/594/Q	- -	












## SCANIA

L 80, LB 80 .....	188
L 81, LB 81 .....	188
G 82, P 82, T 82 .....	188–189
L 85, LS 85 LB 85, LBS 85 .....	180
L 86, LS 86, LB 86, LBS 86 .....	180–190
G 92, P 92, R 92 .....	190–191
G 93, P 93, R 93, P 93 M, H, T93 .....	191
94D, 94L, 94C, 94G .....	192
L, LS, LT, LB, LBS, LBT 110 .....	192–193
L, LS, LT, LB, LBS, LBT 111 .....	193–194
G, P, R, T 112 M, .....	194–196
P, R, T, K 113, .....	196
114L, 114C, 114G .....	197
124L, 124C, 124G .....	197–198
L, LS, LB, LBS, LBT 140, LT 145 .....	198–199
L, LS, LB, LBS, LBT 141, LT 146 .....	199–200
R 142, T 142 .....	200–201
R 143, T 143 .....	201–202
144L, 144C, 144G .....	203





L 80, LB 80	•		-	•	-	32308 J2/Q	VKS 6103	
	•	○	R601, R640	•	VKHB 2001	32308 J2/Q	-	
	○		-	•	VKHB 2026	32216 J2/Q	VKS 6104	
	○		-	•	VKHB 2033	32215 J2/Q	-	
L 81, LB 81	•		-	•	-	-	VKS 6103	1)
	•		-	•	VKHB 2001	32308 J2/Q	-	
	•		-	•	VKHB 2002	32311 J2	VKS 6107	2)
	•		-	•	VKHB 2001	32308 J2/Q	-	
LB 81	•		VKBA 5064	•	VKHB 2003	32312 J2/Q	VKS 6108	
	•		-	•	VKHB 2004	32309 J2/Q	-	
L 81, LB 81	○		-	•	VKHB 2026	32216 J2/Q	VKS 6104	3)
	○		-	•	VKHB 2033	32215 J2/Q	-	
	○		-	•	VKHB 2026	32216 J2/Q	VKS 6109	4)
	○		-	•	VKHB 2028	33215/Q	VKS 6110	
	○		-	•	VKHB 2026	32216 J2/Q	VKS 6104	5)
G 82, P 82, P 82 M, P 82 H	○		-	•	VKHB 2033	32215 J2/Q	-	
	•		-	•	VKHB 2002	32311 J2	VKS 6107	6)
	•		-	•	VKHB 2001	32308 J2/Q	-	
	•		VKBA 5077	•	VKHB 2002	32311 J2	VKS 6108	7)
	•		-	•	VKHB 2001	32308 J2/Q	-	
	•		-	•	VKHB 2002	32311 J2	VKS 6107	8)
	•		-	•	VKHB 2001	32308 J2/Q	-	
	•		VKBA 5077	•	VKHB 2002	32311 J2	VKS 6108	9)
	•		-	•	VKHB 2001	32308 J2/Q	-	
	•		VKBA 5064	•	VKHB 2003	32312 J2/Q	VKS 6108	
	•		-	•	VKHB 2004	32309 J2/Q	-	
	○		VKBA 5075	•	VKHB 2026	32216 J2/Q	VKS 6109	10)
	○		-	•	VKHB 2028	33215/Q	VKS 6110	
	○		-	•	VKHB 2026	32216 J2/Q	VKS 6109	5)
	○		-	•	VKHB 2033	32215 J2/Q	VKS 6110	
○		VKBA 5067	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	10),98)	
○		-	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105		
○		VKBA 5067	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	11),98)	
○		-	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105		
○		VKBA 5068	•	VKHB 2030	32218 J2/Q	VKS 6106	12)	
○		-	•	VKHB 2030	32218 J2/Q	VKS 6105		
○		VKBA 5067	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	13),98)	
○		-	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105		
○		VKBA 5068	•	VKHB 2030	32218 J2/Q	VKS 6106	14)	
○		-	•	VKHB 2030	32218 J2/Q	VKS 6105		
G 82 H, P 82 H (6x2)	○		VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	10),98)
	○		-	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
	○		-	•	VKHB 2030	32218 J2/Q	VKS 6106	5)
	○		-	•	VKHB 2030	32218 J2/Q	-	

								
G 82 M, P 82 M (6x2)	○ ○	Trailing axle	VKBA 5064	• •	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	
G 82, P 82	○ ○	Trailing axle, ASA60	VKBA 5064	• •	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	
	○ ○	Trailing axle, ASA70	VKBA 5087	• •	VKHB 2024 VKHB 2006	T2ED 070/QCLNVB061 T2ED 055/QCLN	VKS 6126 -	
T 82 M (4x2)	• •	AM55	-	• •	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6107 -	15)
	• •	AM55	VKBA 5077	• •	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6108 -	16)
T 82 M (4x2), T 82 H (6x2)	• •	AM60	VKBA 5064	• •	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	
T 82 M (4x2)	○ ○	AD80	VKBA 5075	• •	VKHB 2026 VKHB 2028	32216 J2/Q 33215/Q	VKS 6109 VKS 6110	10)
	○ ○	AD80	-	• •	VKHB 2026 VKHB 2033	32216 J2/Q 32215 J2/Q	VKS 6109 VKS 6110	5)
T 82 M (4x2), T82 H (4x2, 6x2)	○ ○	AD90	VKBA 5067	• •	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	10)
	○ ○	AD90	VKBA 5068	• •	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	12)
T 82 M (4x2), T 82 H (4x2, 6x2)	○ ○	AD90	VKBA 5067	• •	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	13),98)
T 82 H (6x2)	○ ○	Trailing axle, AS90	VKBA 5067	• •	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	5),98)
	○ ○	Trailing axle, AS90	VKBA 5069	• •	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 -	10),98)
L 85, LS 85	• •		-	• •	- VKHB 2001	- 32308 J2/Q	VKS 6103 -	
LB 85, LBS 85	• •		VKBA 5064	• •	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	
L 85, LS 85, LB 85, LBS 85	○ ○	R650, RD650, R651, R751	VKBA 5068	• •	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	
LS 85, LBS 85	○ ○	Trailing axle	-	• •	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 -	
L 86, LS 86	• •	AM55	-	• •	- VKHB 2001	- 32308 J2/Q	VKS 6103 -	1)
	• •	AM55	-	• •	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6107 -	2)
L 86, LS 86, LB 86, LBS 86	• •	AM60	VKBA 5064	• •	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	
	○ ○	R651, R653, R751, R752	VKBA 5067	• •	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	18),98)
	○ ○	R651, R653, R751, R752	VKBA 5068	• •	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	17)



L 86, LS 86, LB 86, LBS 86 .../...	○	R651, R653, R751, R752	VKBA 5068	●	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	5)
LS 86, LBS 86	○	Trailing axle	-	●	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 -	17)
	○	Trailing axle	-	●	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6106 VKS 6105	18)
	○	Trailing axle	-	●	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 -	5)
G 92, P 92, P 92 M, P 92 H	●	AM55	-	●	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6107 -	6)
	●	AM55	VKBA 5077	●	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6108 -	7)
	●	AM55	-	●	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6107 -	8)
	●	AM55	VKBA 5077	●	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6108 -	9)
	●	AM60	VKBA 5064	●	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	
	○	AD80	VKBA 5075	●	VKHB 2026 VKHB 2028	32216 J2/Q 33215/Q	VKS 6109 VKS 6110	10)
	○	AD80	-	●	VKHB 2026 VKHB 2033	32216 J2/Q 32215 J2/Q	VKS 6109 VKS 6110	5)
	○	AD90	VKBA 5067	●	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	11),98)
	○	AD90	VKBA 5068	●	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	14)
	○	AD90	VKBA 5067	●	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	20),98)
	○	AD90, ADA90	VKBA 5068	●	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	19)
	○	AD90, ADA90	VKBA 5067	●	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	10),98)
G 92 H, P 92 H, R 92 H (6x2)	○	Trailing axle ASA90	-	●	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 -	5)
G 92 M, P 92 M (6x2)	○	Trailing axle	VKBA 5064	●	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	5)
G 92, P 92, P 92 M, P 92 H	○	Trailing axle, ASA60	VKBA 5064	●	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	10)
	○	Trailing axle, ASA70	VKBA 5087	●	VKHB 2024 VKHB 2006	T2ED 070/QCLNVB061 T2ED 055/QCLN	VKS 6126 -	10)
G 92, P 92 (6x2, 6x4)	○	Trailing axle, ASA60	VKBA 5064	●	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	
	○	Trailing axle, ASA70	VKBA 5087	●	VKHB 2024 VKHB 2006	T2ED 070/QCLNVB061 T2ED 055/QCLN	VKS 6126 -	
	○	Trailing axle, ARA55	VKBA 5077	●	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6108 -	



P 92 H (6x2)	○	Trailing axle, AS90	VKBA 5069	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 -	10),98)
G 93, P 93, R 93, P 93 M, P 93 H, T 93	•	AM56	VKBA 5225	•	VKHB 2228 VKHB 2004	T2EE 060/Q 32309 J2/Q	VKS 6284 -	10)
	•	AM56	VKBA 5226	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6261 -	5)
	•	AM61	VKBA 5226	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6261 -	21)
	•	AM70	VKBA 5087	•	VKHB 2024 VKHB 2006	T2ED 070/QCLNVB061 T2ED 055/QCLN	VKS 6126 -	14)
	•	AM70	VKBA 5087	•	VKHB 2024 VKHB 2006	T2ED 070/QCLNVB061 T2ED 055/QCLN	VKS 6126 -	35)
	•	AM70	VKBA 5269	•	VKHB 2024 VKHB 2006	T2ED 070/QCLNVB061 T2ED 055/QCLN	VKS 6261 -	36)
	•	AM800, AM820	-	•	-	-	-	-
	○	AD100	VKBA 5083	•	VKHB 2032 VKHB 2032	HM 220149 A/W/110/QV002 HM 220149 A/W/110/QV002	VKS 6124 VKS 6262	22)
	○	AD100	VKBA 5083	•	VKHB 2032 VKHB 2032	HM 220149 A/W/110/QV002 HM 220149 A/W/110/QV002	VKS 6124 VKS 6262	27)
	○	AD80	VKBA 5075	•	VKHB 2026 VKHB 2028	32216 J2/Q 33215/Q	VKS 6109 VKS 6110	10)
	○	AD80	-	•	VKHB 2026 VKHB 2033	32216 J2/Q 32215 J2/Q	VKS 6109 VKS 6110	5)
	○	AD90, ADA90	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 VKS 6105	22),98)
	○	AD90, ADA90	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 VKS 6105	23),98)
	○	AD90, ADA90	-	•	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6111 VKS 6105	24),98)
	○	AD90, ADA90	VKBA 5068	•	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	25)
	○	ARA56	VKBA 5225	•	VKHB 2228 VKHB 2004	T2EE 060/Q 32309 J2/Q	VKS 6284 -	26)
	○	Trailing axle	-	•	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 -	5)
	○	Trailing axle, AS90	VKBA 5069	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 -	
	○	Trailing axle, AS60	VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	
	○	Trailing axle, ASA70	VKBA 5087	•	VKHB 2024 VKHB 2006	T2ED 070/QCLNVB061 T2ED 055/QCLN	VKS 6126 -	
	○	Trailing axle, ASA80	VKBA 5075	•	VKHB 2026 VKHB 2028	32216 J2/Q 33215/Q	VKS 6109 VKS 6110	10)



94D, 94L, 94C, 94G

•	AM620	VKBA 5314	•	-	BTH-0018 B	-	85)
•			•	-	-	-	
•	AM620, AM920	VKBA 5314	•	-	BTH-0018 B	-	86)
•			•	-	-	-	
•	AM620, AM920, AMA860	VKBA 5314	•	-	BTH-0018 B	-	87)
•			•	-	-	-	
•	AM820D	VKBA 5314	•	-	BTH-0018 B	-	99)
•			•	-	-	-	
•	AM900	VKBA 5314	•	-	BTH-0018 B	-	47)
•			•	-	-	-	
•	AM920	VKBA 5314	•	-	BTH-0018 B	-	89)
•			•	-	-	-	
•	AM740, AMA740, AMA860	VKBA 5314	•	-	BTH-0018 B	-	88)
•			•	-	-	-	
○	AD1100	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	10),98)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	
○	AD1100P	-	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	103)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○	ADA1100	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98),
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	102)
○	AD1300, ADA1300	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98),
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	102)
○	AD1500P,	VKBA 5367	•	VKHB 2147	T2EE 100	VKS 6262	101)
○			+			VKS 6273	
○	ADA1500P	-	•	VKHB 2147	T2EE 100	VKS 6262	
○	AS900	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	21),98)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○	ASA1000	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	10),98)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○	ASA1000D	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98),99)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○	AS1300	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	

L 110, LS 110

•		-	•	-	-	VKS 6103	
•			•	VKHB 2001	32308 J2/Q	-	
○	R650, RD650, R651, R751	VKBA 5068	•	VKHB 2030	32218 J2/Q	VKS 6106	
○			•	VKHB 2030	32218 J2/Q	VKS 6105	
○	RP750	-	•	VKHB 2031	32219 J2	VKS 6125	
○			•	VKHB 2031	32219 J2	-	
○	Trailing axle	-	•	VKHB 2030	32218 J2/Q	VKS 6106	
○			•	VKHB 2030	32218 J2/Q	-	

LS 110

LT 110

•		-	•	-	-	VKS 6103	
•			•	VKHB 2001	32308 J2/Q	-	
○		-	•	VKHB 2030	32218 J2/Q	-	
○			•	VKHB 2030	32218 J2/Q	VKS 6105	



LB 110, LBS 110	•		VKBA 5064	•	VKHB 2003	32312 J2/Q	VKS 6108	
	•			•	VKHB 2004	32309 J2/Q	-	
	○	R650, RD650, R651, R751	VKBA 5068	•	VKHB 2030	32218 J2/Q	VKS 6106	
	○			•	VKHB 2030	32218 J2/Q	VKS 6105	
	○	RP750	-	•	VKHB 2031	32219 J2	VKS 6125	
	○			•	VKHB 2031	32219 J2	-	
LBS 110	○	Trailing axle	-	•	VKHB 2030	32218 J2/Q	VKS 6106	
	○			•	VKHB 2030	32218 J2/Q	-	
LBT 110	•		VKBA 5064	•	VKHB 2003	32312 J2/Q	VKS 6108	
	•			•	VKHB 2004	32309 J2/Q	-	
	○		-	•	VKHB 2030	32218 J2/Q	-	
	○			•	VKHB 2030	32218 J2/Q	VKS 6105	
L 111, LS 111, LT 111	•	AM55	-	•	-	-	VKS 6103	1)
	•			•	VKHB 2001	32308 J2/Q	-	
	•	AM55	-	•	VKHB 2002	32311 J2	VKS 6107	2)
	•			•	VKHB 2001	32308 J2/Q	-	
	•	AM60	VKBA 5064	•	VKHB 2003	32312 J2/Q	VKS 6108	
	•			•	VKHB 2004	32309 J2/Q	-	
	○	AD90	VKBA 5068	•	VKHB 2030	32218 J2/Q	VKS 6106	17)
	○			•	VKHB 2030	32218 J2/Q	VKS 6105	
	○	AD90	VKBA 5067	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	18),98)
	○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105	
	○	AD90	VKBA 5068	•	VKHB 2030	32218 J2/Q	VKS 6106	5)
	○			•	VKHB 2030	32218 J2/Q	VKS 6105	
L 111, LT 111	○	AD90	VKBA 5067	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	11),98)
	○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105	
L 111, LS 111, LT 111	○	AD95	-	•	VKHB 2031	32219 J2	VKS 6125	29)
	○			•	VKHB 2031	32219 J2	-	
LT 111	○	AD95	-	•	VKHB 2031	32219 J2	VKS 6123	28)
	○			+	VKHB 2031	32219 J2	VKS 6125	
	○			•	VKHB 2031	32219 J2	VKS 6105	
L 111, LS 111, LT 111	○	AD100	VKBA 5083	•	VKHB 2032	HM 220149 A/W/110/QV002	VKS 6124	
	○			•	VKHB 2032	HM 220149 A/W/110/QV002	VKS 6262	
LS 111	○	Trailing axle	-	•	VKHB 2030	32218 J2/Q	VKS 6106	17)
	○			•	VKHB 2030	32218 J2/Q	-	
	○	Trailing axle	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	18),98)
	○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
	○	Trailing axle	-	•	VKHB 2030	32218 J2/Q	VKS 6106	5)
	○			•	VKHB 2030	32218 J2/Q	-	
LB 111, LBS 111, LBT 111	•	AM60	VKBA 5064	•	VKHB 2003	32312 J2/Q	VKS 6108	
	•			•	VKHB 2004	32309 J2/Q	-	



LBT 111 FB	○	AD80	-	•	VKHB 2026	32216 J2/Q	VKS 6104	30)
				•	VKHB 2033	32215 J2/Q	-	
		AD80	-	•	VKHB 2026	32216 J2/Q	VKS 6109	31)
	○			•	VKHB 2028	33215/Q	VKS 6110	
LB 111, LBS 111, LBT 111 BB/FB	○	AD80	-	•	VKHB 2026	32216 J2/Q	VKS 6104	5)
				•	VKHB 2033	32215 J2/Q	-	
		AD90	VKBA 5068	•	VKHB 2030	32218 J2/Q	VKS 6106	30)
	○			•	VKHB 2030	32218 J2/Q	VKS 6105	
LB 111, LBS 111, LBT 111 BB	○	AD90	VKBA 5067	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	31),98)
				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105	
		AD90	VKBA 5068	•	VKHB 2030	32218 J2/Q	VKS 6106	5)
	○			•	VKHB 2030	32218 J2/Q	VKS 6105	
LB 111, LBT 111 BB	○	AD90	VKBA 5067	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	11),98)
				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105	
		AD95	-	•	VKHB 2031	32219 J2	VKS 6123	28)
	○			+				
	○			•	VKHB 2031	32219 J2	VKS 6125	
	○			•	VKHB 2031	32219 J2	VKS 6105	
LB 111, LBS 111, LBT 111 BB	○	AD95	-	•	VKHB 2031	32219 J2	VKS 6125	29)
				•	VKHB 2031	32219 J2	-	
	○	AD100	VKBA 5083	•	VKHB 2032	HM 220149 A/W/110/QV002	VKS 6124	
				•	VKHB 2032	HM 220149 A/W/110/QV002	VKS 6262	
	○	Trailing axle	-	•	VKHB 2030	32218 J2/Q	VKS 6106	30)
				•	VKHB 2030	32218 J2/Q	-	
	○	Trailing axle	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	31),98)
			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-		
○	Trailing axle	-	•	VKHB 2030	32218 J2/Q	VKS 6106	5)	
			•	VKHB 2030	32218 J2/Q	-		
G 112 M, P 112 M, R 112 M, P 112 H, P 112 E, R 112 H, R 112 E	•	AM55	-	•	VKHB 2002	32311 J2	VKS 6107	6)
				•	VKHB 2001	32308 J2/Q	-	
	•	AM55	VKBA 5077	•	VKHB 2002	32311 J2	VKS 6108	7)
				•	VKHB 2001	32308 J2/Q	-	
•	AM55	-	•	VKHB 2002	32311 J2	VKS 6107	8)	
			•	VKHB 2001	32308 J2/Q	-		
•	AM55	VKBA 5077	•	VKHB 2002	32311 J2	VKS 6108	9)	
			•	VKHB 2001	32308 J2/Q	-		
G 112, P 112, R 112	•	AM60	VKBA 5064	•	VKHB 2003	32312 J2/Q	VKS 6108	
				•	VKHB 2004	32309 J2/Q	-	
G 112 M, P 112 M, R 112 M	•	AM70	VKBA 5087	•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6126	32)
				•	VKHB 2006	T2ED 055/QCLN	-	
	○	AD80	VKBA 5075	•	VKHB 2026	32216 J2/Q	VKS 6109	10)
	○			•	VKHB 2028	33215/Q	VKS 6110	
	○	AD80	-	•	VKHB 2026	32216 J2/Q	VKS 6109	5)
	○			•	VKHB 2033	32215 J2/Q	VKS 6110	



G 112, P 112, R 112	○	AD90, ADA90	VKBA 5067	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	10),98)
		○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105
	○	AD90, ADA90	VKBA 5068	•	VKHB 2030	32218 J2/Q	VKS 6106	12)
		○			•	VKHB 2030	32218 J2/Q	VKS 6105
	○	AD90, ADA90	VKBA 5067	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	13),98)
		○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105
	○	AD90, ADA90	VKBA 5067	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	11),98)
		○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105
	○	AD90, ADA90	VKBA 5068	•	VKHB 2030	32218 J2/Q	VKS 6106	14)
		○			•	VKHB 2030	32218 J2/Q	VKS 6105
○	AD100	VKBA 5083	•	VKHB 2032	HM 220149 A/W/110/QV002	VKS 6124		
	○			•	VKHB 2032	HM 220149 A/W/110/QV002	VKS 6262	
○	ARA55	VKBA 5077	•	VKHB 2002	32311 J2	VKS 6108		
	○			•	VKHB 2001	32308 J2/Q	-	
○	Trailing axle ASA60	VKBA 5064	•	VKHB 2003	32312 J2/Q	VKS 6108		
	○			•	VKHB 2004	32309 J2/Q	-	
○	Trailing axle ASA70	VKBA 5087	•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6126		
	○			•	VKHB 2006	T2ED 055/QCLN	-	
P 112 M (6x2), R 112 M (6x2)	○	Trailing axle AS60	VKBA 5064	•	VKHB 2003	32312 J2/Q	VKS 6108	
	○			•	VKHB 2004	32309 J2/Q	-	
P 112 H (6x2), R 112 H (6x2)	○	Trailing axle, AS90	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	10),98)
	○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○	Trailing axle AS90	-		•	VKHB 2030	32218 J2/Q	VKS 6106	5)
	○			•	VKHB 2030	32218 J2/Q	-	
T 112 M (4x2), T 112 H, T 112 E	•	AM55	-	•	VKHB 2002	32311 J2	VKS 6107	15)
	•			•	VKHB 2001	32308 J2/Q	-	
	•	AM55	VKBA 5077	•	VKHB 2002	32311 J2	VKS 6108	16)
	•			•	VKHB 2001	32308 J2/Q	-	
•	AM55	-		•	VKHB 2002	32311 J2	VKS 6107	8)
	•			•	VKHB 2001	32308 J2/Q	-	
	•	AM55	VKBA 5077	•	VKHB 2002	32311 J2	VKS 6108	9)
	•			•	VKHB 2001	32308 J2/Q	-	
T 112 (4x2, 6x2, 6x4)	•	AM60	VKBA 5064	•	VKHB 2003	32312 J2/Q	VKS 6108	
	•			•	VKHB 2004	32309 J2/Q	-	
•	AM70	VKBA 5087		•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6126	
	•			•	VKHB 2006	T2ED 055/QCLN	-	
T 112 M (4x2)	○	AD80	VKBA 5075	•	VKHB 2026	32216 J2/Q	VKS 6109	10)
	○			•	VKHB 2028	33215/Q	VKS 6110	
○	AD80	-		•	VKHB 2026	32216 J2/Q	VKS 6109	5)
	○			•	VKHB 2033	32215 J2/Q	VKS 6110	
T 112 (4x2, 6x2, 6x4)	○	AD90	VKBA 5067	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	10),98)
	○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105	
	○	AD90, ADA90	VKBA 5067	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	11),98)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105	
	○	AD90, ADA90	VKBA 5068	•	VKHB 2030	32218 J2/Q	VKS 6106	14)
○				•	VKHB 2030	32218 J2/Q	VKS 6105	





T 112 (4x2, 6x2, 6x4) .../...

○	AD90, ADA90	VKBA 5068	•	VKHB 2030	32218 J2/Q	VKS 6106	19)
○			•	VKHB 2030	32218 J2/Q	VKS 6105	
○	AD90, ADA90	VKBA 5067	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	20),98)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105	
○	AD100	VKBA 5083	•	VKHB 2032	HM 220149 A/W/110/QV002	VKS 6124	
○			•	VKHB 2032	HM 220149 A/W/110/QV002	VKS 6262	

T 112 (6x2)

○	Trailing axle, AS90	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	10),98)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○	Trailing axle, AS90	-	•	VKHB 2030	32218 J2/Q	VKS 6106	5)
○			•	VKHB 2030	32218 J2/Q	-	

P 113, R 113, T 113, P 113 H, P 113 E, R 113 H, P 113 M, R 113 M, K 113 E, R 113 M, T 113 H, T 113 E

•	AM56	VKBA 5225	•	VKHB 2228	T2EE 060/Q	VKS 6284	10)
•			•	VKHB 2004	32309 J2/Q	-	
•	AM56	VKBA 5226	•	VKHB 2003	32312 J2/Q	VKS 6261	5)
•			•	VKHB 2004	32309 J2/Q	-	
•	AM61	VKBA 5226	•	VKHB 2003	32312 J2/Q	VKS 6261	21)
•			•	VKHB 2004	32309 J2/Q	-	
•	AM70	VKBA 5087	•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6126	32)
•			•	VKHB 2006	T2ED 055/QCLN	-	
○	AD80	VKBA 5075	•	VKHB 2026	32216 J2/Q	VKS 6109	10)
○			•	VKHB 2028	33215/Q	VKS 6110	
○	AD80	-	•	VKHB 2026	32216 J2/Q	VKS 6109	5)
○			•	VKHB 2033	32215 J2/Q	VKS 6110	
○	AD90, ADA90	-	•	VKHB 2030	32218 J2/Q	VKS 6111	24),98)
○			•	VKHB 2030	32218 J2/Q	VKS 6105	
○	AD90, ADA90	VKBA 5068	•	VKHB 2030	32218 J2/Q	VKS 6106	25)
○			•	VKHB 2030	32218 J2/Q	VKS 6105	
○	AD90, ADA90	VKBA 5067	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	33),98)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105	
○	AD100	VKBA 5083	•	VKHB 2032	HM 220149 A/W/110/QV002	VKS 6124	34)
○			•	VKHB 2032	HM 220149 A/W/110/QV002	VKS 6262	
○	ARA56	VKBA 5225	•	VKHB 2228	T2EE 060/Q	VKS 6284	26)
○			•	VKHB 2004	32309 J2/Q	-	
○	ARA61	VKBA 5226	•	VKHB 2003	32312 J2/Q	VKS 6261	26)
○			•	VKHB 2004	32309 J2/Q	-	
○	Trailing axle, AS60	VKBA 5064	•	VKHB 2003	32312 J2/Q	VKS 6108	10)
○			•	VKHB 2004	32309 J2/Q	-	
○	Trailing axle, ASA70	VKBA 5087	•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6126	10)
○			•	VKHB 2006	T2ED 055/QCLN	-	
○	Trailing axle, ASA80	VKBA 5075	•	VKHB 2026	32216 J2/Q	VKS 6109	
○			•	VKHB 2028	33215/Q	VKS 6110	
○	Trailing axle, AS90	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	21),98)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	



114L, 114C, 114G

•		AM620	VKBA 5314	•	-	BTH-0018 B	-	85)
•				•	-	-	-	
•		AM620, AM920	VKBA 5314	•	-	BTH-0018 B	-	86)
•				•	-	-	-	
•		AM620, AM920, AMA860	VKBA 5314	•	-	BTH-0018 B	-	87)
•				•	-	-	-	
•		AM740, AMA740	VKBA 5314	•	-	BTH-0018 B	-	88)
•				•	-	-	-	
•		AM820D	VKBA 5314	•	-	BTH-0018 B	-	99)
•				•	-	-	-	
•		AM900	VKBA 5314	•	-	BTH-0018 B	-	47)
•				•	-	-	-	
•		AM920	VKBA 5314	•	-	BTH-0018 B	-	89)
•				•	-	-	-	
○		ADA	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98),99)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	
○		ADA100	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98,27)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	
○		ADA1100	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	102)
○		AD1100P	-	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	91)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○		AD1300, ADA1300	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98),
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	102)
○		AD1500P, ADA1500P	VKBA 5367	•	VKHB 2147	T2EE 100	VKS 6262	104)
○				+			VKS 6273	
○		AD1500P, ADA1500P	VKBA 5367	•	VKHB 2147	T2EE 100	VKS 6262	92)
○				+			VKS 6273	
○				•	VKHB 2147	T2EE 100	VKS 6262	
○		AS900	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	90),98)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○		AS900	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	95),98)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○		ASA1000	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	47),98)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○		ASA1000D	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98),99)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○		AS1300	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	10)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	

124L, 124C, 124G

•		AM620	VKBA 5314	•	-	BTH-0018 B	-	
•				•	-	-	-	
•		AM740, AM740D, AMA740, AMA740D	VKBA 5314	•	-	BTH-0018 B	-	47)
•				•	-	-	-	
•		AM820D	VKBA 5314	•	-	BTH-0018 B	-	99)
•				•	-	-	-	



124L, 124C, 124G .../...

•	AMA860, AMA860D	VKBA 5314	•	-	BTH-0018 B	-	
•			•	-	-	-	
•	AM900	VKBA 5314	•	-	BTH-0018 B	-	47)
•			•	-	-	-	
•	AM920	VKBA 5314	•	-	BTH-0018 B	-	
•			•	-	-	-	
•	AMD900	VKBA 5368	•	VKHB 2305	XC 8640 CD/HM 220110	VKS 6274	47)
•			•	VKHB 2305	XC 8640 CD/HM 220110	-	
○	ADA1100	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	27),98)
○	ADA1100		•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	
○	ADA1100	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	47),98)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	
○	AD1100P	-	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	91)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○	AD1300, ADA1300	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	47),98)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	
○	AD1300, ADA1300	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	27),98)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	
○	ADA1300D	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98),99)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	
○	AD1500P, ADA1500P	VKBA 5367	•	VKHB 2147	T2EE 100	VKS 6262	10),14)
○			+			VKS 6273	92)
○			•	VKHB 2147	T2EE 100	VKS 6262	
○	AS900	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	90),98)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○	AS900	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	95),98)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○	AS1300	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	48),98)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○	ASA1000	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	47),98)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○	ASA1000D	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98),107)
○			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○	ASA80	VKBA 5075	•	VKHB 2026	32216 J2/Q	VKS 6109	90)
○			•	VKHB 2028	33215/Q	VKS 6110	

L 140, LS 140, LT 145

•		VKBA 5064	•	VKHB 2003	32312 J2/Q	VKS 6108	
•			•	VKHB 2004	32309 J2/Q	-	
○	R651, RPB652, RP750	-	•	VKHB 2031	32219 J2	VKS 6125	
○			•	VKHB 2031	32219 J2	-	

L 140, LS 140

○	RP751	VKBA 5068	•	VKHB 2030	32218 J2/Q	VKS 6106	
○			•	VKHB 2030	32218 J2/Q	VKS 6105	

LS 140










○	Trailing axle	-	•	VKHB 2030	32218 J2/Q	VKS 6106	
○			•	VKHB 2030	32218 J2/Q	-	



LB 140, LBS 140, LBT 140	• •		VKBA 5064	• •	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	
	○ ○	R651	-	• •	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	- VKS 6105	
	○ ○	R652, RB652, RBP652, R751, R752	VKBA 5068	• •	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	
LB 140, LBS 140	○ ○	RP750	-	• •	VKHB 2031 VKHB 2031	32219 J2 32219 J2	VKS 6125 -	
LBS 140	○ ○	Trailing axle	-	• •	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 -	
L 141, LS 141, LT 146	• •		VKBA 5064	• •	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	
L 141, LS 141	○ ○	AD90	VKBA 5068	• •	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	17)
	○ ○	AD90	VKBA 5067	• •	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	18),98)
	○ ○	AD90	VKBA 5068	• •	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	5)
L 141, LS 141, LT 146	○ ○	AD95	-	• •	VKHB 2031 VKHB 2031	32219 J2 32219 J2	VKS 6125 -	
	○ ○	AD100	VKBA 5083	• •	VKHB 2032 VKHB 2032	HM 220149 A/W/110/QV002 HM 220149 A/W/110/QV002	VKS 6124 VKS 6262	
LS 141	○ ○	Trailing axle	-	• •	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 -	17)
	○ ○	Trailing axle	VKBA 5069	• •	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 -	18),98)
	○ ○	Trailing axle	-	• •	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 -	5)
LB 141, LBS 141, LBT 141	• •		VKBA 5064	• •	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	
LBT 141 FB	○ ○	AD80	-	• •	VKHB 2026 VKHB 2033	32216 J2/Q 32215 J2/Q	VKS 6104 -	30)
	○ ○	AD80	-	• •	VKHB 2026 VKHB 2028	32216 J2/Q 33215/Q	VKS 6109 VKS 6110	31)
	○ ○	AD80	-	• •	VKHB 2026 VKHB 2033	32216 J2/Q 32215 J2/Q	VKS 6104 -	5)
LB 141, LBS 141, LBT 141 BB/FB	○ ○	AD90	VKBA 5068	• •	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	30)
	○ ○	AD90	VKBA 5067	• •	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	31),98)
	○ ○	AD90	VKBA 5068	• •	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	5)
LBT 141 BB	○ ○	AD95	-	• +	VKHB 2031 VKHB 2031	32219 J2 32219 J2	VKS 6123 VKS 6125 VKS 6105	28)



LB 141, LBS 141, LBT 141 BB	○	AD95	-	●	VKHB 2031	32219 J2	VKS 6125	
	○			●	VKHB 2031	32219 J2	-	
	○	AD100	VKBA 5083	●	VKHB 2032	HM 220149 A/W/110/QV002	VKS 6124	
	○			●	VKHB 2032	HM 220149 A/W/110/QV002	VKS 6262	
LBS 141	○	Trailing axle	-	●	VKHB 2030	32218 J2/Q	VKS 6106	30)
	○			●	VKHB 2030	32218 J2/Q	-	
	○	Trailing axle	VKBA 5069	●	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	31),98)
	○			●	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
	○	Trailing axle	-	●	VKHB 2030	32218 J2/Q	VKS 6106	5)
	○			●	VKHB 2030	32218 J2/Q	-	
R 142 M (4x2), R 142 H, R 142 E	●	AM55	-	●	VKHB 2002	32311 J2	VKS 6107	6)
	●			●	VKHB 2001	32308 J2/Q	-	
	●	AM55	VKBA 5077	●	VKHB 2002	32311 J2	VKS 6108	7)
	●			●	VKHB 2001	32308 J2/Q	-	
	●	AM55	-	●	VKHB 2002	32311 J2	VKS 6107	8)
	●			●	VKHB 2001	32308 J2/Q	-	
	●	AM55	VKBA 5077	●	VKHB 2002	32311 J2	VKS 6108	9)
	●			●	VKHB 2001	32308 J2/Q	-	
R 142 (4x2, 6x2, 6x4)	●	AM60	VKBA 5064	●	VKHB 2003	32312 J2/Q	VKS 6108	
	●			●	VKHB 2004	32309 J2/Q	-	
	●	AM70	VKBA 5087	●	VKHB 2024	T2ED 070/QCLNVB061	VKS 6126	
	●			●	VKHB 2006	T2ED 055/QCLN	-	
R 142 M (6x4)	○	AD80	VKBA 5075	●	VKHB 2026	32216 J2/Q	VKS 6109	10)
	○			●	VKHB 2028	33215/Q	VKS 6110	
	○	AD80	-	●	VKHB 2026	32216 J2/Q	VKS 6109	5)
	○			●	VKHB 2033	32215 J2/Q	VKS 6110	
R 142 (4x2, 6x2, 6x4)	○	AD90, ADA90	VKBA 5067	●	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	10),98)
	○			●	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105	
	○	AD90, ADA90	VKBA 5067	●	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	11),98)
	○			●	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105	
	○	AD90, ADA90	VKBA 5068	●	VKHB 2030	32218 J2/Q	VKS 6106	12)
	○			●	VKHB 2030	32218 J2/Q	VKS 6105	
	○	AD90, ADA90	VKBA 5067	●	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	13),98)
	○			●	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6105	
	○	AD90, ADA90	VKBA 5068	●	VKHB 2030	32218 J2/Q	VKS 6106	14)
	○			●	VKHB 2030	32218 J2/Q	VKS 6105	
	○	AD100	VKBA 5083	●	VKHB 2032	HM 220149 A/W/110/QV002	VKS 6124	
	○			●	VKHB 2032	HM 220149 A/W/110/QV002	VKS 6262	
	○	ARA55	VKBA 5077	●	VKHB 2002	32311 J2	VKS 6108	
	○			●	VKHB 2001	32308 J2/Q	-	
	○	Trailing axle, ASA60	VKBA 5064	●	VKHB 2003	32312 J2/Q	VKS 6108	
	○			●	VKHB 2004	32309 J2/Q	-	
	○	Trailing axle, ASA70	VKBA 5087	●	VKHB 2024	T2ED 070/QCLNVB061	VKS 6126	
	○			●	VKHB 2006	T2ED 055/QCLN	-	

									
R 142 (6x2)		○	Trailing axle	VKBA 5069	•	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111	5),98)
R 142 H (6x2)		○	Trailing axle	VKBA 5069	•	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111	10),98)
R 142 M (6x2)		○	Trailing axle	VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108	10)
T 142		•	AM55	-	•	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6107	6)
		•	AM55	VKBA 5077	•	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6108	7)
		•	AM55	-	•	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6107	8)
		•	AM55	VKBA 5077	•	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6108	9)
T 142 (4x2, 6x2, 6x4), T 142 E		•	AM60	VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108	
		•	AM70	VKBA 5087	•	VKHB 2024 VKHB 2006	T2ED 070/QCLNVB061 T2ED 055/QCLN	VKS 6126	
T 142 M		○	AD80	VKBA 5075	•	VKHB 2026 VKHB 2028	32216 J2/Q 33215/Q	VKS 6109 VKS 6110	10)
		○	AD80	-	•	VKHB 2026 VKHB 2033	32216 J2/Q 32215 J2/Q	VKS 6109 VKS 6110	5)
		○	AD90, ADA90	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	10),98)
		○	AD90, ADA90	VKBA 5068	•	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	12)
		○	AD90, ADA90	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	13),98)
		○	AD90, ADA90	VKBA 5068	•	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	14)
T 142 (6x4)		○	AD90, ADA90	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	11),98)
T 142 (4x2, 6x2, 6x4)		○	AD100	VKBA 5083	•	VKHB 2032 VKHB 2032	HM 220149 A/W/110/QV002 HM 220149 A/W/110/QV002	VKS 6124 VKS 6262	
T 142 (6x2)		○	Trailing axle, AS90	VKBA 5069	•	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111	98)
R 143, R 143 E, R 143 H, R 143 M, T 143 H		•	AM56	VKBA 5225	•	VKHB 2228 VKHB 2004	T2EE 060/Q 32309 J2/Q	VKS 6284	10)
		•	AM56	VKBA 5226	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6261	5)



R 143, T 143	•	AM61	VKBA 5226	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6261 -	10)
	•	AM61	VKBA 5226	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6261 -	5)
	•	AM70	VKBA 5087	•	VKHB 2024 VKHB 2006	T2ED 070/QCLNVB061 T2ED 055/QCLN	VKS 6126 -	14)
	•	AM70	VKBA 5087	•	VKHB 2024 VKHB 2006	T2ED 070/QCLNVB061 T2ED 055/QCLN	VKS 6126 -	35)
	•	AM70	VKBA 5269	•	VKHB 2024 VKHB 2006	T2ED 070/QCLNVB061 T2ED 055/QCLN	VKS 6261 -	36)
R 143	•	AM800, AM 820	-	•	-	-	-	-
	•	AD80	VKBA 5075	•	VKHB 2026 VKHB 2028	32216 J2/Q 33215/Q	VKS 6109 VKS 6110	10)
R 143, T 143	○	AD80	-	•	VKHB 2026 VKHB 2033	32216 J2/Q 32215 J2/Q	VKS 6109 VKS 6110	5)
	○	AD90, ADA90	-	•	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6111 VKS 6105	24),98)
	○	AD90, ADA90	VKBA 5068	•	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	25)
	○	AD90, ADA90	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	33),98)
	○	AD100	VKBA 5083	•	VKHB 2032 VKHB 2032	HM 220149 A/W/110/QV002 HM 220149 A/W/110/QV002	VKS 6124 VKS 6262	33)
	○	AD100	VKBA 5083	•	VKHB 2032 VKHB 2032	HM 220149 A/W/110/QV002 HM 220149 A/W/110/QV002	VKS 6124 VKS 6262	37)
	○	AD100	VKBA 5272	•	VKHB 2147 VKHB 2147	T2EE 100 T2EE 100	VKS 6244 VKS 6262	38)
	○	ARA56	VKBA 5225	•	VKHB 2228 VKHB 2004	T2EE 060/Q 32309 J2/Q	VKS 6284 -	-
	○	ARA61	VKBA 5226	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6261 -	-
	○	ASA70	VKBA 5087	•	VKHB 2024 VKHB 2006	T2ED 070/QCLNVB061 T2ED 055/QCLN	VKS 6126 -	35)
R 143, T 143	○	ASA70	VKBA 5270	•	VKHB 2024 VKHB 2006	T2ED 070/QCLNVB061 T2ED 055/QCLN	VKS 6261 -	36)
	○	Trailing axle, AS90	VKBA 5069	•	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 -	21),98)
	○	Trailing axle, AS60	VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	10)
	○	Trailing axle, ASA80	VKBA 5075	•	VKHB 2026 VKHB 2028	32216 J2/Q 33215/Q	VKS 6109 VKS 6110	10)



144L, 144C, 144G

•		AM620	VKBA 5314	•	-	BTH-0018 B	-	
•				•	-	-	-	
•		AM740, AM740D AMA740, AMA740D	VKBA 5314	•	-	BTH-0018 B	-	47)
•				•	-	-	-	
•		AM820D	VKBA 5314	•	-	BTH-0018 B	-	99)
•				•	-	-	-	
•		AMA860 AMA860D	VKBA 5314	•	-	BTH-0018 B	-	
•				•	-	-	-	
•		AM900	VKBA 5314	•	-	BTH-0018 B	-	47)
•				•	-	-	-	
•		AM920	VKBA 5314	•	-	BTH-0018 B	-	
•				•	-	-	-	
○		ADA1100	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98),99)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	
○		ADA1100	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	
○		ADA1100	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	27),98)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	
○		AD1100P	-	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	91)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○		AD1100P	-	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	5),103)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○		ADA1300D	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98),99)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	
○		AD1300, ADA1300	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	47),98)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	
○		AD1300, ADA1300	VKBA 5365	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	27),98)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6272	
○		AD1500P, ADA1500P	VKBA 5367	•	VKHB 2147	T2EE 100	VKS 6262	92)
○				+	VKHB 2147	T2EE 100	VKS 6273	
○				•	VKHB 2147	T2EE 100	VKS 6262	
○		AD1500P, ADA1500P	VKBA 5367	•	VKHB 2147	T2EE 100	VKS 6262	104)
○				+	VKHB 2147	T2EE 100	VKS 6273	
○				•	VKHB 2147	T2EE 100	VKS 6262	
○		AS900	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○		ASA1000	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	47),98)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○		ASA1000	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	98),99)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○		AS1300	VKBA 5069	•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6111	10)
○				•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	
○		ASA70	VKBA 5269	•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6261	90)
○				•	VKHB 2006	T2ED 055/QCLN	-	
○		ASA80	VKBA 5075	•	VKHB 2026	32216 J2/Q	VKS 6109	90)
○				•	VKHB 2028	33215/Q	VKS 6110	







# VOLKSWAGEN

LT - Ser. .... 206  
Transporter..... 207

# VOLKSWAGEN



LT 28, LT 31 (281-286)	•		VKBA 802	•	-	-	-	1)
	•		-	•	-	-	-	2)
		○	VKBA 1477	•	-	-	-	3)
		○	VKBA 1496	•	-	-	-	4)
		○	VKBA 1497	•	-	-	-	5)
LT 35 (291-296)	•		VKBA 802	•	-	-	-	1)
	•		-	•	VKHB 2275	32010 X/OCL7CVB026	-	6)
		○	VKBA 1496	•	-	-	-	7)
		○	VKBA 1497	•	-	-	-	8)
LT 40, LT 45 (291, 293, 295)	•		VKBA 802	•	-	-	-	10)
	•		VKBA 836	•	-	-	-	11)
	•		VKBA 802	•	-	-	-	9)
	•		-	•	VKHB 2275	32010 X/OCL7CVB026	-	12)
		○	-	•	VKHB 2275	32010 X/OCL7CVB026	-	
LT 40, LT 45 (292, 294, 296)	•		VKBA 802	•	-	-	-	13)
	•		VKBA 836	•	-	-	-	14)
	•		VKBA 836	•	-	-	-	15)
	•		-	•	VKHB 2275	32010 X/OCL7CVB026	-	12)
		○	-	•	VKHB 2060	32011 X/Q	VKS 6163	15)
		○	-	•	VKHB 2017	32210 J2/Q	-	
		○	-	•	VKHB 2275	32010 X/OCL7CVB026	-	16)
	○	-	•	VKHB 2060	32011 X/Q	VKS 6163	17)	
	○	-	•	VKHB 2017	32210 J2/Q	-		
LT 50, LT 55	•		VKBA 836	•	-	-	-	18)
	•		-	•	VKHB 2060	32011 X/Q	VKS 6163	18)
	○	-	•	VKHB 2017	32210 J2/Q	-		



Transporter Syncro 4x4

- 
- 
- 
- 
- 
- 
- 
- 

-  
VKBA 3406  
VKBA 910  
VKBA 3406

- 
- 
- 
- 
- 

-  
-  
-  
-

-  
-  
-  
-

-  
-  
-  
-  
-  
-  
-

26)  
27)  
26)  
27)

Transporter, Minibus

- 
- 
- 
- 
- 
- 
- 
- 
- 
- 

-  
VKBA 519  
VKBA 911  
VKBA 912  
-  
VKBA 910

- 
- 
- 
- 
- 
- 
- 
- 
- 
- 

-  
-  
-  
-  
-  
-  
-  
-

-  
-  
-  
-  
-  
-  
-  
-

-  
-  
LM 300849/811/OCL7A  
LM 11949/910/Q  
LM 300849/811/OCL7A  
LM 12749/710/Q  
-  
-

-  
-  
-  
-  
-  
-  
-  
-  
-  
-

19)  
20)  
21)  
22)  
24)  
25)

Transporter, Minibus T4 (FWD)

- 
- 
- 
- 

VKBA 3406  
VKBA 3406

- 
- 
- 
- 

-  
-  
-  
-

-  
-  
-  
-

-  
-  
-  
-

29)  
30)





## VOLVO

F 84, F 85 .....	210	N 7 .....	216
N 84 .....	210	FM 9 .....	217
F 86, F 87 .....	210	F 10 .....	217
FB 86 .....	210	FL 10 .....	217–218
N 86, NB 86 .....	210	FM 10 .....	218
F 88, FB 88, G 88 .....	211	FS 10 .....	218
N 88, NB 88 .....	211	N 10 .....	218–219
F 89, G 89 .....	211	NL 10 .....	219
F 406, F 407, F 408 .....	211	F 12 .....	220
FL 4 .....	211	FH 12 .....	220–221
F 607, F 608, F 609, F 610 .....	212	FL 12 .....	221
F 611, F 612, F 613, F 614 .....	212	FLC .....	221
F 615, F 616, F 617 .....	212	FM 12 .....	221
FL 6 .....	212–213	N 12 .....	221–222
FL 608, FL 611, FL 612, FL 614, FL 615, FL 617, FL 619 .....	213–214	NH 12 .....	222
F 7 .....	214–215	NL 12 .....	222
FL 7 .....	215	F 16 .....	223
FM 7 .....	216	FH 16 .....	223–224
FS 7 .....	216		



F 84, F 85	•	FAT 4,1	-	•	VKHB 2008 VKHB 2009	621/612 3581/3525/Q	-	
	•			-				
	•	FAT 5,0	-	•	-	-	VKS 6113	
	•			VKHB 2001	32308 J2/Q	-		
	○	RAEV60, RATS60	-	•	VKHB 2038 VKHB 2039	582/572/Q 42687/42620	-	
	○			-				
○	RATS80	-	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6128		
○			VKS 6298					
○	RATS81	-	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6115	1)	
○			VKS 6298					
N 84	•	FAT 3,8	-	•	VKHB 2008 VKHB 2009	621/612 3581/3525/Q	-	
	•			-				
	○	RAEV60, RATS60	-	•	VKHB 2038 VKHB 2039	582/572/Q 42687/42620	-	
	○			-				
	○	RATS80	-	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6128	
○	VKS 6298							
○	RATS81	-	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6115	1)	
○			VKS 6298					
F 86, F 87	•	FAT 5,0	-	•	-	-	VKS 6113	2)
	•			VKHB 2001	32308 J2/Q	-		
F 86, FB 86, F 87	•	FAT 6,0	VKBA 5099	•	VKHB 2013 VKHB 2014	6386/K-6320/Q 537/532 X/Q	VKS 6114	
	•			-				
F 86, F 87	○	BAT 10	-	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6128	
	○			VKS 6298				
F 86, FB 86, F 87	○	BAT 11	VKBA 5101	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135	
	○			VKS 6298				
FB 86	○	Trailing axle	-	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6128	3)
	○			-				
	○	Trailing axle	-	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6115	4)
○	-							
	○	Trailing axle	-	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135	5)
	○			-				
N 86, NB 86	•	FAT 5,0	-	•	-	-	VKS 6113	2)
	•			VKHB 2001	32308 J2/Q	-		
	•	FAT 6,0	VKBA 5105	•	VKHB 2013 VKHB 2014	6386/K-6320/Q 537/532 X/Q	VKS 6114	
	•			-				
N 86	○	BAT 10	-	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6128	
	○			VKS 6298				
N 86, NB 86	○	BAT 11	VKBA 5101	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135	6)
	○			VKS 6298				
	○	BAT 11	-	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6129	7)
	○			VKS 6298				
N 86	○	Trailing axle	-	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6128	
	○			-				



F 88, FB 88, G 88	• •		FAT 6,0	VKBA 5099	• •	VKHB 2013 VKHB 2014	6386/K-6320/Q 537/532 X/Q	VKS 6114 -	
		○ ○		VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	8)
		○ ○		-	• •	VKHB 2031 VKHB 2031	32219 J2 32219 J2	VKS 6127 -	9)
FB 88, G 88 (6x2)		○ ○	Trailing axle	-	• •	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6128 -	
N 88 (4x2), NB 88 (6x2)	• •		FAT 5,0	-	• •	- VKHB 2001	- 32308 J2/Q	VKS 6113 -	2)
	• •		FAT 6,0	VKBA 5105	• •	VKHB 2013 VKHB 2014	6386/K-6320/Q 537/532 X/Q	VKS 6114 -	
N 88, NB 88		○ ○		VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	10)
		○ ○		-	• •	VKHB 2031 VKHB 2031	32219 J2 32219 J2	VKS 6127 -	9)
NB 88 (6x2)		○ ○	Trailing axle	-	• •	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6128 -	11)
		○ ○	Trailing axle	-	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	12)
F 89, G 89 (4x2, 6x2, 6x4)	• •			VKBA 5099	• •	VKHB 2013 VKHB 2014	6386/K-6320/Q 537/532 X/Q	VKS 6114 -	
		○ ○		VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	10)
F 89, G 89 (4x2, 6x2)		○ ○		-	• •	VKHB 2031 VKHB 2031	32219 J2 32219 J2	VKS 6127 -	9)
F 89, G 89 (6x2)		○ ○	Trailing axle	-	• •	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6128 -	13)
		○ ○	Trailing axle	-	• •	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6115 -	14)
		○ ○	Trailing axle	-	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	15)
F 406, F 407, F 408	• • • •			-	• • • •	VKHB 2015 VKHB 2016 VKHB 2017 VKHB 2018	32209 J2/Q 32206 J2/Q 32210 J2/Q 32207 J2/Q	VKS 6130 - VKS 6131 -	16) 17)
		○ ○		-	• •	VKHB 2044 VKHB 2045	33014 33012/Q	VKS 6142 -	18)
		○ ○		-	• •	VKHB 2044 VKHB 2045	33014 33012/Q	VKS 6141 -	19)
FL 4	• •			-	• •	- VKHB 2182	- 33207/Q	VKS 6202 -	
		○ ○		-	• •	VKHB 2044 VKHB 2045	33014 33012/Q	VKS 6141 -	





F 607, F 608, F 609, F 610

•  
•

○  
○  
○  
○

-

•  
•

VKHB 2017  
VKHB 2018

32210 J2/Q  
32207 J2/Q

VKS 6131  
-

20)

VKHB 2046  
VKHB 2047

33015/Q  
33013/Q

VKS 6142  
-

21)

VKHB 2046  
VKHB 2047

33015/Q  
33013/Q

VKS 6141  
-

F 611

•  
•

•  
•

-

•  
•

VKHB 2019  
VKHB 2020

32211 J2/Q  
32208 J2/Q

VKS 6239  
-

22)

VKHB 2021  
VKHB 2020

JM 207049/JM 207010  
32208 J2/Q

VKS 6239  
-

23)

F 612, F 613

•  
•

•  
•

-

•  
•

VKHB 2019  
VKHB 2020

32211 J2/Q  
32208 J2/Q

VKS 6239  
-

24)

VKHB 2021  
VKHB 2020

JM 207049/JM 207010  
32208 J2/Q

VKS 6239  
-

25)

F 614

•  
•

•  
•

-

•  
•

VKHB 2019  
VKHB 2020

32211 J2/Q  
32208 J2/Q

VKS 6239  
-

26)

VKHB 2021  
VKHB 2020

JM 207049/JM 207010  
32208 J2/Q

VKS 6239  
-

27)

F 611, F 612, F 613, F 614

○  
○  
○  
○

-

•  
•

VKHB 2048  
VKHB 2046

33018/Q  
33015/Q

VKS 6140  
-

28)

VKHB 2048  
VKHB 2046

33018/Q  
33015/Q

VKS 6139  
-

29)

F 615, F 616, F 617

•  
•

•  
•

•  
•

○  
○

○  
○

○  
○

-

VKBA 5099

VKBA 5124

-

VKBA 5127

•  
•

•  
•

•  
•

•  
•

•  
•

•  
•

-  
VKHB 2023

VKHB 2013  
VKHB 2014

VKHB 2024  
VKHB 2036

-

VKHB 2040  
VKHB 2041

VKHB 2040  
VKHB 2041

-  
JM 205149/110/Q

6386/K-6320/Q  
537/532 X/Q

T2ED 070/QCLNVB061  
39580/W/2/39520/2/Q

-  
580/572/Q

594/592 A/Q  
580/572/Q

594/592 A/Q  
580/572/Q

VKS 6113  
-

VKS 6114  
-

VKS 6134  
-

VKS 6115  
VKS 6137

VKS 6136  
VKS 6137

VKS 6136  
-

30)

31)

32)

33)

34)

32)

FL 6 (CHID B166080-,  
FL608-FL612)

•  
•

•  
•

•  
•

•  
•

-

-

-

-

•  
•

•  
•

•  
•

•  
•

-  
VKHB 2182

-  
VKHB 2065

-  
VKHB 2065

-  
VKHB 2065

-  
33207/Q

-  
33208/Q

-  
33208/Q

-  
33208/Q

VKS 6202  
-

-  
-

VKS 6206  
-

VKS 6206  
-

144)

145)

35)

FL 6 (CHID B166080-,  
FL612 FL615)

•  
•

-

•  
•

-  
VKHB 2065

-  
33208/Q

VKS 6206  
-










35)



FL 6 (CHID B166080-, FL616-FL626)	• •		VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	
	• •		VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	39)
	• •		VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	46)
FL 6 (CHID -B169139, FL616-FL626)	• •		VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	11)
FL6 (CHID.B169140-, FL616-FL626)	• •		VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	39)
FL 6 (CHID B 169140- B190331, 4x2, 6x2, 6x4)	○ ○		VKBA 5101	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	
FL 6 (CHID B166080-, FL618-FL619)	○ ○	BAT 10,9. BAT 11,2. BAT 13,0	VKBA 5127	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6136 -	141)
FL 6 (CHID B166080-, FL608-FL612)	○ ○		VKBA 5135	•	VKHB 2221 VKHB 2175	47678/Q/47620/Q 39590/39520/Q	VKS 6207 -	143)
	○ ○		VKBA 5135	•	VKHB 2221 VKHB 2175	47678/Q/47620/Q 39590/39520/Q	VKS 6207 -	159)
FL 6 (CHID B166080-, FL612-FL615)	○ ○		-	•	- VKHB 2222	- 33115/Q	VKS 6139 -	140)
FL 6 (CHID B166080-, FL616-FL617)	○ ○		VKBA 5127	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6136 -	142)
FL 6 (CHID B166080-, FL616-FL626, 4x2)	○ ○		VKBA 5127	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6136 -	12)
FL 6 (CHID.-B169139, FL618-FL619, 4x2)	○ ○		VKBA 5127	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6136 -	142)
FL 6 (CHID B166080-)	○ ○	Trailing axle	-	•	- VKHB 2065	- 33208/Q	- -	160)
FL 608-612	• •	FAT 4,1	-	•	- VKHB 2182	- 33207/Q	VKS 6202 -	35)
	• •	FAT 4,7	-	•	- VKHB 2182	- 33207/Q	- -	
FL 608-611	○ ○		VKBA 5135	•	VKHB 2221 VKHB 2175	47678/Q/47620/Q 39590/39520/Q	VKS 6207 -	36)
FL 608-612	○ ○		VKBA 5135	•	VKHB 2221 VKHB 2175	47678/Q/47620/Q 39590/39520/Q	VKS 6207 -	150)
FL 608-615	○ ○		-	•	- VKHB 2065	- 33208/Q	VKS 6206 -	151)
FL 612	• •	FAT 4,1	-	•	- VKHB 2182	- 33207/Q	VKS 6202 -	146)
	• •	FAT 4,7	-	•	- VKHB 2182	- 33207/Q	- -	146)












FL 612-614	• •	FAT 5,0 FAT 5,6	-	• •	- VKHB 2065	- 33208/Q	VKS 6206 -	35)
FL 612-615	• •		-	• •	- VKHB 2065	- 33208/Q	VKS 6206 -	35)
FL 612-614	○ ○ ○ ○ ○		-	• • • •	- VKHB 2222 VKHB 2048 VKHB 2222	- 33115/Q 33018/Q 33115/Q	VKS 6139 - VKS 6139 -	35)  37)  38)
FL 616-617	• •		VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	
FL 616-619	• • • •		VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	39)
	○ ○ ○ ○		VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	46)
	○ ○		VKBA 5127	• •	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6136 -	40)
	○ ○		VKBA 5127	• •	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6136 -	46)
FL 616-617	○ ○		VKBA 5127	• •	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6136 -	
FL 618-619	○ ○ ○ ○ ○ ○ ○ ○	BAT 10,9, BAT 11,2	VKBA 5127	• •	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6136 -	39)
	○ ○	BAT 10,0, BAT 10,9	VKBA 5127	• •	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6136 -	40)
	○ ○	BAT 11,5	VKBA 5373	• •	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6136 -	147)
	○ ○	BAT 11,5, BAT 13,0	-	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6243 -	148)
	○ ○	BAT 11,5, BAT 13,0	-	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6243 VKS 6298	40)
FL 616-619	○ ○	Trailing axle	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	149)
F 7 (4x2, 6x2, 6x4, 8x2, 8x4)	• • • • • • • •	FAT 6,5	VKBA 5099	• •	VKHB 2013 VKHB 2014	6386/K-6320/Q 537/532 X/Q	VKS 6114 -	41)
	• •	FAT 6,5	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	42)
	• •	FAT 6,5	VKBA 5099	• •	VKHB 2013 VKHB 2014	6386/K-6320/Q 537/532 X/Q	VKS 6114 -	43)
	• •	FAT 6,5	-	• •	VKHB 2013 VKHB 2014	6386/K-6320/Q 537/532 X/Q	VKS 6133 -	44)
	• •	FAT 6,5	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	45)
	• •	FAT 7,5	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	

								
F 7 (4X2, 6X2, 8X2, 6X4, 8X4)	○ ○		VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	11)
	○ ○		VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	46)
F 7 (6X2, 6X4, 8X2, 8X4)	○ ○		VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	
F 7 (4X2)	○ ○		VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	47)
F 7 (6x2)	○ ○	Trailing axle	-	• •	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6115 -	48)
	○ ○	Trailing axle	-	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	49)
	○ ○	Trailing axle	-	• •	VKHB 2050 VKHB 2051	HM 215249/HM 215210 33213/Q	VKS 6138 -	50)
	○ ○	Trailing axle	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	51)
FL 7	• •		VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	12)
	• •		VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	52)
	• •		-	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6134 -	53)
FL 7 (4x2, 6x2, 8x2, 6x4, 8x4)	○ ○	RAEV 85B, CTEV 87	VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	55)
	○ ○	RAEV 85B, CTEV 87	VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	56)
FL 7 (4x2, 6x2, 6x4)	○ ○	RAN371, RTN372, RTN371	VKBA 5125	• •	VKHB 2053 VKHB 2029	BT1B 639417/Q HM 218248/W/2A/210/2A/Q	VKS 6132 VKS 6179	9)
FL 7	○ ○	Trailing axle	-	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	57)
FL 7 (4x2, 6x2, 6x4)	○ ○	Trailing axle	-	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	11)
	○ ○	Trailing axle	VKBA 5273	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	12)
	○ ○	Trailing axle	VKBA 5273	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	57)
	○ ○	Trailing axle	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	58)
FL 7	○ ○	Trailing axle	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	104)
FL 7 (4x2, 6x2, 6x4)	○ ○	Trailing axle	VKBA 5142	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6135 -	59)



FM7	•		VKBA 5285	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	11)
	•		VKBA 5285	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	101)
	○	RAN371 CTN372	VKBA 5287	•	VKHB 2053 VKHB 2029	BT1B 639417/Q HM 218248/W/2A/210/2A/Q	VKS 6132 VKS 6179	
	○	Trailing axle	VKBA 5285	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	104)
FS 7	•		VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	
	○		VKBA 5127	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6136 -	35)
	○		VKBA 5127	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6136 -	156)
	○		-	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6243 -	157)
	○		-	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6243 -	60)
	○		VKBA 5391	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6136 -	158)
	○	Trailing axle	VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	
	○							
N 7 (4x2, 6x2, 6x4)	•	FAT 5,0	-	•	- VKHB 2001	- 32308 J2/Q	VKS 6113 -	
	•	FAT 5,0	-	•	- VKHB 2001	- 32308 J2/Q	VKS 6114 -	46)
	•	FAT 6,5	VKBA 5099	•	VKHB 2013 VKHB 2014	6386/K-6320/Q 537/532 X/Q	VKS 6114 -	61)
	•	FAT 6,5	VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	62)
	•	FAT 7,5	VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	
N 7 (4x2, 6x2)	○	BAT 10	-	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6135 VKS 6298	
N 7 (4x2, 6x2, 6x4)	○	BAT 13	VKBA 5101	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	
N 7 (4x2, 6x2)	○	RAEV85B	VKBA 5101	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	63)
N 7 (6x2)	○	Trailing axle	-	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	12)
	○	Trailing axle	-	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6115 -	64)
	○	Trailing axle	-	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	65)

									
FM 9	•			VKBA 5285	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	
	•	○	RAN471, CTN372 CTN472	VKBA 5287	•	VKHB 2053 VKHB 2029	BT1B 639417/Q HM 218248/W/2A/210/2A/Q	VKS 6132 VKS 6179	
	•	○	Trailing axle	VKBA 5285	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	104)
F 10 (4x2, 6x2, 6x4)	•		FAT 6,5	VKBA 5099	•	VKHB 2013 VKHB 2014	6386/K-6320/Q 537/532 X/Q	VKS 6114 -	66)
	•		FAT 6,5	VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	67)
	•		FAT 7,5	VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	
F 10 (4x2, 6x2)		○		VKBA 5101	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	69)
F 10 (4x2, 6x2, 6x4)		○		VKBA 5101	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	68)
F 10 (4x2, 6x2)		○		-	•	VKHB 2042 VKHB 2052	683/672 749 A/Q/742/Q	VKS 6135 VKS 6298	70)
		○	RAN71, RTN71, RTN72	VKBA 5125	•	VKHB 2053 VKHB 2029	BT1B 639417/Q HM 218248/W/2A/210/2A/Q	VKS 6132 VKS 6179	9)
		○	RAN81, RTN80, RTN87	-	•	VKHB 2031 VKHB 2031	32219 J2 32219 J2	VKS 6127 -	9)
F 10 (6x2)		○	Trailing axle	VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	117)
		○	Trailing axle	-	•	VKHB 2029 VKHB 2051	HM 218248/W/2A/210/2A/Q 33213/Q	VKS 6195 -	118)
		○	Trailing axle	-	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6115 -	71)
		○	Trailing axle	-	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	72)
		○	Trailing axle	VKBA 5101	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	73)
		○	Trailing axle	-	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	74)
		○	Trailing axle	-	•	VKHB 2042 VKHB 2052	683/672 749 A/Q/742/Q	VKS 6135 -	75)
		○	Trailing axle	-	•	VKHB 2050 VKHB 2051	HM 215249/HM 215210 33213/Q	VKS 6138 -	76)
		○	Trailing axle	VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	77)
FL 10	•			VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	12)
	•			VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	52)
	•			-	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6134 -	53)



FL 10 (6x4, 8x4)	• •		-	• •	VKHB 2225 VKHB 2003	33217/Q 32312 J2/Q	VKS 6297 -	54)
FL 10 (4x2, 6x2, 6x4, 8x4)	○ ○		VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	
FL 10 (4x2, 6x2, 8x2, 6x4, 8x4)	○ ○	RAEV 85B, CTEV 87	VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	55)
		RAEV 85B, CTEV 87	VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	56)
FL 10 (4x2, 6x2, 6x4)	○ ○	RAN371, RTN372, RTN371	VKBA 5125	• •	VKHB 2053 VKHB 2029	BT1B 639417/Q HM 218248/W/2A/210/2A/Q	VKS 6132 VKS 6179	9)
FL 10	○ ○	Trailing axle	-	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	57)
FL 10 (4x2, 6x2, 6x4)	○ ○ ○ ○	Trailing axle	-	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	11)
		Trailing axle	VKBA 5273	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	12)
		Trailing axle	VKBA 5273	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	57)
		Trailing axle	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	58)
FL 10	○ ○	Trailing axle	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	104)
FL 10 (4x2, 6x2, 6x4)	○ ○	Trailing axle	VKBA 5142	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6135 -	59)
FM10	• • • •		VKBA 5285	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	11)
			VKBA 5285	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	101)
		Rear axle RAN 371, CTN 372, CTN 472	-	• •	VKHB 2053 VKHB 2029	BT1B 639417/Q HM 218248/W/2A/210/2A/Q	VKS 6179 -	
	○ ○	Trailing axle	VKBA 5285	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	104)
FS 10	• •		VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	46)
FS 10 (4x2, 6x4, 8x4)	○ ○		VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	69)
			VKBA 5125	• •	VKHB 2053 VKHB 2029	BT1B 639417/Q HM 218248/W/2A/210/2A/Q	VKS 6132 VKS 6179	78)
N 10 (4x2, 6x2, 6x4)	• • • • •	FAT 5,0	-	• •	- VKHB 2001	- 32308 J2/Q	VKS 6113 -	
		FAT 6,5	VKBA 5099	• •	VKHB 2013 VKHB 2014	6386/K-6320/Q 537/532 X/Q	VKS 6114 -	79)
		FAT 6,5	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	80)
		FAT 7,5	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	












	•			VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	81)
	•			VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	82)
N 10 (4x2, 6x2)	○	BAT 10	-		•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6135 VKS 6298	11)
N 10 (4x2, 6x2, 6x4)	○	BAT 13	VKBA 5101		•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	11)
	○		VKBA 5101		•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	69)
	○		-		•	VKHB 2042 VKHB 2052	683/672 749 A/Q/742/Q	VKS 6135 VKS 6298	70)
	○		VKBA 5101		•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	83)
	○	RAN71, RTN71, RTN72	VKBA 5125		•	VKHB 2053 VKHB 2029	BT1B 639417/Q HM 218248/W/2A/210/2A/Q	VKS 6132 VKS 6179	9)
	○	RAN81, RTN80, RTN82, RTN87	-		•	VKHB 2031 VKHB 2031	32219 J2 32219 J2	VKS 6127 -	9)
N 10 (6x2)	○	Trailing axle	-		•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	46)
	○	Trailing axle	-		•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6115 -	84)
	○	Trailing axle	-		•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	85)
	○	Trailing axle	-		•	VKHB 2042 VKHB 2052	683/672 749 A/Q/742/Q	VKS 6135 -	86)
NL 10 S	•	FAT 6,5, 6,7	VKBA 5124		•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	11)
	•	FAT 7,5, 8,0	VKBA 5124		•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	87)
	•	FAT 9,0	-		•	VKHB 2225 VKHB 2003	33217/Q 32312 J2/Q	VKS 6297 -	88)
NL 10 S (4x2, 6x2, 6x4)	○		VKBA 5101		•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	11)
	○		VKBA 5101		•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	69)
	○		-		•	VKHB 2042 VKHB 2052	683/672 749 A/Q/742/Q	VKS 6135 VKS 6298	70)
	○	Trailing axle	-		•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	11)
	○	Trailing axle	-		•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	46)
	○	Trailing axle	-		•	VKHB 2042 VKHB 2052	683/672 749 A/Q/742/Q	VKS 6135 -	89)





F 12 (4x2, 6x2, 6x4)	• •		FAT 6,5	VKBA 5099	• •	VKHB 2013 VKHB 2014	6386/K-6320/Q 537/532 X/Q	VKS 6114 -	90)
			FAT 6,5	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	91)
F 12 (4x2, 6x2, 6x4, 8x2, 8x4)	• •		FAT 7,5	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	92)
			FAT 7,5	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	93)
F 12 (4x2, 6x2, 6x4)	○ ○ ○ ○			VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	69)
				-	• •	VKHB 2042 VKHB 2052	683/672 749 A/Q/742/Q	VKS 6135 VKS 6298	70)
				VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	94)
			RAN81, RTN80, RTN87	-	• •	VKHB 2031 VKHB 2031	32219 J2 32219 J2	VKS 6127 -	9)
F 12 (4x2, 6x2, 6x4, 8x2, 8x4)	○ ○		RAN71, RTN71, RTN72	VKBA 5125	• •	VKHB 2053 VKHB 2029	BT1B 639417/Q HM 218248/W/2A/210/2A/Q	VKS 6132 VKS 6179	9)
F 12 (6x2)	○ ○ ○ ○		Trailing axle	-	• •	VKHB 2029 VKHB 2051	HM 218248/W/2A/210/2A/Q 33213/Q	VKS 6195 -	100)
			Trailing axle	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	51)
			Trailing axle	-	• •	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6115 -	95)
			Trailing axle	-	• •	VKHB 2050 VKHB 2051	HM 215249/HM 215210 33213/Q	VKS 6138 -	99)
F 12 (6x2, 8x2)	○ ○ ○		Trailing axle	-	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	96)
			Trailing axle	-	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	97)
			Trailing axle	-	• •	VKHB 2042 VKHB 2052	683/672 749 A/Q/742/Q	VKS 6135 -	98)
FH 12	• •			VKBA 5285	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	101)
				VKBA 5285	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	11)
FH 12 (4x2, 6x2, 6x4, 8x4)	○ ○			VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	11)
FH 12 (4x2, 6x2, 6x4)	○ ○ ○			VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	102)
			CTN372	VKBA 5287	• •	VKHB 2053 VKHB 2029	BT1B 639417/Q HM 218248/W/2A/210/2A/Q	VKS 6132 VKS 6179	103)
			RAN471	VKBA 5287	• •	VKHB 2053 VKHB 2029	BT1B 639417/Q HM 218248/W/2A/210/2A/Q	VKS 6132 VKS 6179	9)

									
FH 12		○ ○	Trailing axle	VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	12)
FH 12 (4x2, 6x2, 6x4), CHID.-A276505, -B190367, - 563621		○ ○	Trailing axle	VKBA 5285	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	104)
FH 12 (4x2, 6x2, 6x4), CHID.-A276505, -B190367, - 563621		○ ○	Trailing axle	VKBA 5273	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	105)
FH 12 (4x2, 6x2, 6x4)		○ ○	Trailing axle	VKBA 5273	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	12)
FL 12	• •			VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	
FL 12 (4x2, 6x2, 6x4, 8x4)		○ ○ ○ ○ ○ ○ ○ ○		VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	11)
		○ ○		VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	12)
		○ ○	Trailing axle	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	
		○ ○	Trailing axle	VKBA 5273	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	
		○ ○	Trailing axle	VKBA 5273	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	12)
		○ ○	Trailing axle	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	99)
FLC	• •			-	• •	- VKHB 2182	- 33207/Q	VKS 6202 -	
		○ ○		-	• •	VKHB 2044 VKHB 2045	33014 33012/Q	VKS 6141 -	
FM12	• • • •			VKBA 5285	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	11)
		○ ○		VKBA 5285	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	101)
		○ ○	RAN471, CTN372 CTN472	VKBA 5287	• •	VKHB 2053 VKHB 2029	BT1B 639417/Q HM 218248/W/2A/210/2A/Q	VKS 6132 VKS 6179	161)
		○ ○	Trailing axle	VKBA 5285	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	104)
N 12 (4x2, 6x2, 6x4)	• • • • • •		FAT 5,0	-	• •	- VKHB 2001	- 32308 J2/Q	VKS 6113 -	
		• •	FAT 6,5	VKBA 5099	• •	VKHB 2013 VKHB 2014	6386/K-6320/Q 537/532 X/Q	VKS 6114 -	106)
		• •	FAT 6,5	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	107)
		• •	FAT 7,5 8,0	VKBA 5124	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	101)



N 12 (4x2, 6x2, 6x4) .../...

•		-	•	VKHB 2042	683/672	VKS 6135	
•			•	VKHB 2052	749 A/Q/742/Q	VKS 6298	
•		VKBA 5101	•	VKHB 2042	683/672	VKS 6135	69)
•			•	VKHB 2043	663/653/Q	VKS 6298	
•	BAT 10	-	•	VKHB 2040	594/592 A/Q	VKS 6135	11)
•			•	VKHB 2041	580/572/Q	VKS 6298	
•	BAT 13	VKBA 5101	•	VKHB 2042	683/672	VKS 6135	11)
•			•	VKHB 2043	663/653/Q	VKS 6298	
•	RAN71, RTN71, RTN72	VKBA 5125	•	VKHB 2053	BT1B 639417/Q	VKS 6132	9)
•			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6179	
•	RAN81, RTN80, RTN82, RTN87	-	•	VKHB 2031	32219 J2	VKS 6127	9)
•			•	VKHB 2031	32219 J2	-	

N 12 (6x2)

•	Trailing axle	-	•	VKHB 2040	594/592 A/Q	VKS 6115	108)
•			•	VKHB 2041	580/572/Q	-	
•	Trailing axle	-	•	VKHB 2042	683/672	VKS 6135	109)
•			•	VKHB 2043	663/653/Q	-	
•	Trailing axle	-	•	VKHB 2042	683/672	VKS 6135	110)
•			•	VKHB 2043	663/653/Q	-	
•	Trailing axle	-	•	VKHB 2042	683/672	VKS 6135	111)
•			•	VKHB 2043	663/653/Q	-	
•	Trailing axle	-	•	VKHB 2042	683/672	VKS 6135	112)
•			•	VKHB 2052	749 A/Q/742/Q	-	

NH 12 (Ch.668771-)

•		VKBA 5285	•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6134	46), 89)
•			•	VKHB 2036	39580/W/2/39520/2/Q	-	
•	CTN372, RAN471	-	•	VKHB 2053	BT1B 639417/Q	VKS 6179	
•			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	-	

NL 12 S

•	FAT 6.5,-6.7	VKBA 5124	•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6134	11)
•			•	VKHB 2036	39580/W/2/39520/2/Q	-	
•	FAT 7.5,-8.0	VKBA 5124	•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6134	113)
•			•	VKHB 2036	39580/W/2/39520/2/Q	-	

NL 12 S (4x2, 6x2, 6x4)

•		VKBA 5101	•	VKHB 2042	683/672	VKS 6135	69)
•			•	VKHB 2043	663/653/Q	VKS 6298	
•		-	•	VKHB 2042	683/672	VKS 6135	70)
•			•	VKHB 2052	749 A/Q/742/Q	VKS 6298	
•		VKBA 5101	•	VKHB 2042	683/672	VKS 6135	11)
•			•	VKHB 2043	663/653/Q	VKS 6298	
•	RTN371, RTN372, RAN471	VKBA 5125	•	VKHB 2053	BT1B 639417/Q	VKS 6132	9)
•			•	VKHB 2029	HM 218248/W/2A/210/2A/Q	VKS 6179	
•	Trailing axle	-	•	VKHB 2042	683/672	VKS 6135	11)
•			•	VKHB 2043	663/653/Q	-	
•	Trailing axle	-	•	VKHB 2042	683/672	VKS 6135	46)
•			•	VKHB 2043	663/653/Q	-	
•	Trailing axle	-	•	VKHB 2042	683/672	VKS 6135	89)
•			•	VKHB 2052	749 A/Q/742/Q	-	



F 16 (4x2, 6x2, 6x4)	• •		VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	101)
	• •	FAT 6.5,-7.5 8.0	VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	
F 16 (4x2, 6x2)	○ ○		VKBA 5239	•	VKHB 2042 VKHB 2052	683/672 749 A/Q/742/Q	VKS 6135 VKS 6271	70)
F 16 (4x2, 6x2, 6x4)	○ ○		VKBA 5238	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6271	69)
	○ ○		VKBA 5238	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6271	94)
	○ ○	RTN371, RTN372, RAN471	VKBA 5125	•	VKHB 2053 VKHB 2029	BT1B 639417/Q HM 218248/W/2A/210/2A/Q	VKS 6132 VKS 6179	10)
F 16 (6x4)	○ ○		VKBA 5101	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	69)
	○ ○		-	•	VKHB 2042 VKHB 2052	683/672 749 A/Q/742/Q	VKS 6135 VKS 6298	70)
	○ ○		VKBA 5101	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	94)
	○ ○	Trailing axle	-	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	114)
	○ ○	Trailing axle	-	•	VKHB 2042 VKHB 2052	683/672 749 A/Q/742/Q	VKS 6135 -	115)
	○ ○	Trailing axle	VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	116)
	○ ○	Trailing axle	-	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 -	57)
	○ ○	Trailing axle	VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	58)
FH 16	• •		VKBA 5285	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	101)
	• •		VKBA 5285	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	11)
	• •		VKBA 5285	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	40)
FH 16 (4x2, 6x2, 6x4, 8x4)	○ ○		VKBA 5101	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	155)
FH 16 (4x2, 6x2, 6x4) CHID.-A291151	○ ○		VKBA 5273	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	102
FH 16 (4x2, 6x2, 6x4)	○ ○	CTN372	VKBA 5287	•	VKHB 2053 VKHB 2029	BT1B 639417/Q HM 218248/W/2A/210/2A/Q	VKS 6132 VKS 6179	103)
	○ ○	RAN471	VKBA 5287	•	VKHB 2053 VKHB 2029	BT1B 639417/Q HM 218248/W/2A/210/2A/Q	VKS 6132 VKS 6179	9)
FH 16 (4x2, 6x2, 6x4) CHID.-A276505, -B190367, - 563621	○ ○	Trailing axle	VKBA 5285	•	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	104)



FH 16 (CHID.A291152-)	○ ○	Trailing axle	VKBA 5285	• •	VKHB 2024 VKHB 2036	T2ED 070/QCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	104)
FH 16 (4x2, 6x2, 6x4) CHID. -A276505, -B190367, - 563621	○ ○	Trailing axle	VKBA 5273	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	105)
FH 16 CHID. -A291151	○ ○		VKBA 5273	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	104)
FH 16 (4x2, 6x2, 6x4)	○ ○	Trailing axle	VKBA 5273	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	12)
FH 16 (4x2, 6x2, 6x4, 8x4)	○ ○		VKBA 5101	• •	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	11)







## BUSSAR

FIAT-IVECO .....	228–229
KÄSSBOHRER / SETRA .....	230
MAN .....	231–232
MERCEDES-BENZ .....	233–237
MERCEDES-BENZ "Baumuster" .....	238–241
RENAULT - R V I .....	242–244
SCANIA .....	245–249
VOLVO .....	250–251





315.8-13, 315.8-17 Turbo, 315S.8-18, 316.8-13	• •	○ ○	-	• •	VKHB 2201 VKHB 2063	30309 J2/Q 32307 J2/Q	VKS 6321 -
		○ ○	-	• •	VKHB 2282 VKHB 2284	32015 X/Q 32214 J2/Q	VKS 6320 -
370SE-27 Eurotech, 370SE-29 Eurotech, 370SE-35 Eurotech	• •	○ ○	VKBA 5188	• •	VKHB 2013 VKHB 2303	6386/K-6320/Q 32310 TN9	VKS 6215 -
		○ ○	VKBA 5326	• •	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6324 -
370S.10-24, 370S.12-24, 370S.12-25L, 370S.12-30, 370S.12-35	• •	○ ○	VKBA 5188	• •	VKHB 2013 VKHB 2303	6386/K-6320/Q 32310 TN9	VKS 6215 -
		○ ○	VKBA 5327	• •	VKHB 2212 VKHB 2211	32221 J2 R 32217 J2/QVB128/L 32217/Q	VKS 6322 VKS 6225
370.10-24, 370.10-25, 370.12-24, 370.12-25, 370.12-25L, 370.12-30, 370.12-35	• •	○ ○	VKBA 5188	• •	VKHB 2013 VKHB 2303	6386/K-6320/Q 32310 TN9	VKS 6215 -
		○ ○	-	• •	VKHB 2031 VKHB 2080	32219 J2 32217 J2/Q	VKS 6212 VKS 6223
380.10-29 Euroclass, 380.12-29 Euroclass, 378.12-35 Euroclass, 380.12-38 Euroclass HD	• •	○ ○	VKBA 5322	• •	VKHB 2013 VKHB 2303	6386/K-6320/Q 32310 TN9	VKS 6323 -
		○ ○	VKBA 5326	• •	VKHB 2210 VKHB 2211	32219 J2/VB129 R 32217 J2/QVB128/L 32217/Q	VKS 6324 -
470.10-20, 470.12-20	• •	○ ○	VKBA 5324	• •	VKHB 2283 VKHB 2004	30312 J2/Q 32309 J2/Q	VKS 6319 -
		○ ○	VKBA 5330	• •	VKHB 2162 VKHB 2225	33021/Q 33217/Q	VKS 6318 VKS 6332
471.10-20 U-Effeuno, 471.12-20 U-Effeuno	• •	○ ○	VKBA 5324	• •	VKHB 2283 VKHB 2004	30312 J2/Q 32309 J2/Q	VKS 6319 -
		○ ○	VKBA 5329	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 VKS 6225
480.10-21 Turbocity-U, 480.12-21 Turbocity-U, 480E.10-22 Turbocity-U, 480E.12-22 Turbocity-U, 480E.12-26 Turbocity-U	• •	○ ○	VKBA 5323	• •	VKHB 2286 VKHB 2303	HM 212049/HM 212010 32310 TN9	VKS 6215 -
		○ ○	VKBA 5329	• •	VKHB 2215 VKHB 2216	30221 J2 32024 X	VKS 6322 VKS 6225
490.10-22 Turbocity-UR, 490.12-22 Turbocity-UR, 490E.10-22 Turbocity-UR, 490E.12-22 Turbocity-UR	• •	○ ○	VKBA 5323	• •	VKHB 2286 VKHB 2303	HM 212049/HM 212010 32310 TN9	VKS 6215 -
		○ ○	VKBA 5328	• •	VKHB 2285 VKHB 2285	HM 220149/Q/220110/Q HM 220149/Q/220110/Q	VKS 6180 VKS 6325
490.18.29	• •	○ ○	VKBA 5323	• •	VKHB 2286 VKHB 2303	HM 212049/HM 212010 32310 TN9	VKS 6215 -
		○ ○	-	• •	- -	- -	- -
570.10-20, 570.12-20	• •	○ ○	VKBA 5324	• •	VKHB 2283 VKHB 2004	30312 J2/Q 32309 J2/Q	VKS 6319 -
		○ ○	VKBA 5330	• •	VKHB 2162 VKHB 2225	33021/Q 33217/Q	VKS 6318 VKS 6332



571.10-20 S-Effeuno,  
571.12-20 S-Effeuno

•  
•

○  
○

VKBA 5324

•  
•

VKHB 2283  
VKHB 2004

30312 J2/Q  
32309 J2/Q

VKS 6319  
-

VKBA 5329

•  
•

VKHB 2215  
VKHB 2216

30221 J2  
32024 X

VKS 6322  
VKS 6225

580.10-21 Turbocity-S,  
580.12-21 Turbocity-S,  
580E.12-22 Turbocity-S

•  
•

○  
○

VKBA 5323

•  
•

VKHB 2286  
VKHB 2303

HM 212049/HM 212010  
32310 TN9

VKS 6215  
-

VKBA 5329

•  
•

VKHB 2215  
VKHB 2216

30221 J2  
32024 X

VKS 6322  
VKS 6225

590E.12-22 Turbocity-SR

•  
•

○  
○

VKBA 5323

•  
•

VKHB 2286  
VKHB 2303

HM 212049/HM 212010  
32310 TN9

VKS 6215  
-

VKBA 5328

•  
•

VKHB 2285  
VKHB 2285

HM 220149/Q/220110/Q  
HM 220149/Q/220110/Q

VKS 6180  
VKS 6325

670.12-20

•  
•

○  
○

VKBA 5324

•  
•

VKHB 2283  
VKHB 2004

30312 J2/Q  
32309 J2/Q

VKS 6319  
-

VKBA 5330

•  
•

VKHB 2162  
VKHB 2225

33021/Q  
33217/Q

VKS 6318  
VKS 6332

671.22-24 I-Effeuno

•  
•

○  
○

VKBA 5324

•  
•

VKHB 2283  
VKHB 2004

30312 J2/Q  
32309 J2/Q

VKS 6319  
-

VKBA 5329

•  
•

VKHB 2215  
VKHB 2216

30221 J2  
32024 X

VKS 6322  
VKS 6225

680.12-26 Turbocity-I,  
2480.12, 3480.18-29  
Turbocity-U, 4480-18

•  
•

○  
○

VKBA 5323

•  
•

VKHB 2286  
VKHB 2303

HM 212049/HM 212010  
32310 TN9

VKS 6215  
-

VKBA 5329

•  
•

VKHB 2215  
VKHB 2216

30221 J2  
32024 X

VKS 6322  
VKS 6225

# KÄSSBOHRER / SETRA



S 309 HD	• •		VKBA 5304	• •	VKHB 2071 VKHB 2004	332330 B/Q 32309 J2/Q	VKS 6259 VKS 6263
S 312 HD	• •		VKBA 5304	• •	VKHB 2071 VKHB 2004	332330 B/Q 32309 J2/Q	VKS 6259 VKS 6263
S 315 HD	• •		VKBA 5304	• •	VKHB 2071 VKHB 2004	332330 B/Q 32309 J2/Q	VKS 6259 VKS 6263
S 312 HD	○ ○	ZF	VKBA 5303	• •	VKHB 2281 VKHB 2160	32022 X/Q 32021 X/Q	VKS 6258 -
S 315 HD	○ ○ ○ ○	ZF  Scania	VKBA 5303  VKBA 5303	• • • •	VKHB 2281 VKHB 2160  VKHB 2281 VKHB 2160	32022 X/Q 32021 X/Q  32022 X/Q 32021 X/Q	VKS 6258 -  VKS 6258 -



292 (Type 880)	•		V7-75 SL	VKBA 5162	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6182 -	
	•		V7-70 SL	VKBA 5155	•	VKHB 2132 VKHB 2068	331933/Q 33210/Q	VKS 6182 -	
	○	○	H07-1080	VKBA 5153	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	
	○	○	H09-1180	VKBA 5153	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	
292/332/362H (Type 882)	•		V7-70 SL	VKBA 5155	•	VKHB 2132 VKHB 2068	331933/Q 33210/Q	VKS 6182 -	
	•		V7-75 SL	VKBA 5162	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6182 -	
	○	○	H07-1080	VKBA 5153	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	
	○	○	H09-1180	VKBA 5153	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	
EL 202, (Type A12)	•		V9-65 L	VKBA 5162	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6182 -	
	○	○	HONL-1180	VKBA 5300	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6183 VKS 6181	1)
	○	○	HONL-1180	VKBA 5302	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6334 -	2)
NL 202 F, (Type 898)	•		V9-65 L	VKBA 5162	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6182 -	
	○	○	HONL- 1180	VKBA 5153	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	
NL 202, (Type 895)	•		V9-65 L	VKBA 5162	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6182 -	
	○	○	HOLN- 1180	VKBA 5153	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	
NM-152, MIDI-BUS, (Type A05)	•		V9-65 L	VKBA 5162	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6182 -	
	○	○	HONM-0780	VKBA 5301	•	VKHB 2172 VKHB 2082	331974 A/Q 33019/Q	VKS 6197 VKS 6194	
SG 242/292, 322, (Type 793)	•		V7-75 SL	VKBA 5162	•	VKHB 2132 VKHB 2070	331933/Q 32310 J2/Q	VKS 6182 -	
SG 242/282H (Type 795)	•		V7-70 SL	VKBA 5155	•	VKHB 2132 VKHB 2068	331933/Q 33210/Q	VKS 6182 -	
	•		HN7-70 SL	VKBA 5155	•	VKHB 2132 VKHB 2068	331933/Q 33210/Q	VKS 6182 -	
	○	○	H07-1080	VKBA 5153	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	
SG 242/292, 322 (Type 793)	○	○	H07-11120	VKBA 5300	•	VKHB 2146 VKHB 2161	33021/QVB091 32019 X/Q	VKS 6183 VKS 6181	1)



SG 242/292, 322, (Type 793)

•

V7-70 SL

VKBA 5162

•

VKHB 2132  
VKHB 2070

331933/Q  
32310 J2/Q

VKS 6182  
-

13)

•

V7-70 SL

VKBA 5155

•

VKHB 2132  
VKHB 2068

331933/Q  
33210/Q

VKS 6182  
-

12)

○

HOM7-1100

VKBA 5302

•

VKHB 2146  
VKHB 2161

33021/QVB091  
32019 X/Q

VKS 6334  
-

2)

○

HOM7-1100

VKBA 5300

•

VKHB 2146  
VKHB 2161

33021/QVB091  
32019 X/Q

VKS 6183  
VKS 6181

1)

○

H07-11120

VKBA 5302

•

VKHB 2146  
VKHB 2161

33021/QVB091  
32019 X/Q

VKS 6334  
-

2)

○

H07-1080

VKBA 5300

•

VKHB 2146  
VKHB 2161

33021/QVB091  
32019 X/Q

VKS 6183  
VKS 6181

○

H07-10/11120

VKBA 5300

•

VKHB 2146  
VKHB 2161

33021/QVB091  
32019 X/Q

VKS 6183  
VKS 6181

SL 200, (Type 192)

•

V7-70 SL

VKBA 5155

•

VKHB 2132  
VKHB 2068

331933/Q  
33210/Q

VKS 6182  
-

○

H07-1080

VKBA 5153

•

VKHB 2162  
VKHB 2161

33021/Q  
32019 X/Q

VKS 6183  
VKS 6181

SL 202, (Type 791)

•

V7-70 SL

VKBA 5162

•

VKHB 2132  
VKHB 2070

331933/Q  
32310 J2/Q

VKS 6182  
-

13)

•

V7-75 SL

VKBA 5162

•

VKHB 2132  
VKHB 2070

331933/Q  
32310 J2/Q

VKS 6182  
-

•

V7-70 SL

VKBA 5155

•

VKHB 2132  
VKHB 2068

331933/Q  
33210/Q

VKS 6182  
-

12)

○

H07-1080

VKBA 5153

•

VKHB 2162  
VKHB 2161

33021/Q  
32019 X/Q

VKS 6183  
VKS 6181

○

H09-1180

VKBA 5153

•

VKHB 2162  
VKHB 2161

33021/Q  
32019 X/Q

VKS 6183  
VKS 6181

SUE 240/280, (Type 789)

•

V7-70 SL

VKBA 5155

•

VKHB 2132  
VKHB 2068

331933/Q  
33210/Q

VKS 6182  
-

○

H07-1080

VKBA 5153

•

VKHB 2162  
VKHB 2161

33021/Q  
32019 X/Q

VKS 6183  
VKS 6181

SUE 242, (Type 888)

•

V7-75 SL

VKBA 5162

•

VKHB 2132  
VKHB 2070

331933/Q  
32310 J2/Q

VKS 6182  
-

•

V7-70 SL

VKBA 5155

•

VKHB 2132  
VKHB 2068

331933/Q  
33210/Q

VKS 6182  
-

○

H09-1180

VKBA 5153

•

VKHB 2162  
VKHB 2161

33021/Q  
32019 X/Q

VKS 6183  
VKS 6181

○

H07-1080

VKBA 5153

•

VKHB 2162  
VKHB 2161

33021/Q  
32019 X/Q

VKS 6183  
VKS 6181



0 301	•	VL 1/3-2,1	VKBA 5024	•	VKHB 2054	2789/2720/QCL7C	VKS 6152	4)
	•			•	VKHB 2055	1380/Q/1328/Q	-	
	•	VL 1/3-2,1	VKBA 5025	•	VKHB 2056	33109/Q	VKS 6299	5)
	•			•	VKHB 2057	33205/QVQ077	-	
	•	VL 1/4-1,6	VKBA 5023	•	VKHB 2058	32304 J2/Q	VKS 6149	6)
	•			•	VKHB 2018	32207 J2/Q	-	
	•	VL 1/4-1,6	VKBA 5024	•	VKHB 2054	2789/2720/QCL7C	VKS 6152	7)
	•			•	VKHB 2055	1380/Q/1328/Q	-	
	•	VL 1/4-1,6	VKBA 5025	•	VKHB 2056	33109/Q	VKS 6299	8)
	•			•	VKHB 2057	33205/QVQ077	-	
0 303	•	VL 1/5-2,3, VL 1/6-2,3, VL 1/7-2,6	VKBA 5025	•	VKHB 2056	33109/Q	VKS 6299	
	•			•	VKHB 2057	33205/QVQ077	-	
	•	VL 2/11 D-3,8	VKBA 5029	•	VKHB 2061	33211/Q	VKS 6148	
	•			•	VKHB 2064	529656	-	
	•	VO 3/9 DL-5	VKBA 5032	•	VKHB 2051	33213/Q	VKS 6157	
	•			•	VKHB 2065	33208/Q	-	
	•	HL 1/2-3,3	VKBA 5041	•	VKHB 2019	32211 J2/Q	VKS 6143	9)
	•			•	VKHB 2017	32210 J2/Q	-	
	•	HL 1/3-4,5, HL 2/5-4,5, HL 2/9-4,7	VKBA 5043	•	VKHB 2074	3984/3920	VKS 6147	
	•			•	VKHB 2075	33822/Q/33895/Q	-	
0 303	•	VL 1/3-2,1	VKBA 5024	•	VKHB 2054	2789/2720/QCL7C	VKS 6152	4)
	•			•	VKHB 2055	1380/Q/1328/Q	-	
	•	VL 1/3-2,1	VKBA 5025	•	VKHB 2056	33109/Q	VKS 6299	5)
	•			•	VKHB 2057	33205/QVQ077	-	
	•	VL 1/4-1,6	VKBA 5023	•	VKHB 2058	32304 J2/Q	VKS 6149	6)
	•			•	VKHB 2018	32207 J2/Q	-	
	•	VL 1/4-1,6	VKBA 5024	•	VKHB 2054	2789/2720/QCL7C	VKS 6152	7)
	•			•	VKHB 2055	1380/Q/1328/Q	-	
	•	VL 1/4-1,6	VKBA 5025	•	VKHB 2056	33109/Q	VKS 6299	8)
	•			•	VKHB 2057	33205/QVQ077	-	
	•	VL 1/5-2,3, VL 1/6-2,3, VL 1/7-2,6	VKBA 5025	•	VKHB 2056	33109/Q	VKS 6299	
	•			•	VKHB 2057	33205/QVQ077	-	
	•	VL 2/11 D-3,8	VKBA 5029	•	VKHB 2061	33211/Q	VKS 6148	
	•			•	VKHB 2064	529656	-	
	•	VO 3/9 DL-5	VKBA 5032	•	VKHB 2051	33213/Q	VKS 6157	
•			•	VKHB 2065	33208/Q	-		
•	VO 3/10 DL-6	VKBA 5033	•	VKHB 2066	33214/Q	VKS 6175	19)	
•			•	VKHB 2067	33209/Q	-		
•	VO 3/10 DL-6	VKBA 5034	•	VKHB 2066	33214/Q	VKS 6175	20)	
•			•	VKHB 2068	33210/Q	-		
•	VO 3/9 DL-5, VO 3/9 L-5	VKBA 5032	•	VKHB 2051	33213/Q	VKS 6157		
•			•	VKHB 2065	33208/Q	-		
•	VO 4/13 DL-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	21)	
•			•	VKHB 2068	33210/Q	VKS 6146		

# MERCEDES-BENZ



O 303 .../...	•	VO 4/13 DL-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	22)	
	•	○	HL 1/2-3,3	VKBA 5041	•	VKHB 2019 VKHB 2017	32211 J2/Q 32210 J2/Q	VKS 6143 -	9)
	•	○	HL 1/3-4,5, HL 2/5-4,5, HL 2/9-4,7	VKBA 5043	•	VKHB 2074 VKHB 2075	3984/3920 33822/Q/33895/Q	VKS 6147 -	
	•	○	HO 4/01 DL-10	VKBA 5056	•	VKHB 2124 VKHB 2158	33020/Q 33117/Q	VKS 6176 -	
	•	○	HO 4/10 L-10, HO 4/10 DL-10, HO 5/8 L-10, HO 5/8 DL-10	VKBA 5052	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	
	•	○	HO 4/18 L-7,7, HO 4/18 DL-7,7	VKBA 5295	•	VKHB 2026 VKHB 2079	32216 J2/Q 330356 A/Q	VKS 6255 -	
O 305	•	VO 4/11 DL-7	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	21)	
	•	VO 4/11 DL-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	22)	
	•	○	HO 7/8 DL-10, NR 7/4 DL-10, NR 7/5 DL-10	VKBA 5296	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	
O 307	•	VO 4/11 DL-7	VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	21)	
	•	VO 4/11 DL-7	VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	22)	
	•	○	HO 7/8 DL-10	VKBA 5296	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	
O 309, 309 D	•	VL 1/3-2,1	VKBA 5024	•	VKHB 2054 VKHB 2055	2789/2720/QCL7C 1380/Q/1328/Q	VKS 6152 -	4)	
	•	VL 1/3-2,1	VKBA 5025	•	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	5)	
	•	VL 1/4-1,6	VKBA 5023	•	VKHB 2058 VKHB 2018	32304 J2/Q 32207 J2/Q	VKS 6149 -	6)	
	•	VL 1/4-1,6	VKBA 5024	•	VKHB 2054 VKHB 2055	2789/2720/QCL7C 1380/Q/1328/Q	VKS 6152 -	7)	
	•	VL 1/4-1,6	VKBA 5025	•	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	8)	
	•	VL 1/5-2,3, VL 1/6-2,3, VL 1/7-2,6	VKBA 5025	•	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -		
	•	VL 2/11 D-3,8	VKBA 5029	•	VKHB 2061 VKHB 2064	33211/Q 529656	VKS 6148 -		
	•	VO 3/9 DL-5	VKBA 5032	•	VKHB 2051 VKHB 2065	33213/Q 33208/Q	VKS 6157 -		



		<ul style="list-style-type: none"> <li>○ HL 1/2-3,3</li> </ul>	VKBA 5041	<ul style="list-style-type: none"> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2019</li> <li>• VKHB 2017</li> </ul>	32211 J2/Q 32210 J2/Q	VKS 6143 -	9)
		<ul style="list-style-type: none"> <li>○ HL 1/3-4,5,</li> <li>○ HL 2/5-4,5,</li> <li>○ HL 2/9-4,7</li> </ul>	VKBA 5043	<ul style="list-style-type: none"> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2074</li> <li>• VKHB 2075</li> </ul>	3984/3920 33822/Q/33895/Q	VKS 6147 -	
0 402	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VL 2/11 D-3,8	VKBA 5029	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2061</li> <li>• VKHB 2064</li> </ul>	33211/Q 529656	VKS 6148 -	
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VO 4/18 DL-7, VO 4/22 DLE-6,6	VKBA 5038	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2071</li> <li>• VKHB 2070</li> </ul>	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
0 404	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VL 2/11 D-3,8	VKBA 5029	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2061</li> <li>• VKHB 2064</li> </ul>	33211/Q 529656	VKS 6148 -	
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VO 4/21 CLE-6.6	VKBA 5298	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2280</li> <li>• VKHB 2068</li> </ul>	BT1-0084/Q 33210/Q	VKS 6150 VKS 6315	21)
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VO 4/21 CLE-6.6	VKBA 5299	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2280</li> <li>• VKHB 2070</li> </ul>	BT1-0084/Q 32310 J2/Q	VKS 6150 VKS 6315	22)
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VO 4/22 DLE-6.6	VKBA 5037	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2071</li> <li>• VKHB 2068</li> </ul>	332330 B/Q 33210/Q	VKS 6158 VKS 6146	21)
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VO 4/22 DLE-6.6	VKBA 5038	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2071</li> <li>• VKHB 2070</li> </ul>	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	22)
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VO 4/35 CLE-7.5	VKBA 5298	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2280</li> <li>• VKHB 2068</li> </ul>	BT1-0084/Q 33210/Q	VKS 6150 VKS 6315	21)
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VO 4/35 CLE-7.5	VKBA 5299	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2280</li> <li>• VKHB 2070</li> </ul>	BT1-0084/Q 32310 J2/Q	VKS 6150 VKS 6315	22)
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HO 4/01 DL-11.5	VKBA 5056	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2124</li> <li>• VKHB 2158</li> </ul>	33020/Q 33117/Q	VKS 6176 -	
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HO 4/02 CL-11.5, HO 4/04 DCL-11,5	VKBA 5297	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2124</li> <li>• VKHB 2158</li> </ul>	33020/Q 33117/Q	VKS 6257 -	
0 405	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VL 2/11 D-3,8	VKBA 5029	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2061</li> <li>• VKHB 2064</li> </ul>	33211/Q 529656	VKS 6148 -	
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VO 4/22 DLE-6,6	VKBA 5038	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2071</li> <li>• VKHB 2070</li> </ul>	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VO 4/18 DL-7, VO 4/33 DL-6,6, VO 4/34 DL-7	VKBA 5037	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2071</li> <li>• VKHB 2068</li> </ul>	332330 B/Q 33210/Q	VKS 6158 VKS 6146	21)
	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	VO 4/18 DL-7, VO 4/33 DL-6,6, VO 4/34 DL-7	VKBA 5038	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2071</li> <li>• VKHB 2070</li> </ul>	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	22)
	<ul style="list-style-type: none"> <li>○</li> <li>○</li> </ul>	HO 7/02 DLM-10, HO 7/9 DL-10, HO 7/10 DL-11.5, NR 7/4 DL-10, NR 7/5 DL-10	VKBA 5296	<ul style="list-style-type: none"> <li>•</li> <li>•</li> </ul>	<ul style="list-style-type: none"> <li>• VKHB 2162</li> <li>• VKHB 2161</li> </ul>	33021/Q 32019 X/Q	VKS 6183 VKS 6181	



# MERCEDES-BENZ



O 407	•	VL 2/11 D-3,8	VKBA 5029	•	VKHB 2061	33211/Q	VKS 6148	
	•			•	VKHB 2064	529656	-	
	•	VO 4/18 DL-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	21)
	•			•	VKHB 2068	33210/Q	VKS 6146	
	•	VO 4/18 DL-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	22)
•			•	VKHB 2070	32310 J2/Q	VKS 6146		
•	VO 4/22 DLE-6,6	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158		
•			•	VKHB 2070	32310 J2/Q	VKS 6146		
○	HO 7/02 DLM-10,	VKBA 5296	•	VKHB 2162	33021/Q	VKS 6183		
○	HO 7/9 DL-10,		•	VKHB 2161	32019 X/Q	VKS 6181		
		HO 7/10 DL-11.5						
O 408	•	VL 2/11 D-3,8	VKBA 5029	•	VKHB 2061	33211/Q	VKS 6148	
	•			•	VKHB 2064	529656	-	
	•	VO 4/18 DL-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	21)
	•			•	VKHB 2068	33210/Q	VKS 6146	
	•	VO 4/18 DL-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	22)
•			•	VKHB 2070	32310 J2/Q	VKS 6146		
•	VO 4/22 DLE-6,6	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158		
•			•	VKHB 2070	32310 J2/Q	VKS 6146		
○	HO 7/02 DLM-10,	VKBA 5296	•	VKHB 2162	33021/Q	VKS 6183		
○	HO 7/9 DL-10,		•	VKHB 2161	32019 X/Q	VKS 6181		
		HO 7/10 DL-11.5						
O 608 D, 609 D, 611 D, 614 D	•	VL 1/10 C-2,5,	VKBA 5025	•	VKHB 2056	33109/Q	VKS 6299	
	•	VL 1/9 C-2,3		•	VKHB 2057	33205/QVQ077	-	
	○	HL 1/8-4,7	VKBA 5047	•	VKHB 2154	32014 X/Q	VKS 6173	
	○			•	VKHB 2060	32011 X/Q	-	
	○	HL 1/9-5,6,	VKBA 5048	•	VKHB 2155	331293/Q	VKS 6172	
○	HL 2/15-5,8		•	VKHB 2156	33011/Q	-		
○	HL 2/5-4,5	VKBA 5043	•	VKHB 2074	3984/3920	VKS 6147		
○			•	VKHB 2075	33822/Q/33895/Q	-		
O 814, 817	•	VL 2/10 D-3,5	VKBA 5028	•	VKHB 2061	33211/Q	VKS 6148	
	•			•	VKHB 2007	32306 J2/Q	-	
	•	VL 2/9 D-3,1	VKBA 5026	•	VKHB 2059	33111/Q	VKS 6159	
	•			•	VKHB 2007	32306 J2/Q	-	
	○	HL 2/11 D-5,8	VKBA 5048	•	VKHB 2155	331293/Q	VKS 6172	
	○			•	VKHB 2156	33011/Q	-	
○	HL 2/13 D-6,4	VKBA 5233	•	VKHB 2137	JM 714249/210/Q	VKS 6174		
○			•	VKHB 2233	33112/QVB259	-		
○	HL 4/30 DS-6,4,	-	•	VKHB 2157	32016 X/Q	VKS 6175		
○	HL 4/30 D-6,4,		•	VKHB 2159	33113/QVB022	-		
		HL 4/35 D-6,4						



O 1114, 1117, 1120	•		VL 2/11 D-3,8	VKBA 5029	•	VKHB 2061	33211/Q	VKS 6148	
	•				•	VKHB 2064	529656	-	
		○	HL 4/28 D-7,8	VKBA 5046	•	VKHB 2041	580/572/Q	VKS 6178	
		○			•	VKHB 2079	330356 A/Q	-	
		○	HL 4/29 D-9,2	-	•	VKHB 2158	33117/Q	VKS 6178	
		○			•	VKHB 2081	331074/Q	-	
O 1317		○	HL 5/1 Z-10	-	•	VKHB 2083	CK-598 A/K-592 A	VKS 6145	
		○			•	VKHB 2033	32215 J2/Q	-	
O 1417		○	HH 4/04 D-12	VKBA 5056	•	VKHB 2124	33020/Q	VKS 6176	
		○			•	VKHB 2158	33117/Q	-	
O 1617, 1625, 1628	•		VL 4/2 D-7	-	•	-	-	VKS 6160	
	•				•	VKHB 2070	32310 J2/Q	-	
	•		VO 4/18 DL-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	
	•				•	VKHB 2070	32310 J2/Q	VKS 6146	
OH 1622, OH 1625, OH 1627, OH 1628, OH 1634	•		VO 4/18 DL-7	VKBA 5037	•	VKHB 2071	332330 B/Q	VKS 6158	21)
	•				•	VKHB 2068	33210/Q	VKS 6146	
	•		VL 4/10 D-7, VO 4/18 DL-7	VKBA 5038	•	VKHB 2071	332330 B/Q	VKS 6158	22)
		○			•	VKHB 2070	32310 J2/Q	VKS 6146	
		○	HO 4/01 DL-10	VKBA 5056	•	VKHB 2124	33020/Q	VKS 6176	
		○			•	VKHB 2158	33117/Q	-	

# MERCEDES-BENZ "Baumuster"



730.013-014			VKBA 5032	• •	VKHB 2051 VKHB 2065	33213/Q 33208/Q	VKS 6157 -	
730.015			VKBA 5033	• •	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	19)
			VKBA 5034	• •	VKHB 2066 VKHB 2068	33214/Q 33210/Q	VKS 6175 -	20)
730.035			VKBA 5032	• •	VKHB 2051 VKHB 2065	33213/Q 33208/Q	VKS 6157 -	
730.042			VKBA 5033	• •	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	19)
730.047			VKBA 5032	• •	VKHB 2051 VKHB 2065	33213/Q 33208/Q	VKS 6157 -	
			VKBA 5034	• •	VKHB 2066 VKHB 2068	33214/Q 33210/Q	VKS 6175 -	20)
730.049			VKBA 5033	• •	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	19)
			VKBA 5034	• •	VKHB 2066 VKHB 2068	33214/Q 33210/Q	VKS 6175 -	20)
730.053			VKBA 5032	• •	VKHB 2051 VKHB 2065	33213/Q 33208/Q	VKS 6157 -	
730.054			VKBA 5033	• •	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	19)
			VKBA 5034	• •	VKHB 2066 VKHB 2068	33214/Q 33210/Q	VKS 6175 -	20)
730.060-062			VKBA 5032	• •	VKHB 2051 VKHB 2065	33213/Q 33208/Q	VKS 6157 -	
730.502			VKBA 5023	• •	VKHB 2058 VKHB 2018	32304 J2/Q 32207 J2/Q	VKS 6149 -	6)
			VKBA 5024	• •	VKHB 2054 VKHB 2055	2789/2720/QCL7C 1380/Q/1328/Q	VKS 6152 -	7)
			VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	8)
730.503-.504			VKBA 5024	• •	VKHB 2054 VKHB 2055	2789/2720/QCL7C 1380/Q/1328/Q	VKS 6152 -	4)
			VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	5)
730.505			VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	
730.506			VKBA 5024	• •	VKHB 2054 VKHB 2055	2789/2720/QCL7C 1380/Q/1328/Q	VKS 6152 -	4)
			VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	5)
730.533			VKBA 5025	• •	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	



730.534			VKBA 5024	•	VKHB 2054 VKHB 2055	2789/2720/QCL7C 1380/Q/1328/Q	VKS 6152 -	4)
			VKBA 5025	•	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	5)
730.600, 730.602. -603, 730.630			VKBA 5025	•	VKHB 2056 VKHB 2057	33109/Q 33205/QVQ077	VKS 6299 -	
730.732			VKBA 5026	•	VKHB 2059 VKHB 2007	33111/Q 32306 J2/Q	VKS 6159 -	
730.733			VKBA 5028	•	VKHB 2061 VKHB 2007	33211/Q 32306 J2/Q	VKS 6148 -	
730.830-832			VKBA 5029	•	VKHB 2061 VKHB 2064	33211/Q 529656	VKS 6148 -	
739.003			-	•	- VKHB 2070	- 32310 J2/Q	VKS 6160 -	
739.133, 739.176			VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	22)
739.200-201, 739.203-204, 739.207, 739.209, 211			VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	21)
			VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	22)
739.230-233			VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	21)
			VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	22)
739.234			VKBA 5298	•	VKHB 2280 VKHB 2068	BT1-0084/Q 33210/Q	VKS 6150 VKS 6315	21)
			VKBA 5299	•	VKHB 2280 VKHB 2070	BT1-0084/Q 32310 J2/Q	VKS 6150 VKS 6315	22)
739.235-236			VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	21)
			VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	22)
739.238			VKBA 5298	•	VKHB 2280 VKHB 2068	BT1-0084/Q 33210/Q	VKS 6150 VKS 6315	21)
			VKBA 5299	•	VKHB 2280 VKHB 2070	BT1-0084/Q 32310 J2/Q	VKS 6150 VKS 6315	22)
739.240			VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	21)
			VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	22)
739.241, 739.245			VKBA 5298	•	VKHB 2280 VKHB 2068	BT1-0084/Q 33210/Q	VKS 6150 VKS 6315	21)
			VKBA 5299	•	VKHB 2280 VKHB 2070	BT1-0084/Q 32310 J2/Q	VKS 6150 VKS 6315	22)

# MERCEDES-BENZ "Baumuster"



739.242			VKBA 5037	•	VKHB 2071 VKHB 2068	332330 B/Q 33210/Q	VKS 6158 VKS 6146	21)
			VKBA 5038	•	VKHB 2071 VKHB 2070	332330 B/Q 32310 J2/Q	VKS 6158 VKS 6146	22)
739.245			VKBA 5298	•	VKHB 2280 VKHB 2068	BT1-0084/Q 33210/Q	VKS 6150 VKS 6315	21)
			VKBA 5299	•	VKHB 2280 VKHB 2070	BT1-0084/Q 32310 J2/Q	VKS 6150 VKS 6315	22)
740.200, 740.230-233			VKBA 5296	•	VKHB 2162 VKHB 2161	33021/Q 32019 X/Q	VKS 6183 VKS 6181	
741.001, 741.030-.031			VKBA 5041	•	VKHB 2019 VKHB 2017	32211 J2/Q 32210 J2/Q	VKS 6143 -	9)
741.200, 741.202-.203, 741.301-.304, 741.330-.337			VKBA 5043	•	VKHB 2074 VKHB 2075	3984/3920 33822/Q/33895/Q	VKS 6147 -	
741.560, 741.580			VKBA 5047	•	VKHB 2154 VKHB 2060	32014 X/Q 32011 X/Q	VKS 6173 -	
741.580, 742.420-.421, 742.436, 742.440			VKBA 5048	•	VKHB 2155 VKHB 2156	331293/Q 33011/Q	VKS 6172 -	
742.450			VKBA 5233	•	VKHB 2137 VKHB 2233	JM 714249/210/Q 33112/QVB259	VKS 6174 -	
742.471, 742.481.			VKBA 5048	•	VKHB 2155 VKHB 2156	331293/Q 33011/Q	VKS 6172 -	
744.601-602, 744.604, 744.630-632			VKBA 5295	•	VKHB 2026 VKHB 2079	32216 J2/Q 330356 A/Q	VKS 6255 -	
744.701-702, 744.704. 744.706-707			VKBA 5052	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	
744.731, 744.733-735			VKBA 5052	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	
744.900, 744.904, 744.917-.918			VKBA 5046	•	VKHB 2041 VKHB 2079	580/572/Q 330356 A/Q	VKS 6178 -	
744.920			-	•	VKHB 2158 VKHB 2081	33117/Q 331074/Q	VKS 6178 -	
744.950, 744.958, 744.960			-	•	VKHB 2157 VKHB 2159	32016 X/Q 33113/QVB022	VKS 6175 -	
745.139			-	•	VKHB 2083 VKHB 2033	CK-598 A/K-592 A 32215 J2/Q	VKS 6145 -	
745.200, 745.202, 745.207, 745.230			VKBA 5052	•	VKHB 2082 VKHB 2028	33019/Q 33215/Q	VKS 6154 -	
745.616			VKBA 5056	•	VKHB 2124 VKHB 2158	33020/Q 33117/Q	VKS 6176 -	
745.800-801, 745.807-809, 745.840-849			VKBA 5056	•	VKHB 2124 VKHB 2158	33020/Q 33117/Q	VKS 6176 -	
745.860-864			VKBA 5297	•	VKHB 2124 VKHB 2158	33020/Q 33117/Q	VKS 6257 -	
745.871-872, 745.874-877			VKBA 5056	•	VKHB 2124 VKHB 2158	33020/Q 33117/Q	VKS 6176 -	



745.990, 745.996-997

VKBA 5297

- 
- 

VKHB 2124  
VKHB 2158

33020/Q  
33117/Q

VKS 6257  
-

748.501

VKBA 5296

- 
- 

VKHB 2162  
VKHB 2161

33021/Q  
32019 X/Q

VKS 6183  
VKS 6181

748.512-515, 748.517-524,  
748.526

VKBA 5296

- 
- 

VKHB 2162  
VKHB 2161

33021/Q  
32019 X/Q

VKS 6183  
VKS 6181

749.210-212

VKBA 5296

- 
- 

VKHB 2162  
VKHB 2161

33021/Q  
32019 X/Q

VKS 6183  
VKS 6181

# RENAULT - R V I



AGORA citybus	•		VKBA 5308	•	-	-	-	
	•		VKBA 5305	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6140 -	
ER 100-2	•	RI 6A	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	
	•		VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -	
FRH	•	RI 65 R	VKBA 5310	•	VKHB 2066 VKHB 2236	33214/Q 32309 BJ2/QCL7C	VKS 6303 -	40)
	•	PX 1141	VKBA 5305	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6140 -	40)
FRI	•	RI 65 R	VKBA 5306	•	VKHB 2066 VKHB 2004	33214/Q 32309 J2/Q	VKS 6303 -	38)
	•	RI 65 R	VKBA 5310	•	VKHB 2066 VKHB 2236	33214/Q 32309 BJ2/QCL7C	VKS 6303 -	39)
	•	PX 1141	VKBA 5218	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6201 -	36)
	•	PX 1141	VKBA 5305	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6140 -	37)
G 105, G 105 S	•	E 6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	23)
	•	E 6A	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	24)
	•	P 1321 B	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -	
G 45, G 45 S	•	E 6A	VKBA 5215	•	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	23)
	•	E 6A	VKBA 5216	•	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	24)
	•	P 1321 B	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -	
GX 187	•	RI 6A	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	
	•	PX 1021 PX SAR 1021	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -	
GX 317	•		VKBA 5308	•	-	-	-	
	•		VKBA 5305	•	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6140 -	
MEGABUS	•	RI 6A	VKBA 5220	•	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	
	•	PX 1021 PX SAR 1021	VKBA 5214	•	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -	



PER 180	• •	RI 6A	-	• •	- -	- -	- -	- -
	○ ○	PX 1021 G PX SAR 1021 A	VKBA 5214	• •	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -	
PG 60, PG 60 S	• •	E 6A	VKBA 5215	• •	VKHB 2066 VKHB 2067	33214/Q 33209/Q	VKS 6175 -	23)
	• •	E 6A	VKBA 5216	• •	VKHB 2066 VKHB 2184	33214/Q T2ED 045	VKS 6175 -	24)
	○ ○	P 1321	VKBA 5214	• •	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -	
PGC 191	• •	E 5A	VKBA 5220	• •	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	
	○ ○	P 1021 J	VKBA 5214	• •	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -	
PGC 231	• •	E 5A	VKBA 5220	• •	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	
	○ ○	P 1021 J	VKBA 5214	• •	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -	
PR 10	• •	E 5A	VKBA 5220	• •	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	
	○ ○	PX 821 G	-	• •	- -	- -	VKS 6234 -	
PR 100	• •	RI 6A	VKBA 5312	• •	VKHB 2287 VKHB 2056	JH 211749/JH 211710 33109/Q	VKS 6202 -	44)
	• •	RI 6A	VKBA 5313	• •	VKHB 2287 VKHB 2067	JH 211749/JH 211710 33209/Q	VKS 6202 -	45)
	○ ○	P 1021 X PX 1021 E, G	VKBA 5214	• •	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -	35)
PR 100-2	• •	RI 6A	VKBA 5220	• •	VKHB 2051 VKHB 2067	33213/Q 33209/Q	VKS 6202 -	
	○ ○		VKBA 5214	• •	VKHB 2185 VKHB 2042	52375/52618 683/672	VKS 6201 -	
PR 100-3	• •		VKBA 5308	• •	- -	- -	- -	
	○ ○	PU 04 PS 08	VKBA 5305	• •	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6140 -	
PR 112	• •		VKBA 5308	• •	- -	- -	- -	
	○ ○	PU 04 PS 08	VKBA 5305	• •	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6140 -	
PR 118	• •		VKBA 5308	• •	- -	- -	- -	
	○ ○	PU 04 PS 08	VKBA 5305	• •	VKHB 2192 VKHB 2194	JF 9549/9510 33216/Q	VKS 6140 -	



# RENAULT - R V I



PR 12	•	E 5A	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	
	•			•	VKHB 2067	33209/Q	-	
		○	PX 821 G	-	-	-	VKS 6234	
		○		•	-	-	-	
PR 14	•	E 5A	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	
	•			•	VKHB 2067	33209/Q	-	
		○	P 1021 PX 1021	•	VKHB 2185	52375/52618	VKS 6201	
		○		•	VKHB 2042	683/672	-	
PR 180	•	RI 6A	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	
	•			•	VKHB 2067	33209/Q	-	
	•	RI 6A	VKBA 5313	•	VKHB 2287	JH 211749/JH 211710	VKS 6202	35)
	•			•	VKHB 2067	33209/Q	-	
		○	PX 1021	•	VKHB 2185	52375/52618	VKS 6201	
		○	PX SAR 1021	•	VKHB 2042	683/672	-	
PR 8C	•	E 5A	VKBA 5220	•	VKHB 2051	33213/Q	VKS 6202	41)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A	VKBA 5221	•	VKHB 2051	33213/Q	VKS 6175	42)
	•			•	VKHB 2067	33209/Q	-	
	•	E 5A	VKBA 5315	•	VKHB 2051	33213/Q	VKS 6175	43)
	•			•	VKHB 2068	33210/Q	-	
		○	P 1140	•	VKHB 2161	32019 X/Q	VKS 6201	
		○		•	VKHB 2158	33117/Q	-	
TRACER	•	E 70 XD	VKBA 5316	•	-	BTFB 446329 CB	-	46)
	•			•	-	-	-	
	•	E 70 XD	VKBA 5308	•	-	-	-	47)
	•			•	-	-	-	
		○	P 1140 E	•	VKHB 2192	JF 9549/9510	VKS 6201	
		○		•	VKHB 2158	33117/Q	-	
		○	P 1141 E	•	VKHB 2192	JF 9549/9510	VKS 6201	
		○		•	VKHB 2194	33216/Q	-	



F 82 CL, S 82 CL	•		AM60	VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	10)
	•	○	R642, R 653	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 VKS 6105	10)
K 82	•			VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	
	•	○	R642, R 653, R 750	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 VKS 6105	
	•	○	R642, R 653	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 VKS 6105	10)
S 82 HR	•		AM55	-	•	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6107 -	10)
	•	○	R 653	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 VKS 6105	10)
B 86, BF 86	•		AM55	-	•	- VKHB 2001	- 32308 J2/Q	VKS 6103 -	39)
	•		AM55	-	•	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6107 -	40)
	•		AM60	VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	10)
	•	○	R653	VKBA 5068	•	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	39)
	•	○	R640	-	•	VKHB 2026 VKHB 2033	32216 J2/Q 32215 J2/Q	VKS 6104 -	39)
	•	○	R640	-	•	VKHB 2026 VKHB 2028	32216 J2/Q 33215/Q	VKS 6109 VKS 6110	40)
	•	○							
BR 86	•			-	•	- VKHB 2001	- 32308 J2/Q	VKS 6103 -	41)
	•			-	•	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6107 -	42)
	•			VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	43)
	•			VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	44)
	•	○	R640	-	•	VKHB 2026 VKHB 2033	32216 J2/Q 32215 J2/Q	VKS 6104 -	45)
	•	○	R640	-	•	VKHB 2026 VKHB 2028	32216 J2/Q 33215/Q	VKS 6109 VKS 6110	46)
	•	○	R651	VKBA 5068	•	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	
	•	○	R653	VKBA 5068	•	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	45)
	•	○	R653	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 VKS 6105	46)
	•	○							



K92CL, K92 CR	• •	○ ○	AD90, ADA90	VKBA 5064	• •	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	47)			
				VKBA 5067	• •	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	48)			
K 93 CRB	• • • • •	○ ○	AM56	VKBA 5225	• •	VKHB 2228 VKHB 2004	T2EE 060/Q 32309 J2/Q	VKS 6284 -	49)			
			AM61, AMA61	VKBA 5264	• •	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6242 -	52)			
			AM61, AMA61	VKBA 5226	• •	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6261 -	51)			
			AMA56	VKBA 5263	• •	VKHB 2228 VKHB 2004	T2EE 060/Q 32309 J2/Q	VKS 6241 -	50)			
			AD90, ADA90	VKBA 5067	• •	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	48)			
B 111	• • • •	○ ○ ○ ○ ○ ○ ○ ○	-	-	• •	- VKHB 2001	- 32308 J2/Q	VKS 6103 -	53)			
			-	-	• •	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6107 -	56)			
			R640	-	• •	VKHB 2026 VKHB 2033	32216 J2/Q 32215 J2/Q	VKS 6104 -	53)			
			R640	-	• •	VKHB 2026 VKHB 2028	32216 J2/Q 33215/Q	VKS 6109 VKS 6110	54)			
			R640	VKBA 5075	• •	VKHB 2026 VKHB 2028	32216 J2/Q 33215/Q	VKS 6109 VKS 6110	55)			
			R653	VKBA 5067	• •	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	56)			
			R653	VKBA 5068	• •	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	5)			
			R653	VKBA 5068	• •	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	53)			
			BF 111, BF 111-CKD	• •	○ ○ ○ ○ ○ ○ ○		VKBA 5064	• •	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	10)
						R640	-	• •	VKHB 2026 VKHB 2033	32216 J2/Q 32215 J2/Q	VKS 6104 -	53)
R640	-	• •				VKHB 2026 VKHB 2028	32216 J2/Q 33215/Q	VKS 6109 VKS 6110	54)			
R640	VKBA 5075	• •				VKHB 2026 VKHB 2028	32216 J2/Q 33215/Q	VKS 6109 VKS 6110	55)			
R653	VKBA 5068	• •				VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	53)			
R653	VKBA 5067	• •				VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	56)			
R653	VKBA 5068	• •				VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	5)			



BR 112, N 112	•		VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	57)	
	•		VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	58)	
	•	○	R653	VKBA 5068	•	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	59)
	•	○	R653	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 VKS 6105	60)
	•	○	Trailing axle	VKBA 5069	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 -	
F 112 CL, S 112 CL	•		AM55	-	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6107 -	61)	
	•		AM55	VKBA 5077	•	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6108 -	62)
	•		AM60	VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	10)
	•	○	R642, R 653, R 750	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 VKS 6105	
K 112 CLB	•		VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	48)	
	•	○	R653, R750	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 VKS 6105	48)
N 111 AL	•		VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	63)	
	•	○		VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 VKS 6105	65)
	•	○	R653	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 VKS 6105	64)
N 112 CLB	•		VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	66)	
	•	○	R653, R760	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 VKS 6105	64)
K 113 CLB	•		AM56	VKBA 5263	•	VKHB 2228 VKHB 2004	T2EE 060/Q 32309 J2/Q	VKS 6241 -	68)
	•		AM61, AMA61	VKBA 5226	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6261 -	
	•		AM61, AMA61	VKBA 5264	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6242 -	69)
	•		AMA56	VKBA 5263	•	VKHB 2228 VKHB 2004	T2EE 060/Q 32309 J2/Q	VKS 6241 -	68)
	•		AMA56	VKBA 5225	•	VKHB 2228 VKHB 2004	T2EE 060/Q 32309 J2/Q	VKS 6284 -	67)
	•	○	AD90, ADA90	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/NW/2A/210/2A/Q HM 218248/NW/2A/210/2A/Q	VKS 6111 VKS 6105	48)
	•	○							



K 113 TLA, K 113 TLB

•

AMA56

VKBA 5225

•

VKHB 2228  
VKHB 2004

T2EE 060/Q  
32309 J2/Q

VKS 6284  
-

70)

•

AMA56

VKBA 5263

•

VKHB 2228  
VKHB 2004

T2EE 060/Q  
32309 J2/Q

VKS 6241  
-

71)

•

•

VKBA 5226

•

VKHB 2003  
VKHB 2004

32312 J2/Q  
32309 J2/Q

VKS 6261  
-

72)

•

•

VKBA 5264

•

VKHB 2003  
VKHB 2004

32312 J2/Q  
32309 J2/Q

VKS 6242  
-

73)

•

•

AMA61

VKBA 5226

•

VKHB 2003  
VKHB 2004

32312 J2/Q  
32309 J2/Q

VKS 6261  
-

70)

•

•

AMA61

VKBA 5264

•

VKHB 2003  
VKHB 2004

32312 J2/Q  
32309 J2/Q

VKS 6242  
-

71)

•

•

○

ADA90

VKBA 5067

•

VKHB 2029  
VKHB 2029

HM 218248/W/2A/210/2A/Q  
HM 218248/W/2A/210/2A/Q

VKS 6111  
VKS 6105

48)

○

Trailing axle

VKBA 5064

•

VKHB 2003  
VKHB 2004

32312 J2/Q  
32309 J2/Q

VKS 6108  
-

48)

○

L 113 CLB

•

AM56

VKBA 5225

•

VKHB 2228  
VKHB 2004

T2EE 060/Q  
32309 J2/Q

VKS 6284  
-

67)

•

AMA56

VKBA 5263

•

VKHB 2228  
VKHB 2004

T2EE 060/Q  
32309 J2/Q

VKS 6241  
-

68)

•

•

AM61, AMA61

VKBA 5226

•

VKHB 2003  
VKHB 2004

32312 J2/Q  
32309 J2/Q

VKS 6261  
-

49)

•

•

AM61, AMA61

VKBA 5264

•

VKHB 2003  
VKHB 2004

32312 J2/Q  
32309 J2/Q

VKS 6242  
-

50)

•

•

○

AD90, ADA90

VKBA 5067

•

VKHB 2029  
VKHB 2029

HM 218248/W/2A/210/2A/Q  
HM 218248/W/2A/210/2A/Q

VKS 6111  
VKS 6105

48)

○

N 113 ALB

•

AMA56

VKBA 5225

•

VKHB 2228  
VKHB 2004

T2EE 060/Q  
32309 J2/Q

VKS 6284  
-

74)

•

AMA56

VKBA 5263

•

VKHB 2228  
VKHB 2004

T2EE 060/Q  
32309 J2/Q

VKS 6241  
-

75)

•

•

AMA56

VKBA 5226

•

VKHB 2003  
VKHB 2004

32312 J2/Q  
32309 J2/Q

VKS 6261  
-

76)

•

•

AMA56

VKBA 5264

•

VKHB 2003  
VKHB 2004

32312 J2/Q  
32309 J2/Q

VKS 6242  
-

77)

•

•

○

ADA90

VKBA 5067

•

VKHB 2029  
VKHB 2029

HM 218248/W/2A/210/2A/Q  
HM 218248/W/2A/210/2A/Q

VKS 6111  
VKS 6105

48)

○

ASA90

VKBA 5069

•

VKHB 2029  
VKHB 2029

HM 218248/W/2A/210/2A/Q  
HM 218248/W/2A/210/2A/Q

VKS 6111  
-

48)

○

N 113 CLB, N 113 CRB

•

AMA56

VKBA 5225

•

VKHB 2228  
VKHB 2004

T2EE 060/Q  
32309 J2/Q

VKS 6284  
-

78)

•

AMA56

VKBA 5263

•

VKHB 2228  
VKHB 2004

T2EE 060/Q  
32309 J2/Q

VKS 6241  
-

79)

•

•

AMA56

VKBA 5226

•

VKHB 2003  
VKHB 2004

32312 J2/Q  
32309 J2/Q

VKS 6261  
-

80)

•

•

AMA56

VKBA 5264

•

VKHB 2003  
VKHB 2004

32312 J2/Q  
32309 J2/Q

VKS 6242  
-

81)

•

•



	•		AMA56	VKBA 5293	•	VKHB 2228 VKHB 2004	T2EE 060/Q 32309 J2/Q	VKS 6253 -	
	•		AMA61	VKBA 5294	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6254 -	96)
	•		AMA61	VKBA 5226	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6261 -	97)
	•	○	ADA90	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	82)
BR 116	•			-	•	- VKHB 2001	- 32308 J2/Q	VKS 6103 -	41)
	•			VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	83)
	•			-	•	VKHB 2002 VKHB 2001	32311 J2 32308 J2/Q	VKS 6107 -	42)
	•			VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	84)
	•			VKBA 5064	•	VKHB 2003 VKHB 2004	32312 J2/Q 32309 J2/Q	VKS 6108 -	44)
	•	○	R653, R750	VKBA 5068	•	VKHB 2030 VKHB 2030	32218 J2/Q 32218 J2/Q	VKS 6106 VKS 6105	45)
	•	○	R653, R750	VKBA 5067	•	VKHB 2029 VKHB 2029	HM 218248/W/2A/210/2A/Q HM 218248/W/2A/210/2A/Q	VKS 6111 VKS 6105	46)



B 10M, B 9M, B 10B, BLE, B 10L	•		VKBA 5099	•	VKHB 2013	6386/K-6320/Q	VKS 6114	134)
	•			•	VKHB 2014	537/532 X/Q	-	
	•		VKBA 5124	•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6134	135)
	•			•	VKHB 2036	39580/W/2/39520/2/Q	-	
	○	Trailing axle	VKBA 5124	•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6134	135)
	○			•	VKHB 2036	39580/W/2/39520/2/Q	-	
	○	Trailing axle	VKBA 5124	•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6134	136)
○			•	VKHB 2036	39580/W/2/39520/2/Q	-		
○	Trailing axle	VKBA 5099	•	VKHB 2013	6386/K-6320/Q	VKS 6114	134)	
○			•	VKHB 2014	537/532 X/Q	-		
○	Trailing axle	VKBA 5262	•	VKHB 2042	683/672	VKS 6135	35)	
○			•	VKHB 2043	663/653/Q	VKS 6298		
○			VKBA 5262	•	VKHB 2042	683/672	VKS 6135	35)
○				•	VKHB 2043	663/653/Q	VKS 6298	
B 10R	•		VKBA 5124	•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6134	139)
	•			•	VKHB 2036	39580/W/2/39520/2/Q	-	
	•		VKBA 5124	•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6134	138)
	•			•	VKHB 2036	39580/W/2/39520/2/Q	-	
•		VKBA 5099	•	VKHB 2013	6386/K-6320/Q	VKS 6114	137)	
•			•	VKHB 2014	537/532 X/Q	-		
○		VKBA 5262	•	VKHB 2042	683/672	VKS 6135	35)	
○			•	VKHB 2043	663/653/Q	VKS 6298		
B 12	•		VKBA 5124	•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6134	
	•			•	VKHB 2036	39580/W/2/39520/2/Q	-	
	○	Trailing axle	VKBA 5124	•	VKHB 2024	T2ED 070/QCLNVB061	VKS 6134	
○			•	VKHB 2036	39580/W/2/39520/2/Q	-		
○		VKBA 5262	•	VKHB 2042	683/672	VKS 6135		
○			•	VKHB 2043	663/653/Q	VKS 6298		
B 57, BB57	•		VKBA 5099	•	VKHB 2013	6386/K-6320/Q	VKS 6114	119)
	•			•	VKHB 2014	537/532 X/Q	-	
	•		VKBA 5099	•	VKHB 2013	6386/K-6320/Q	VKS 6114	120)
	•			•	VKHB 2014	537/532 X/Q	-	
	○		-	•	VKHB 2040	594/592 A/Q	VKS 6115	120)
	○			•	VKHB 2041	580/572/Q	VKS 6298	
○		-	•	VKHB 2040	594/592 A/Q	VKS 6135	122)	
○			•	VKHB 2041	580/572/Q	VKS 6298		
○		-	•	VKHB 2040	594/592 A/Q	VKS 6128	121)	
○			•	VKHB 2041	580/572/Q	VKS 6298		
B 58	•		VKBA 5099	•	VKHB 2013	6386/K-6320/Q	VKS 6114	
	•			•	VKHB 2014	537/532 X/Q	-	
	○		-	•	VKHB 2040	594/592 A/Q	VKS 6128	12)
	○			•	VKHB 2041	580/572/Q	VKS 6298	
	○		-	•	VKHB 2040	594/592 A/Q	VKS 6115	124)
○			•	VKHB 2041	580/572/Q	VKS 6298		
○		-	•	VKHB 2040	594/592 A/Q	VKS 6128	123)	
○			•	VKHB 2041	580/572/Q	VKS 6298		



B 59	•		VKBA 5099	•	VKHB 2013 VKHB 2014	6386/K-6320/Q 537/532 X/Q	VKS 6114 -	
	•	○	VKBA 5262	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	
B 6	•		-	•	VKHB 2017 VKHB 2018	32210 J2/Q 32207 J2/Q	VKS 6131 -	125)
	•		VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/OCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	127)
	•		-	•	VKHB 2021 VKHB 2020	JM 207049/JM 207010 32208 J2/Q	VKS 6239 -	126)
	•		-	•	- VKHB 2065	- 33208/Q	VKS 6206 -	153)
	•	○	-	•	VKHB 2046 VKHB 2047	33015/Q 33013/Q	VKS 6141 -	128)
	•	○	-	•	VKHB 2048 VKHB 2046	33018/Q 33015/Q	VKS 6139 -	129)
	•	○	-	•	VKHB 2048 VKHB 2046	33018/Q 33015/Q	VKS 6140 -	152)
	•	○	VKBA 5261	•	VKHB 2163 VKHB 2165	33022 33220	VKS 6139 -	130)
	•	○	VKBA 5135	•	VKHB 2221 VKHB 2175	47678/Q/47620/Q 39590/39520/Q	VKS 6207 -	154)
	•							
	B 7	•		VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/OCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -
•		○	VKBA 5127	•	VKHB 2040 VKHB 2041	594/592 A/Q 580/572/Q	VKS 6136 -	131)
B 7R	•		VKBA 5285	•	VKHB 2024 VKHB 2036	T2ED 070/OCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	11)
	•	○	VKBA 5101	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	
B 7F, B 7FA	•		VKBA 5099	•	VKHB 2013 VKHB 2014	6386/K-6320/Q 537/532 X/Q	VKS 6114 -	132)
	•		VKBA 5124	•	VKHB 2024 VKHB 2036	T2ED 070/OCLNVB061 39580/W/2/39520/2/Q	VKS 6134 -	133)
	•	○	VKBA 5262	•	VKHB 2042 VKHB 2043	683/672 663/653/Q	VKS 6135 VKS 6298	











## TRAILER


ARVIN MERITOR (ROR) .....	256
BPW .....	256–257
FRUEHAUF .....	257
GIGANT (SAE) .....	257–259
KÄSSBOHRER .....	259
MERCEDES-BENZ DISCOS .....	260
MONTENEGRO .....	260
SAF .....	260–261
SMB .....	261
TRAILOR .....	262

**ARVIN MERITOR (ROR)**

TE 9000, TE 9300		VKBA 5528	•	VKHB 2298 VKHB 2299	33116 TN9/QCLNVB091 32310 J2/QU4	VKN 504 VKN 502	VKS 6260 -	
TM 22000, TM 22500, TM 25000		VKBA 5504	•	VKHB 2029 VKHB 2051	HM 218248/W/2A/210/2A/Q 33213/Q	VKN 510 VKN 506	VKS 6205 -	
TM 33000		-	•	VKHB 2297 VKHB 2030	32220 J2 32218 J2/Q	-	-	1)
LM 9000		VKBA 5553	•	VKHB 2315 VKHB 2315	BT1-0163/Q BT1-0163/Q	-	VKS 6205 -	

**BPW**

ZRZ-8010, EHZ-9010	1973-82	VKBA 5502	•	VKHB 2028 VKHB 2303	33215/Q 32310 TN9	VKN 507 VKN 502	- -	
ZRZ-10010	1973-77	VKBA 5503	•	VKHB 2225 VKHB 2217	33217/Q 33213 TN9/QVT621	- -	- -	
ERZ-10010, EHZ-11010	1977-82	VKBA 5503	•	VKHB 2225 VKHB 2217	33217/Q 33213 TN9/QVT621	- -	- -	
H/R 6,5 - 9 tons, KH/KR 6,5 - 9 tons	1982-	VKBA 5527	•	VKHB 2177 VKHB 2303	33116 TN9/QVT621 32310 TN9	VKN 504 VKN 502	- -	
NH/NR 6 - 9 tons		VKBA 5525	•	VKHB 2177 VKHB 2303	33116 TN9/QVT621 32310 TN9	VKN 504 VKN 502	VKS 6285 -	
HL/HLS 6,5 - 9 tons	1982-	VKBA 5527	•	VKHB 2177 VKHB 2303	33116 TN9/QVT621 32310 TN9	VKN 504 VKN 502	- -	
HL/HLS 6,5 - 9 tons	1982-	VKBA 5525	•	VKHB 2177 VKHB 2303	33116 TN9/QVT621 32310 TN9	VKN 504 VKN 502	VKS 6285 -	1)
ECO: H/R 6,5 - 9 tons, KH/KR 6,5 - 9 tons, NH/NR 6,5 - 9 tons	1993-	VKBA 5521	•	VKHB 2177 VKHB 2303	33116 TN9/QVT621 32310 TN9	VKN 504 VKN 515	VKS 6250 -	
ECO/ECO-MAXX, SH/SKH 8-9 tons		VKBA 5521	•	VKHB 2177 VKHB 2303	33116 TN9/QVT621 32310 TN9	VKN 504 VKN 515	VKS 6250 -	
ECO-Plus, 8-9 t		VKBA 5550	•	VKHB 2178 VKHB 2217	33118 TN9/QVT621 33213 TN9/QVT621	VKN 505 VKN 516	VKS 6354 -	
HL/HLS 10 - 12 tons		VKBA 5526	•	VKHB 2178 VKHB 2217	33118 TN9/QVT621 33213 TN9/QVT621	VKN 505 VKN 506	VKS 6287 -	1)
HL/HLS 10 - 12 ton		VKBA 5524	•	VKHB 2178 VKHB 2217	33118 TN9/QVT621 33213 TN9/QVT621	VKN 505 VKN 506	- -	2)
ECO: H/R 10-12 tons, KH/KR 10-12 tons, NH/NR 10-12 tons	1993-	VKBA 5522	•	VKHB 2178 VKHB 2217	33118 TN9/QVT621 33213 TN9/QVT621	VKN 505 VKN 506	VKS 6251 -	
ECO/ECO-MAXX, SH/SKH 10-12 tons		VKBA 5522	•	VKHB 2178 VKHB 2217	33118 TN9/QVT621 33213 TN9/QVT621	VKN 505 VKN 516	VKS 6251 -	
ECO-Plus, 10-12 t		VKBA 5551	•	VKHB 2178 VKHB 2217	33118 TN9/QVT621 33213 TN9/QVT621	VKN 505 VKN 516	VKS 6251 -	
H/R 10-12 tons, KH/HR 10-12 tons	1982-	VKBA 5524	•	VKHB 2178 VKHB 2217	33118 TN9/QVT621 33213 TN9/QVT621	VKN 505 VKN 506	- -	




NH/NR 10-12 tons		VKBA 5526	• •	VKHB 2178 VKHB 2217	33118 TN9/QVT621 33213 TN9/QVT621	VKN 505 VKN 506	VKS 6287 -	
NR 13 - 14 tons		VKBA 5513	• •	VKHB 2031 VKHB 2028	32219 J2 33215/Q		VKS 6286 -	

### FRUEHAUF

Propar axle (P-series)		VKBA 5505	• •	VKHB 2227 VKHB 2227	HM 518445/410 HM 518445/410	VKN 511 VKN 511	VKS 6283 -	
SMB OA/VA	1991-99	VKBA 5523	• •	VKHB 2279 VKHB 2279	BT1B 639416 B/Q BT1B 639416 B/Q	VKN 510 VKN 510	VKS 6252 -	1)
	2000-	-	• •	VKHB 2279 VKHB 2279	BT1B 639416 B/Q BT1B 639416 B/Q	VKN 510 VKN 510	VKS 6364 -	2)
	2000-	-	• •	VKHB 2279 VKHB 2279	BT1B 639416 B/Q BT1B 639416 B/Q	VKN 510 VKN 510	VKS 6365 -	3)
	2000-	-	• •	VKHB 2279 VKHB 2279	BT1B 639416 B/Q BT1B 639416 B/Q	VKN 510 VKN 510	VKS 6366 -	4)

### GIGANT (SAE)

DH4 05506 3334	1999	-	• •	- VKHB 2065	- 33208/Q		-	
DH5/6 09010 3745	1999	-	• •	VKHB 2326 VKHB 2303	33116/Q 32310 TN9		-	2)
DH5/6 09010 4345	1998	-	• •	VKHB 2326 VKHB 2303	33116/Q 32310 TN9		-	2)
DH6 10010 4345, DH6 10008 3745		-	• •	VKHB 2331 VKHB 2051	33118/Q 33213/Q		-	2)
DKH1 09010 3745		VKBA 5552	• •	- -	BTH-0022 A -		- -	
DKH1 09010 4345		VKBA 5552	• •	- -	BTH-0022 A -		- -	
GH4 05506 3010	06/1999	-	• •	- VKHB 2065	- 33208/Q		-	
GHK1 12010		VKBA 5397	• •	- -	- -		- -	
GKH1 10010 4220		VKBA 5552	• •	- -	BTH-0022 A -		- -	
GKH1 09010 4218		VKBA 5552	• •	- -	BTH-0022 A -		- -	
GNV5 10010 3020	11/1996	-	• •	VKHB 2331 VKHB 2051	33118/Q 33213/Q		-	2)
GNV5 12010 3620	1996	-	• •	VKHB 2331 VKHB 2051	33118/Q 33213/Q		-	
GNVH5 12010 4220	1999	-	• •	VKHB 2331 VKHB 2051	33118/Q 33213/Q		-	



**GIGANT (SAE) forts.**

GNVH5/6 09010 4218	1997	-	•	VKHB 2326 VKHB 2303	33116/Q 32310 TN9	-	1) 2)
GV 2001 10510 3020		-	•	VKHB 2326 VKHB 2326	33116/Q 33116/Q	-	2)
GV 2001 12010 3020		-	•	VKHB 2331 VKHB 2326	33118/Q 33116/Q	-	2)
GVH5/6 09010 4218	1999	-	•	VKHB 2326 VKHB 2303	33116/Q 32310 TN9	-	2)
GVH5 12010 3620	1997	-	•	VKHB 2331 VKHB 2051	33118/Q 33213/Q	-	2)
GVH5 12010 3020	1997	-	•	VKHB 2331 VKHB 2051	33118/Q 33213/Q	-	2)
GVH5 12010 4220	1996	-	•	VKHB 2331 VKHB 2051	33118/Q 33213/Q	-	2)
GVH5 12008 3620	1997	-	•	VKHB 2331 VKHB 2051	33118/Q 33213/Q	-	2)
GVH5 10010 4220	1997	-	•	VKHB 2331 VKHB 2051	33118/Q 33213/Q	-	2)
GVH5 10010 3620	1997	-	•	VKHB 2331 VKHB 2051	33118/Q 33213/Q	-	2)
GVH5 10010 3020	1997	-	•	VKHB 2331 VKHB 2051	33118/Q 33213/Q	-	2)
GVH5 10008 3620	1997	-	•	VKHB 2331 VKHB 2051	33118/Q 33213/Q	-	2)
GZV5 12010 4220	1999	-	•	VKHB 2331 VKHB 2051	33118/Q 33213/Q	-	2)
SH3 10510 3020	1990	-	•	VKHB 2026 VKHB 2026	32216 J2/Q 32216 J2/Q	-	
SNH3 10510 3020	1995	-	•	VKHB 2026 VKHB 2026	32216 J2/Q 32216 J2/Q	-	
SV2 05506 3012	1989	-	•	- VKHB 2019	- 32211 J2/Q	-	
SV2 06706 3015	1990	-	•	VKHB 2284 -	32214 J2/Q -	-	
SV2 14010 4220 (340120)		-	•	VKHB 2297 VKHB 2030	32220 J2 32218 J2/Q	-	
SV2 20010 4220	1998	-	•	- VKHB 2297	- 32220 J2	-	
SV3 10508 3520 (340022)		-	•	VKHB 2030 VKHB 2026	32218 J2/Q 32216 J2/Q	-	
SV3 10510 3020	1990	-	•	VKHB 2026 VKHB 2026	32216 J2/Q 32216 J2/Q	-	
SV3 10510 3020 (340049)		-	•	VKHB 2026 VKHB 2026	32216 J2/Q 32216 J2/Q	-	




SV3 10510 3020 (340109)	-	•	VKHB 2026	32216 J2/Q	-
		•	VKHB 2026	32216 J2/Q	
SV3 10510 3020 (340253)	-	•	VKHB 2026	32216 J2/Q	-
		•	VKHB 2026	32216 J2/Q	
SV3 12010 3020	-	•	VKHB 2030	32218 J2/Q	-
		•	VKHB 2026	32216 J2/Q	
SV3 13010 3520 (340250)	-	•	VKHB 2030	32218 J2/Q	-
		•	VKHB 2026	32216 J2/Q	
5120/S32	-	•	VKHB 2017	32210 J2/Q	-
		•	VKHB 2020	32208 J2/Q	
5122/S33	-	•	VKHB 2284	32214 J2/Q	-
		•	-	-	
5203/S44	-	•	VKHB 2026	32216 J2/Q	-
		•	VKHB 2284	32214 J2/Q	
5204/S44	-	•	VKHB 2030	32218 J2/Q	-
		•	VKHB 2026	32216 J2/Q	
5205/S44	-	•	VKHB 2297	32220 J2	-
		•	VKHB 2030	32218 J2/Q	
5206/S44	-	•	-	-	-
		•	VKHB 2030	32218 J2/Q	
5207R/S44	-	•	-	-	-
		•	VKHB 2030	32218 J2/Q	
7103/S33	-	•	VKHB 2026	32216 J2/Q	-
		•	VKHB 2284	32214 J2/Q	
7104/S35	-	•	VKHB 2030	32218 J2/Q	-
		•	VKHB 2026	32216 J2/Q	
7121/S33	-	•	-	-	-
		•	VKHB 2019	32211 J2/Q	
7404/S33	-	•	VKHB 2026	32216 J2/Q	-
		•	VKHB 2026	32216 J2/Q	
9164/S35	-	•	VKHB 2030	32218 J2/Q	-
		•	VKHB 2026	32216 J2/Q	
9303/S4420	-	•	VKHB 2026	32216 J2/Q	-
		•	VKHB 2284	32214 J2/Q	
9304/S4420	-	•	VKHB 2030	32218 J2/Q	-
		•	VKHB 2026	32216 J2/Q	
9404/S35	-	•	VKHB 2026	32216 J2/Q	-
		•	VKHB 2026	32216 J2/Q	

### KÄSSBOHRER

10 tons, 09-01.030, 09-01.062, 09-01.075, 09-01.077, 09-01.089, 09-01.093, 09-01.100	VKBA 5519	•	VKHB 2030	32218 J2/Q	-
		•	VKHB 2026	32216 J2/Q	-
6,5 tons, 09-01.087, 09-01.088	VKBA 5517	•	VKHB 2248	30218 J2	VKS 6294
		•	VKHB 2204	30216 J2/Q	-
9 tons, 09-01.111, 09-01.112, 09-01.113, 09-01.114, 09-01.119, 09-01.121, 09-01.122	VKBA 5518	•	VKHB 2248	30218 J2	VKS 6294
		•	VKHB 2026	32216 J2/Q	-



**MERCEDES-BENZ DISCOS**

NR 5/10 DCL-9	VKBA 5548	•	VKHB 2225 VKHB 2002	33217/Q 32311 J2	VKS 6150 -
LR4	VKBA 5552	•	-	BTH-0022 A -	- -
TE5	VKBA 5552	•	-	BTH-0022 A -	- -

**MONTENEGRO**

7,5 T	VKBA 5532	•	VKHB 2080	32217 J2/Q -	VKS 6307 -	1)
8 T	VKBA 5533	•	VKHB 2080	32217 J2/Q -	VKS 6307 -	2)
	VKBA 5532	•	VKHB 2080	32217 J2/Q -	VKS 6307 -	3)
8,5 T	VKBA 5534	•	VKHB 2080 VKHB 2080	32217 J2/Q 32217 J2/Q	VKS 6308 -	4)
	VKBA 5532	•	VKHB 2080	32217 J2/Q -	VKS 6307 -	5)
9,5 T	VKBA 5532	•	VKHB 2080	32217 J2/Q -	VKS 6307 -	6)
	VKBA 5533	•	VKHB 2080	32217 J2/Q -	VKS 6307 -	7)
10,5 T	VKBA 5534	•	VKHB 2080 VKHB 2080	32217 J2/Q 32217 J2/Q	VKS 6308 -	8)
11 T	VKBA 5535	•	VKHB 2227	HM 518445/410 -	VKS 6307 -	9) 13)
11,5 T	VKBA 5536	•	VKHB 2227	HM 518445/410 -	VKS 6307 -	10) 13)
13 T	VKBA 5534	•	VKHB 2080 VKHB 2080	32217 J2/Q 32217 J2/Q	VKS 6308 -	11)
	VKBA 5536	•	VKHB 2227	HM 518445/410 -	VKS 6307 -	12) 13)

**SAF**

EBN 3140-6, EBN 3130/12"	VKBA 5547	•	VKHB 2061 VKHB 2182	33211/Q 33207/Q	VKS 6314 -
EBN 4040, ESN 4040	VKBA 5537	•	VKHB 2198 VKHB 2202	30311 J2/Q 30307 J2/Q	VKS 6309 -
EBN 4530, EBN 4535, EBN 4540, EBN 4540-6	VKBA 5538	•	VKHB 2173 VKHB 2067	33212/Q 33209/Q	VKS 6309 -
ES 5030, ESN 4540, ESN 5030, EZN 5030, RS 5030, WESN 5030, WEZN 5030	VKBA 5539	•	VKHB 2283 VKHB 2201	30312 J2/Q 30309 J2/Q	VKS 6310 -



ESN 5542		VKBA 5540	• •	VKHB 2288 VKHB 2201	32213 J2/Q 30309 J2/Q		VKS 6310 -	
ESN 6030, EZN 6030, WESN 6030, WEZN 6030, WEZN 6030/12"		VKBA 5541	• •	VKHB 2304 VKHB 2201	30313 J2/Q 30309 J2/Q		VKS 6312 -	
RZM 13130		VKBA 5542	• •	VKHB 2030 VKHB 2003	32218 J2/Q 32312 J2/Q		VKS 6313 -	
RBM 8442, RSM 8442, RSM 8442-8, RSM 11242, RZM 8442, RZM 8442-8, RZM 11242, WRZM 8442, WRZM 8442-8, WRZM 11242		VKBA 5507	• •	VKHB 2029 VKHB 2051	HM 218248/W/2A/210/2A/Q 33213/Q	VKN 510 VKN 506	VKS 6249 -	1)
RLBM 8442, RLSM 8442, RLSM 11242		VKBA 5507	• •	VKHB 2029 VKHB 2051	HM 218248/W/2A/210/2A/Q 33213/Q	VKN 510 VKN 506	VKS 6249 -	2)
WRLZM 8130, WRLZM 8435-8, WRLZM 8435-10, WRLZM 11030, WRLZM 11035-8, WRLZM 11035-10, WZRLZM 8130, WZRLZM 11030		VKBA 5507	• •	VKHB 2029 VKHB 2051	HM 218248/W/2A/210/2A/Q 33213/Q	VKN 510 VKN 506	VKS 6249 -	3)
WRZM 8130, WRZM 8435-10, WRZM 11030, WRZM 11035-8, WRZM 11035-10		VKBA 5507	• •	VKHB 2029 VKHB 2051	HM 218248/W/2A/210/2A/Q 33213/Q		VKS 6249 -	4)
RBM 8442/12		VKBA 5543	• •	VKHB 2050 VKHB 2051	HM 215249/HM 215210 33213/Q		VKS 6310 -	
RSM 6242/12-8, RSM 6242/12-10, WRZM 6242, WRZM 6242-8		VKBA 5544	• •	VKHB 2050 VKHB 2214	HM 215249/HM 215210 33113/Q		VKS 6310 -	
EBN 5535		VKBA 5545	• •	VKHB 2214 VKHB 2201	33113/Q 30309 J2/Q		VKS 6309 -	
RLSM 9042, RLSM 9042/20, RSM 6542, RSM 9042, RSM 9042/20	-11/1995	VKBA 5508	• •	VKHB 2247 VKHB 2247	32924 32924	VKN 514 VKN 514	VKS 6292 -	
RZM 16242, RZT 16242		VKBA 5546	• •	VKHB 2212 VKHB 2072	32221 J2 32314 J2/Q		VKS 6311 -	
SK 1000 / ETO		VKBA 5549	• •	- -	BTF-0056 EB -		- -	5)
SK 1000 / ET 120, INTRADISC plus		VKBA 5549	• •	- -	BTF-0056 EB -		- -	5)

<b>SMB</b>
------------

SMB OA/VA	1991-99	VKBA 5523	• •	VKHB 2279 VKHB 2279	BT1B 639416 B/Q BT1B 639416 B/Q	VKN 510 VKN 510	VKS 6252 -	1)
	2000-	-	• •	VKHB 2279 VKHB 2279	BT1B 639416 B/Q BT1B 639416 B/Q	VKN 510 VKN 510	VKS 6364 -	2)
	2000-	-	• •	VKHB 2279 VKHB 2279	BT1B 639416 B/Q BT1B 639416 B/Q	VKN 510 VKN 510	VKS 6365 -	3)
	2000-	-	• •	VKHB 2279 VKHB 2279	BT1B 639416 B/Q BT1B 639416 B/Q	VKN 510 VKN 510	VKS 6366 -	4)



## TRAILOR

L 200; L 300 TM; L400 TEM

VKBA 5506

- 
- 

VKHB 2226  
VKHB 2205

JM 718149 A/110/Q  
JM 515649/610/Q

VKN 512  
VKN 513

VKS 6295  
-



SMB OA/VA

1991-99

VKBA 5523

- 
- 

VKHB 2279  
VKHB 2279

BT1B 639416 B/Q  
BT1B 639416 B/Q

VKN 510  
VKN 510

VKS 6252  
-



2000-

-

- 
- 

VKHB 2279  
VKHB 2279

BT1B 639416 B/Q  
BT1B 639416 B/Q

VKN 510  
VKN 510

VKS 6364  
-



2000-

-

- 
- 

VKHB 2279  
VKHB 2279

BT1B 639416 B/Q  
BT1B 639416 B/Q

VKN 510  
VKN 510

VKS 6365  
-



2000-

-

- 
- 


VKHB 2279  
VKHB 2279

BT1B 639416 B/Q  
BT1B 639416 B/Q

VKN 510  
VKN 510

VKS 6366  
-




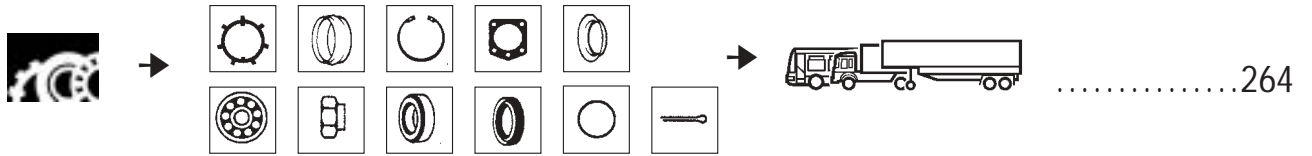










ARVIN MERITOR (ROR) .....	277
BPW .....	277
CITROEN .....	277
DAF .....	277
FIAT IVECO .....	277
FORD .....	277
FRUEHAUF .....	277
KÄSSBOHRER .....	278
MAN .....	278
MERCEDES-BENZ .....	278


MERCEDES-BENZ DISCOS .....	279
MONTENEGRO .....	279
PEUGEOT .....	279
RENAULT-RVI .....	279
SAF .....	280
SCANIA .....	280
TRAILOR .....	280
VOLKSWAGEN .....	280
VOLVO .....	280

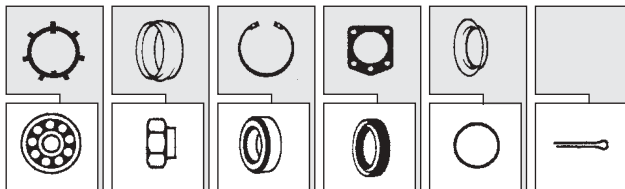









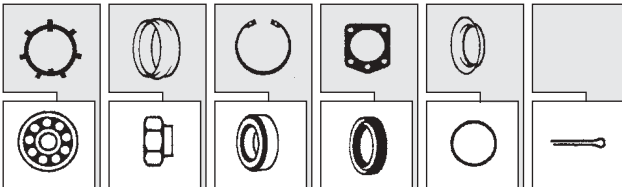

VKBA 519	2						1					VOLKSWAGEN	•	
VKBA 523	2						1				1	FORD	•	
VKBA 596	2						1					MERCEDES-BENZ	•	
VKBA 802	2		1				1					VOLKSWAGEN	•	
VKBA 804	1		1				2					PEUGEOT	•	
VKBA 813	1		1				2					CITROEN, FIAT IVECO	•	
VKBA 814	1		1				1					CITROEN, FIAT IVECO	•	•
VKBA 821	2	1					1	1				FIAT IVECO	•	•
VKBA 828	2						1					RVI	•	
VKBA 829	2		1				2					RVI	•	•
VKBA 830	2		1				1					RVI	•	•
VKBA 836	2		1				1					VOLKSWAGEN	•	
VKBA 844	2		1				2					CITROEN, FIAT IVECO, PEUGEOT	•	
VKBA 845	2		1				1					CITROEN, FIAT IVECO, PEUGEOT	•	•
VKBA 846	2		1				1					CITROEN, FIAT IVECO, PEUGEOT	•	•
VKBA 847	2		1				1					RVI	•	
VKBA 848	1				1		2					RVI	•	•
VKBA 849	1				1		1					RVI	•	•
VKBA 908	1		1									RVI	•	
VKBA 909	1		1									RVI	•	
VKBA 910	2					1	2				1	VOLKSWAGEN	•	
VKBA 911	2		1				1					VOLKSWAGEN	•	
VKBA 912	2		1				1					VOLKSWAGEN	•	
VKBA 921	1		1				1	1	1			FORD	•	•
VKBA 922	1	1					1	1	1			FORD	•	•
VKBA 923	2	1					1					FORD	•	•
VKBA 957	1		1				1	1	1			FORD	•	•
VKBA 958	1		1				1	1	1			FORD	•	•
VKBA 959	2	1					2					FORD	•	•
VKBA 977	2		1				1					RVI	•	•
VKBA 1312	1				1				1			CITROEN	•	•
VKBA 1385	2		1				1	1				FIAT IVECO	•	
VKBA 1386	2		1				1	1				FIAT IVECO	•	
VKBA 1391	2	1					1					FIAT IVECO	•	•
VKBA 1393	2						1					FIAT IVECO	•	•
VKBA 1394	2						1					FIAT IVECO	•	•
VKBA 1444	2		1				2					CITROEN, FIAT IVECO, PEUGEOT	•	•
VKBA 1445	2		1				1					CITROEN, FIAT IVECO, PEUGEOT	•	•
VKBA 1446	2		1				1					CITROEN, FIAT IVECO, PEUGEOT	•	•
VKBA 1462	2		1				1					CITROEN, FIAT IVECO, PEUGEOT	•	•
VKBA 1463	2		1				1					CITROEN, FIAT IVECO, PEUGEOT	•	•
VKBA 1465	2						1				1	FORD	•	•
VKBA 1466	1						1		1			FORD	•	•
VKBA 1467	1						1					FORD	•	•
VKBA 1470	1	1	7	1				1				MERCEDES-BENZ	•	•
VKBA 1477	1				1		1		2			VOLKSWAGEN	•	•
VKBA 1496	1				1		1		2			VOLKSWAGEN	•	•
VKBA 1497	1				1		1		2			VOLKSWAGEN	•	•
VKBA 3406	1		2			1						VOLKSWAGEN	•	•
VKBA 3407	2		1				1					RVI	•	•
VKBA 3428	2		1				2					CITROEN, FIAT IVECO, PEUGEOT	•	•
VKBA 3429	2		1				1					CITROEN, FIAT IVECO, PEUGEOT	•	•
VKBA 3430	2		1				1					CITROEN, FIAT IVECO, PEUGEOT	•	•
VKBA 3434	2						1			1		MERCEDES-BENZ	•	•
VKBA 3435	1						2	1				MERCEDES-BENZ	•	•
VKBA 3475	2	1					1					MERCEDES-BENZ	•	•
VKBA 3486	1		1				1					MERCEDES-BENZ	•	•
VKBA 3500	1		1				1					RVI	•	•
VKBA 3501	1		1				1					RVI	•	•
VKBA 3508	2		1				1	1				FIAT IVECO	•	•
VKBA 3509	2		1				1	1				FIAT IVECO	•	•
VKBA 3551	1											FIAT IVECO	•	•
VKBA 3552	1											FIAT IVECO	•	•
VKBA 3553	1											FIAT IVECO	•	•
VKBA 5008	2	1					1	2				DAF	•	•
VKBA 5011	2						2	3				DAF	•	•
VKBA 5014	2						1	2				DAF	•	•
VKBA 5015	2						2					DAF	•	•
VKBA 5020	2						1					DAF	•	•
VKBA 5023	2						1					MERCEDES-BENZ	•	•

											
VKBA 5024	2					1			MERCEDES-BENZ	•	
VKBA 5025	2					1			MERCEDES-BENZ	•	
VKBA 5026	2					1			MERCEDES-BENZ	•	
VKBA 5028	2					1			MERCEDES-BENZ	•	
VKBA 5029	2					1			MERCEDES-BENZ	•	
VKBA 5032	2					1			MERCEDES-BENZ	•	•
VKBA 5033	2					1	1		MERCEDES-BENZ	•	•
VKBA 5034	2					1	1		MERCEDES-BENZ	•	•
VKBA 5037	2					2	1		MERCEDES-BENZ	•	•
VKBA 5038	2					2	1		MERCEDES-BENZ	•	•
VKBA 5039	2					1	1		MERCEDES-BENZ	•	
VKBA 5040	2	1				2			MERCEDES-BENZ		•
VKBA 5041	2	1				1			MERCEDES-BENZ		•
VKBA 5043	2	1				1			MERCEDES-BENZ		•
VKBA 5046	2					1	1		MERCEDES-BENZ		•
VKBA 5047	2	1				1			MERCEDES-BENZ		•
VKBA 5048	2	1				1			MERCEDES-BENZ		•
VKBA 5052	2	1				1	1		MERCEDES-BENZ		•
VKBA 5056	2	1				1	1		MERCEDES-BENZ		•
VKBA 5057	2					2	2	1	MERCEDES-BENZ		•
VKBA 5058	2					2	4	1	MERCEDES-BENZ		•
VKBA 5059	2					2	4	1	MERCEDES-BENZ		•
VKBA 5064	2					1	1		SCANIA	•	•
VKBA 5067	2					2	1		SCANIA		•
VKBA 5068	2					2	1		SCANIA		•
VKBA 5069	2					1	1		SCANIA		•
VKBA 5075	2					2			SCANIA		•
VKBA 5077	2					1	1		SCANIA	•	•
VKBA 5083	2					2		2	SCANIA		•
VKBA 5087	2					1		2	SCANIA	•	•
VKBA 5099	2					1		1	VOLVO	•	•
VKBA 5101	2					2			VOLVO		•
VKBA 5105	2					1			VOLVO	•	
VKBA 5124	2					1		1	VOLVO	•	•
VKBA 5125	2					2		1	VOLVO		•
VKBA 5127	2					1		2	VOLVO		•
VKBA 5135	2					1		1	VOLVO		•
VKBA 5142	2					1			VOLVO		•
VKBA 5150	2					1			MAN		•
VKBA 5153	2					2	4	1	MAN		•
VKBA 5155	2					1	1		MAN	•	
VKBA 5160	2					2	4	1	MAN		•
VKBA 5162	2					1			MAN	•	•
VKBA 5163	2					1			MAN		•
VKBA 5166	2					2	3	1	MAN, MERCEDES-BENZ	•	
VKBA 5171	2					1	1		FIAT IVECO	•	
VKBA 5174	2					1	1		FIAT IVECO	•	•
VKBA 5180	2					2			FIAT IVECO		•
VKBA 5188	2					1	1		FIAT IVECO, FIAT-IVECO	•	
VKBA 5189	2					2	1	1	FIAT IVECO		•
VKBA 5190	2					1	1	1	FIAT IVECO	•	
VKBA 5192	2					2			FIAT IVECO		•
VKBA 5201	2					1			RVI		•
VKBA 5205	2					1			RVI	•	
VKBA 5206	2					1			RVI	•	
VKBA 5207	2	1				2			RVI		•
VKBA 5208	2					1			RVI	•	
VKBA 5214	2					1			RENAULT-RVI		•
VKBA 5216	2					1			RENAULT-RVI	•	
VKBA 5217	2					1			RVI		•
VKBA 5218	2					1			RENAULT-RVI		•
VKBA 5220	2					1			RENAULT-RVI	•	
VKBA 5221	2					1			RENAULT-RVI	•	
VKBA 5223	2					2			RENAULT-RVI	•	
VKBA 5225	2					1	1		SCANIA	•	•
VKBA 5226	2					1	1		SCANIA	•	•
VKBA 5227	2					1		1	DAF	•	
VKBA 5229	2					1		2	DAF		•
VKBA 5230	2					1			DAF	•	
VKBA 5232	2	1				1			MERCEDES-BENZ		•



VKBA 5233	2	1				1						MERCEDES-BENZ		•
VKBA 5234	2	1				2						MERCEDES-BENZ		•
VKBA 5236	2	1				1	1					MERCEDES-BENZ		•
VKBA 5237	2	1				1	1					MERCEDES-BENZ	•	
VKBA 5238	2	1				2						VOLVO		•
VKBA 5239	2	1				2						VOLVO		•
VKBA 5240	2					1						DAF	•	
VKBA 5241	2					1	1					DAF		•
VKBA 5242	2					1						DAF	•	
VKBA 5243	2					1						DAF		•
VKBA 5244	2					1						DAF	•	
VKBA 5245	2					1						DAF		•
VKBA 5248	1			1		2						DAF		•
VKBA 5261	2					1	1	2				VOLVO		•
VKBA 5262	2					2		1				VOLVO		•
VKBA 5263	2					1	1					SCANIA	•	
VKBA 5264	2					1	1					SCANIA		•
VKBA 5265	2					1						MAN		•
VKBA 5269	2					1	1	1				SCANIA	•	•
VKBA 5270	2					1		2				SCANIA		•
VKBA 5272	2					2		2				SCANIA		•
VKBA 5273	2					2		1				VOLVO		•
VKBA 5274	2					1						FIAT IVECO		•
VKBA 5276	2					1						FIAT IVECO		•
VKBA 5277	2					1						FIAT IVECO	•	
VKBA 5278	2					1						FIAT IVECO	•	
VKBA 5281	2					1						FIAT IVECO		•
VKBA 5282	2					1						FIAT IVECO		•
VKBA 5283	2					1						FIAT IVECO		•
VKBA 5284	2					1						FIAT IVECO	•	
VKBA 5285	2					1		2				VOLVO	•	•
VKBA 5287	2					2		2				VOLVO		•
VKBA 5288	2					1	1					FIAT IVECO	•	
VKBA 5293	2					1	1					SCANIA	•	
VKBA 5294	2					1	1					SCANIA	•	
VKBA 5295	2					1	1					MERCEDES-BENZ		•
VKBA 5296	2					2	5	1				MERCEDES-BENZ		•
VKBA 5297	2	1				1	1					MERCEDES-BENZ		•
VKBA 5298	2					3	1					MERCEDES-BENZ	•	
VKBA 5299	2					3	1					MERCEDES-BENZ	•	
VKBA 5300	2					2	4	1				MAN		•
VKBA 5301	2					2		1				MAN		•
VKBA 5302	2					1						MAN, MERCEDES-BENZ		•
VKBA 5303	2					1						KÄSSBOHRER/SETRA		•
VKBA 5304	2					2	1					KÄSSBOHRER/SETRA	•	
VKBA 5305	2					1						RENAULT-RVI		•
VKBA 5306	2					1	1					RENAULT-RVI	•	
VKBA 5307	2					1	1	2				MAN		•
VKBA 5308	1							1				RENAULT-RVI	•	
VKBA 5309	2					1						RENAULT-RVI		•
VKBA 5310	2					1	1					RENAULT-RVI	•	
VKBA 5311	2					1						RENAULT-RVI		•
VKBA 5312	2					1						RENAULT-RVI	•	
VKBA 5313	2					1						RENAULT-RVI	•	
VKBA 5314	1							1				SCANIA	•	
VKBA 5315	2					1						RENAULT-RVI	•	
VKBA 5316	1							1				RENAULT-RVI	•	
VKBA 5317	2					1						RVI	•	
VKBA 5322	2					1	1					FIAT-IVECO	•	
VKBA 5323	2					1	1					FIAT-IVECO	•	
VKBA 5324	2					1	1					FIAT-IVECO	•	
VKBA 5326	2					1						FIAT IVECO, FIAT-IVECO		•
VKBA 5327	2					2		1				FIAT-IVECO		•
VKBA 5328	2					2		1				FIAT-IVECO		•
VKBA 5329	2					2		1				FIAT-IVECO		•
VKBA 5330	2					2	1	2				FIAT-IVECO		•
VKBA 5331	2					1						MAN		•
VKBA 5332	2					1						RVI		•
VKBA 5333	2					1						RVI		•
VKBA 5335	2					1						RVI	•	

										
VKBA 5340	2				1			MAN	•	•
VKBA 5341	2				1			MAN, MERCEDES-BENZ		•
VKBA 5342	2				1			RVI	•	
VKBA 5343	2				1			FIAT IVECO	•	•
VKBA 5344	2				1	1	1	FIAT IVECO		•
VKBA 5345	2				1			RVI	•	
VKBA 5347	2				1			FIAT IVECO		•
VKBA 5348	2				1			FIAT IVECO		•
VKBA 5349	2				1			FIAT IVECO		•
VKBA 5350	2				1			FIAT IVECO		•
VKBA 5351	2				1	1	1	FIAT IVECO		•
VKBA 5353	2				1	1	1	FIAT IVECO		•
VKBA 5355	2				1			RVI		•
VKBA 5356	2				1			RVI		•
VKBA 5359	2				1			RVI	•	
VKBA 5360	2				1			RVI	•	
VKBA 5361	2				1	1	1	MAN	•	•
VKBA 5365	2				2	1		SCANIA		•
VKBA 5367	2				3	2	2	SCANIA		•
VKBA 5368	2				1		1	SCANIA	•	
VKBA 5369	2				1			MERCEDES-BENZ		•
VKBA 5370	2				1			MERCEDES-BENZ		•
VKBA 5371	2				1	2		MERCEDES-BENZ	•	
VKBA 5373	2				1		2	VOLVO		•
VKBA 5374	2				3	1		MERCEDES-BENZ	•	
VKBA 5375	2				3	1		MERCEDES-BENZ	•	•
VKBA 5376	2				2	4	1	MERCEDES-BENZ		•
VKBA 5377	1	1						MAN	•	
VKBA 5378	2				1			MAN	•	
VKBA 5379	2				1			MAN	•	
VKBA 5380	2				1			MAN	•	
VKBA 5381	2				1			MAN	•	
VKBA 5383	2				1			MAN	•	
VKBA 5384	2				1			MAN	•	
VKBA 5386	2				1			MERCEDES-BENZ	•	
VKBA 5387	2				1			MERCEDES-BENZ	•	
VKBA 5389	2				1			MERCEDES-BENZ	•	
VKBA 5390	2				2	3	1	MERCEDES-BENZ	•	
VKBA 5391	2				1			VOLVO		•
VKBA 5392	2				1			MERCEDES-BENZ		•
VKBA 5393	2				1			MERCEDES-BENZ		•
VKBA 5394	2				1	1		MERCEDES-BENZ		•
VKBA 5395	2				1			MERCEDES-BENZ		•
VKBA 5397	1							GIGANT (SAE), FIAT IVECO		•
VKBA 5398	2				1	1	1	FIAT IVECO	•	
VKBA 5399	2				1	1	1	FIAT IVECO		•
VKBA 5401	2				1			MERCEDES-BENZ		•
VKBA 5402	2				1	1		MERCEDES-BENZ		•
VKBA 5404	2				1	1	1	FIAT IVECO	•	
VKBA 5405	2				1	1	1	FIAT IVECO	•	
VKBA 5502	2							BPW		
VKBA 5503	2				2			BPW		
VKBA 5504	2				1	1		ARVIN MERITOR (ROR		
VKBA 5505	2				1		1	FRUEHAUF		
VKBA 5506	2				1	1		TRAILOR		
VKBA 5507	2				1			SAF		
VKBA 5508	2				1	1		SAF		
VKBA 5513	2				1			BPW		
VKBA 5517	2				1			KÄSSBOHRER		
VKBA 5518	2				1			KÄSSBOHRER		
VKBA 5519	2				1			KÄSSBOHRER		
VKBA 5521	2	1		1	2	1	2	BPW		
VKBA 5522	2			1		2	1	BPW		
VKBA 5523	2				1			TRAILOR, SMB, FRUEHAUF		
VKBA 5524	2				2		1	BPW		
VKBA 5525	2				2		1	BPW		
VKBA 5526	2				1		1	BPW		
VKBA 5527	2				3		1	BPW		
VKBA 5528	2				1			ROR		
VKBA 5532	2	1			2		1	MONTENEGRO		





VKBA 5533	2					2		1	
VKBA 5534	2	1				1		1	
VKBA 5535	2	1				2		1	
VKBA 5536	2					2		1	
VKBA 5537	2					1			
VKBA 5538	2					1			
VKBA 5539	2					1			
VKBA 5540	2					1			
VKBA 5541	2					1			
VKBA 5542	2					1			
VKBA 5543	2					1			
VKBA 5544	2					1			
VKBA 5545	2					1			
VKBA 5546	2					1			
VKBA 5547	2					1			
VKBA 5548	2					1	1		
VKBA 5549	1								
VKBA 5550	2			1	2	3			
VKBA 5551	2			1	2	3		1	
VKBA 5552	1								
VKBA 5553	2					1			



MONTENEGRO		
MONTENEGRO		
MONTENEGRO		
MONTENEGRO		
SAF		
SAF		
SAF		
SAF		
SAF		
SAF		
SAF		
SAF		
SAF		
SAF		
MERCEDES-BENZ DISCOS		
SAF		
BPW		
BPW		
MERCEDES-BENZ DISCOS, GIGANT (SAE)		
ARVIN MERITOR (ROR)		



VKBA 519	-	-	-	-	-
VKBA 523	-	-	-	-	-
VKBA 596	-	-	-	-	-
VKBA 802	-	-	-	-	-
VKBA 804	-	-	-	-	-
VKBA 813	-	-	-	-	-
VKBA 814	-	-	-	-	-
VKBA 821	VKHB 2246	VKHB 2239	-	-	-
VKBA 828	-	-	-	-	-
VKBA 829	-	-	-	-	-
VKBA 830	-	-	-	-	-
VKBA 836	-	-	-	-	-
VKBA 844	VKHB 2275	VKHB 2275	-	-	-
VKBA 845	VKHB 2266	VKHB 2267	-	-	-
VKBA 846	VKHB 2266	VKHB 2267	-	-	-
VKBA 847	-	-	-	-	-
VKBA 848	-	-	-	-	-
VKBA 849	-	-	-	-	-
VKBA 908	-	-	-	-	-
VKBA 909	-	-	-	-	-
VKBA 910	-	-	-	-	-
VKBA 911	VKHB 2272	VKHB 2270	-	-	-
VKBA 912	VKHB 2272	VKHB 2271	-	-	-
VKBA 921	-	-	-	-	-
VKBA 922	-	-	-	-	-
VKBA 923	-	-	-	-	-
VKBA 957	-	-	-	-	-
VKBA 958	-	-	-	-	-
VKBA 959	VKHB 2246	VKHB 2277	-	-	-
VKBA 977	-	-	-	-	-
VKBA 1312	-	-	-	-	-
VKBA 1385	VKHB 2020	VKHB 2262	-	-	-
VKBA 1386	VKHB 2020	VKHB 2262	-	-	-
VKBA 1391	VKHB 2258	VKHB 2239	-	-	-
VKBA 1393	VKHB 2060	VKHB 2060	-	-	-
VKBA 1394	VKHB 2059	VKHB 2060	-	-	-
VKBA 1444	VKHB 2275	VKHB 2275	-	-	-
VKBA 1445	VKHB 2266	VKHB 2267	-	-	-
VKBA 1446	VKHB 2266	VKHB 2267	-	-	-
VKBA 1462	VKHB 2268	VKHB 2016	-	-	-
VKBA 1463	VKHB 2268	VKHB 2016	-	-	-
VKBA 1465	-	-	-	-	-
VKBA 1466	-	-	-	-	-
VKBA 1467	-	-	-	-	-
VKBA 1470	-	-	-	-	-
VKBA 1477	-	-	-	-	-
VKBA 1496	-	-	-	-	-
VKBA 1497	-	-	-	-	-
VKBA 3406	-	-	-	-	-
VKBA 3407	-	-	-	-	-
VKBA 3428	VKHB 2302	VKHB 2302	-	-	-
VKBA 3429	VKHB 2266	VKHB 2267	-	-	-
VKBA 3430	VKHB 2268	VKHB 2016	-	-	-
VKBA 3434	-	-	-	-	-
VKBA 3435	-	-	-	-	-
VKBA 3475	-	-	-	-	-
VKBA 3486	-	-	-	-	-
VKBA 3500	-	-	-	-	-
VKBA 3501	-	-	-	-	-
VKBA 3508	VKHB 2065	VKHB 2179	-	-	-
VKBA 3509	VKHB 2065	VKHB 2179	-	-	-
VKBA 3551	-	-	-	-	-
VKBA 3552	-	-	-	-	-
VKBA 3553	-	-	-	-	-
VKBA 5008	VKHB 2132	VKHB 2070	VKS 6169	-	-
VKBA 5011	VKHB 2141	VKHB 2043	VKS 6171	-	VKS 6170
VKBA 5014	VKHB 2132	VKHB 2070	VKS 6164	-	-
VKBA 5015	VKHB 2143	VKHB 2144	VKS 6165	-	VKS 6165
VKBA 5020	VKHB 2145	VKHB 2082	VKS 6140	-	-
VKBA 5023	VKHB 2058	VKHB 2018	VKS 6149	-	-
VKBA 5024	VKHB 2054	VKHB 2055	VKS 6152	-	-
VKBA 5025	VKHB 2056	VKHB 2057	VKS 6299	-	-
VKBA 5026	VKHB 2059	VKHB 2007	VKS 6159	-	-
VKBA 5028	VKHB 2061	VKHB 2007	VKS 6148	-	-
VKBA 5029	VKHB 2061	VKHB 2064	VKS 6148	-	-
VKBA 5032	VKHB 2051	VKHB 2065	VKS 6157	-	-
VKBA 5033	VKHB 2066	VKHB 2067	VKS 6175	-	-
VKBA 5034	VKHB 2066	VKHB 2068	VKS 6175	-	-
VKBA 5037	VKHB 2071	VKHB 2068	VKS 6158	-	VKS 6146
VKBA 5038	VKHB 2071	VKHB 2070	VKS 6158	-	VKS 6146



VKBA 5039	VKHB 2072	VKHB 2070	VKS 6150	-	-
VKBA 5040	VKHB 2060	VKHB 2017	VKS 6159	-	-
VKBA 5041	VKHB 2019	VKHB 2017	VKS 6143	-	-
VKBA 5043	VKHB 2074	VKHB 2075	VKS 6147	-	-
VKBA 5046	VKHB 2041	VKHB 2079	VKS 6178	-	-
VKBA 5047	VKHB 2154	VKHB 2060	VKS 6173	-	-
VKBA 5048	VKHB 2155	VKHB 2156	VKS 6172	-	-
VKBA 5052	VKHB 2082	VKHB 2028	VKS 6154	-	-
VKBA 5056	VKHB 2124	VKHB 2158	VKS 6176	-	-
VKBA 5057	VKHB 2160	VKHB 2161	VKS 6183	-	VKS 6181
VKBA 5058	VKHB 2162	VKHB 2161	VKS 6183	-	VKS 6181
VKBA 5059	VKHB 2163	VKHB 2164	VKS 6183	-	VKS 6181
VKBA 5064	VKHB 2003	VKHB 2004	VKS 6108	-	-
VKBA 5067	VKHB 2029	VKHB 2029	VKS 6111	-	VKS 6105
VKBA 5068	VKHB 2030	VKHB 2030	VKS 6106	-	VKS 6105
VKBA 5069	VKHB 2029	VKHB 2029	VKS 6111	-	-
VKBA 5075	VKHB 2026	VKHB 2028	VKS 6109	-	VKS 6110
VKBA 5077	VKHB 2002	VKHB 2001	VKS 6108	-	-
VKBA 5083	VKHB 2032	VKHB 2032	VKS 6124	-	VKS 6262
VKBA 5087	VKHB 2024	VKHB 2006	VKS 6126	-	-
VKBA 5099	VKHB 2013	VKHB 2014	VKS 6114	-	-
VKBA 5101	VKHB 2042	VKHB 2043	VKS 6135	-	VKS 6298
VKBA 5105	VKHB 2013	VKHB 2014	VKS 6114	-	-
VKBA 5124	VKHB 2024	VKHB 2036	VKS 6134	-	-
VKBA 5125	VKHB 2053	VKHB 2029	VKS 6132	-	VKS 6179
VKBA 5127	VKHB 2040	VKHB 2041	VKS 6136	-	-
VKBA 5135	VKHB 2221	VKHB 2175	VKS 6207	-	-
VKBA 5142	VKHB 2024	VKHB 2036	VKS 6135	-	-
VKBA 5150	VKHB 2174	VKHB 2175	VKS 6192	-	-
VKBA 5153	VKHB 2162	VKHB 2161	VKS 6183	-	VKS 6181
VKBA 5155	VKHB 2132	VKHB 2068	VKS 6182	-	-
VKBA 5160	VKHB 2163	VKHB 2164	VKS 6183	-	VKS 6181
VKBA 5162	VKHB 2132	VKHB 2070	VKS 6182	-	-
VKBA 5163	VKHB 2146	VKHB 2082	VKS 6189	-	-
VKBA 5166	VKHB 2172	VKHB 2161	VKS 6197	-	VKS 6194
VKBA 5171	VKHB 2201	VKHB 2202	VKS 6227	-	-
VKBA 5174	VKHB 2203	VKHB 2002	VKS 6216	-	-
VKBA 5180	VKHB 2211	VKHB 2137	VKS 6210	-	-
VKBA 5188	VKHB 2013	VKHB 2303	VKS 6215	-	-
VKBA 5189	VKHB 2215	VKHB 2216	VKS 6218	-	VKS 6225
VKBA 5190	VKHB 2082	VKHB 2160	VKS 6214	-	-
VKBA 5192	VKHB 2212	VKHB 2211	VKS 6218	-	VKS 6225
VKBA 5201	VKHB 2048	VKHB 2046	VKS 6233	-	-
VKBA 5205	VKHB 2188	VKHB 2189	VKS 6118	-	-
VKBA 5206	VKHB 2190	VKHB 2057	VKS 6118	-	-
VKBA 5207	VKHB 2060	VKHB 2191	VKS 6238	-	VKS 6229
VKBA 5208	VKHB 2068	VKHB 2182	VKS 6235	-	-
VKBA 5214	VKHB 2185	VKHB 2042	VKS 6201	-	-
VKBA 5216	VKHB 2066	VKHB 2184	VKS 6175	-	-
VKBA 5217	VKHB 2186	VKHB 2187	VKS 6201	-	-
VKBA 5218	VKHB 2192	VKHB 2194	VKS 6201	-	-
VKBA 5220	VKHB 2051	VKHB 2067	VKS 6202	-	-
VKBA 5221	VKHB 2051	VKHB 2067	VKS 6175	-	-
VKBA 5223	VKHB 2170	VKHB 2169	VKS 6232	-	VKS 6232
VKBA 5225	VKHB 2228	VKHB 2004	VKS 6284	-	-
VKBA 5226	VKHB 2003	VKHB 2004	VKS 6261	-	-
VKBA 5227	VKHB 2231	VKHB 2002	VKS 6333	-	-
VKBA 5229	VKHB 2146	VKHB 2147	VKS 6180	-	-
VKBA 5230	VKHB 2232	VKHB 2070	VKS 6333	-	-
VKBA 5232	VKHB 2137	VKHB 2233	VKS 6155	-	-
VKBA 5233	VKHB 2137	VKHB 2233	VKS 6174	-	-
VKBA 5234	VKHB 2234	VKHB 2017	VKS 6288	-	-
VKBA 5236	VKHB 2082	VKHB 2028	VKS 6270	-	-
VKBA 5237	VKHB 2203	VKHB 2002	VKS 6270	-	-
VKBA 5238	VKHB 2042	VKHB 2043	VKS 6135	-	VKS 6271
VKBA 5239	VKHB 2042	VKHB 2052	VKS 6135	-	VKS 6271
VKBA 5240	VKHB 2237	VKHB 2238	VKS 6102	-	-
VKBA 5241	VKHB 2246	VKHB 2239	VKS 6120	-	-
VKBA 5242	VKHB 2067	VKHB 2016	VKS 6266	-	-
VKBA 5243	VKHB 2034	-	VKS 6267	-	-
VKBA 5244	VKHB 2241	VKHB 2242	VKS 6290	-	-
VKBA 5245	VKHB 2137	VKHB 2243	VKS 6289	-	-
VKBA 5248	-	-	VKS 6293	-	-
VKBA 5261	VKHB 2163	VKHB 2165	VKS 6139	-	-
VKBA 5262	VKHB 2042	VKHB 2043	VKS 6135	-	VKS 6298
VKBA 5263	VKHB 2228	VKHB 2004	VKS 6241	-	-
VKBA 5264	VKHB 2003	VKHB 2004	VKS 6242	-	-
VKBA 5265	VKHB 2240	VKHB 2018	VKS 6296	-	-
VKBA 5269	VKHB 2024	VKHB 2006	VKS 6261	-	-
VKBA 5270	VKHB 2024	VKHB 2006	VKS 6261	-	-



VKBA 5272	VKHB 2147	VKHB 2147	VKS 6244	-	VKS 6262
VKBA 5273	VKHB 2042	VKHB 2043	VKS 6135	-	VKS 6298
VKBA 5274	VKHB 2209	VKHB 2209	VKS 6326	-	-
VKBA 5276	VKHB 2208	VKHB 2074	VKS 6247	-	-
VKBA 5277	VKHB 2250	VKHB 2250	VKS 6316	-	-
VKBA 5278	VKHB 2249	VKHB 2250	VKS 6316	-	-
VKBA 5281	VKHB 2211	VKHB 2137	VKS 6245	-	-
VKBA 5282	VKHB 2210	VKHB 2211	VKS 6213	-	-
VKBA 5283	VKHB 2178	VKHB 2051	VKS 6246	-	-
VKBA 5284	VKHB 2013	VKHB 2303	VKS 6215	-	-
VKBA 5285	VKHB 2024	VKHB 2036	VKS 6134	-	-
VKBA 5287	VKHB 2053	VKHB 2029	VKS 6132	-	VKS 6179
VKBA 5288	VKHB 2255	VKHB 2182	VKS 6227	-	-
VKBA 5293	VKHB 2228	VKHB 2004	VKS 6253	-	-
VKBA 5294	VKHB 2003	VKHB 2004	VKS 6254	-	-
VKBA 5295	VKHB 2026	VKHB 2079	VKS 6255	-	-
VKBA 5296	VKHB 2162	VKHB 2161	VKS 6183	-	VKS 6181
VKBA 5297	VKHB 2124	VKHB 2158	VKS 6257	-	-
VKBA 5298	VKHB 2280	VKHB 2068	VKS 6150	-	VKS 6146
VKBA 5299	VKHB 2280	VKHB 2070	VKS 6150	-	VKS 6146
VKBA 5300	VKHB 2146	VKHB 2161	VKS 6183	-	VKS 6181
VKBA 5301	VKHB 2172	VKHB 2082	VKS 6197	-	VKS 6194
VKBA 5302	VKHB 2146	VKHB 2161	VKS 6334	-	-
VKBA 5303	VKHB 2281	VKHB 2160	VKS 6258	-	-
VKBA 5304	VKHB 2071	VKHB 2004	VKS 6259	-	VKS 6263
VKBA 5305	VKHB 2192	VKHB 2194	VKS 6140	-	-
VKBA 5306	VKHB 2066	VKHB 2004	VKS 6303	-	-
VKBA 5307	VKHB 2170	VKHB 2033	VKS 6138	-	-
VKBA 5308	-	-	-	-	-
VKBA 5309	VKHB 2192	VKHB 2158	VKS 6201	-	-
VKBA 5310	VKHB 2066	VKHB 2236	VKS 6303	-	-
VKBA 5311	VKHB 2161	VKHB 2158	VKS 6201	-	-
VKBA 5312	VKHB 2287	VKHB 2056	VKS 6202	-	-
VKBA 5313	VKHB 2287	VKHB 2067	VKS 6202	-	-
VKBA 5314	-	-	-	-	-
VKBA 5315	VKHB 2051	VKHB 2068	VKS 6175	-	-
VKBA 5316	-	-	-	-	-
VKBA 5317	VKHB 2066	VKHB 2184	VKS 6202	-	-
VKBA 5322	VKHB 2013	VKHB 2303	VKS 6323	-	-
VKBA 5323	VKHB 2286	VKHB 2303	VKS 6215	-	-
VKBA 5324	VKHB 2283	VKHB 2004	VKS 6319	-	-
VKBA 5326	VKHB 2210	VKHB 2211	VKS 6324	-	-
VKBA 5327	VKHB 2212	VKHB 2211	VKS 6322	-	VKS 6225
VKBA 5328	VKHB 2285	VKHB 2285	VKS 6180	-	VKS 6325
VKBA 5329	VKHB 2215	VKHB 2216	VKS 6322	-	VKS 6332
VKBA 5330	VKHB 2162	VKHB 2225	VKS 6318	-	VKS 6332
VKBA 5331	VKHB 2248	VKHB 2222	VKS 6328	-	-
VKBA 5332	VKHB 2161	VKHB 2169	VKS 6234	-	-
VKBA 5333	VKHB 2161	VKHB 2169	VKS 6201	-	-
VKBA 5335	VKHB 2061	VKHB 2065	VKS 6238	-	-
VKBA 5340	VKHB 2293	VKHB 2004	VKS 6329	-	-
VKBA 5341	VKHB 2163	VKHB 2164	VKS 6334	-	-
VKBA 5342	VKHB 2066	VKHB 2068	VKS 6303	-	-
VKBA 5343	VKHB 2251	VKHB 2252	VKS 6326	-	-
VKBA 5344	VKHB 2215	VKHB 2216	VKS 6322	-	-
VKBA 5345	VKHB 2020	VKHB 2294	VKS 6305	-	-
VKBA 5347	VKHB 2297	VKHB 2031	VKS 6331	-	-
VKBA 5348	VKHB 2212	VKHB 2211	VKS 6322	-	-
VKBA 5349	VKHB 2253	VKHB 2253	VKS 6326	-	-
VKBA 5350	VKHB 2211	VKHB 2137	VKS 6330	-	-
VKBA 5351	VKHB 2215	VKHB 2216	VKS 6322	-	-
VKBA 5353	VKHB 2215	VKHB 2216	VKS 6322	-	-
VKBA 5355	VKHB 2044	VKHB 2045	VKS 6237	-	-
VKBA 5356	VKHB 2282	VKHB 2199	VKS 6306	-	-
VKBA 5359	VKHB 2190	VKHB 2294	VKS 6118	-	-
VKBA 5360	VKHB 2067	VKHB 2294	VKS 6130	-	-
VKBA 5361	VKHB 2169	VKHB 2282	VKS 6186	-	-
VKBA 5365	VKHB 2029	VKHB 2029	VKS 6111	-	VKS 6272
VKBA 5367	VKHB 2147	VKHB 2147	VKS 6262	VKS 6273	VKS 6262
VKBA 5368	VKHB 2305	VKHB 2305	VKS 6274	-	-
VKBA 5369	VKHB 2162	VKHB 2306	VKS 6334	-	-
VKBA 5370	VKHB 2163	VKHB 2165	VKS 6334	-	-
VKBA 5371	VKHB 2002	VKHB 2002	VKS 6150	-	-
VKBA 5373	VKHB 2040	VKHB 2041	VKS 6136	-	-
VKBA 5374	VKHB 2307	VKHB 2003	VKS 6315	VKS 6150	VKS 6146
VKBA 5375	VKHB 2280	VKHB 2003	VKS 6315	VKS 6150	VKS 6146
VKBA 5376	VKHB 2162	VKHB 2082	VKS 6183	-	VKS 6181
VKBA 5377	-	-	-	-	-
VKBA 5378	VKHB 2314	VKHB 2179	-	-	-
VKBA 5379	VKHB 2314	VKHB 2179	VKS 6341	-	-



VKBA 5380	VKHB 2240	VKHB 2018	VKS 6342	-	-
VKBA 5381	VKHB 2293	VKHB 2067	VKS 6329	-	-
VKBA 5383	VKHB 2293	VKHB 2067	VKS 6343	-	-
VKBA 5384	VKHB 2293	VKHB 2067	VKS 6344	-	-
VKBA 5386	VKHB 2318	VKHB 2317	VKS 6346	-	-
VKBA 5387	VKHB 2319	VKHB 2320	VKS 6347	-	-
VKBA 5389	VKHB 2124	VKHB 2169	VKS 6349	-	-
VKBA 5390	VKHB 2082	VKHB 2323	VKS 6194	-	VKS 6197
VKBA 5391	VKHB 2040	-	VKS 6136	-	-
VKBA 5392	VKHB 2321	VKHB 2044	VKS 6350	-	-
VKBA 5393	VKHB 2124	VKHB 2326	VKS 6351	-	-
VKBA 5394	VKHB 2082	VKHB 2170	VKS 6352	-	-
VKBA 5395	VKHB 2041	VKHB 2328	VKS 6178	-	-
VKBA 5397	-	-	-	-	-
VKBA 5398	VKHB 2082	VKHB 2160	VKS 6335	-	-
VKBA 5399	VKHB 2248	VKHB 2215	VKS 6336	-	-
VKBA 5401	VKHB 2163	VKHB 2329	VKS 6353	-	-
VKBA 5402	VKHB 2124	VKHB 2326	VKS 6150	-	-
VKBA 5404	VKHB 2082	VKHB 2160	VKS 6335	-	-
VKBA 5405	VKHB 2082	VKHB 2170	VKS 6337	-	-
VKBA 5502	VKHB 2028	VKHB 2303	-	-	-
VKBA 5503	VKHB 2225	VKHB 2217	-	-	-
VKBA 5504	VKHB 2029	VKHB 2051	VKS 6205	-	-
VKBA 5505	VKHB 2227	VKHB 2227	VKS 6283	VKS 6283	-
VKBA 5506	VKHB 2226	VKHB 2205	VKS 6295	-	-
VKBA 5507	VKHB 2029	VKHB 2051	VKS 6249	-	-
VKBA 5508	VKHB 2247	VKHB 2247	VKS 6292	-	-
VKBA 5513	VKHB 2031	VKHB 2028	VKS 6286	-	-
VKBA 5517	VKHB 2248	VKHB 2204	VKS 6294	-	-
VKBA 5518	VKHB 2248	VKHB 2026	VKS 6294	-	-
VKBA 5519	VKHB 2030	VKHB 2026	-	-	-
VKBA 5521	VKHB 2177	VKHB 2303	VKS 6250	-	-
VKBA 5522	VKHB 2178	VKHB 2217	VKS 6251	-	-
VKBA 5523	VKHB 2279	VKHB 2279	VKS 6252	-	-
VKBA 5524	VKHB 2178	VKHB 2217	-	-	-
VKBA 5525	VKHB 2177	VKHB 2303	VKS 6285	-	-
VKBA 5526	VKHB 2178	VKHB 2217	VKS 6287	-	-
VKBA 5527	VKHB 2177	VKHB 2303	-	-	-
VKBA 5528	VKHB 2298	VKHB 2299	VKS 6260	-	-
VKBA 5532	VKHB 2080	VKHB 2280	VKS 6307	VKS 6307	-
VKBA 5533	VKHB 2080	VKHB 2080	VKS 6307	VKS 6307	-
VKBA 5534	VKHB 2080	VKHB 2080	VKS 6308	-	-
VKBA 5535	VKHB 2227	VKHB 2227	VKS 6307	VKS 6307	-
VKBA 5536	VKHB 2227	VKHB 2227	VKS 6307	VKS 6307	-
VKBA 5537	VKHB 2198	VKHB 2202	VKS 6309	-	-
VKBA 5538	VKHB 2173	VKHB 2067	VKS 6309	-	-
VKBA 5539	VKHB 2283	VKHB 2201	VKS 6310	-	-
VKBA 5540	VKHB 2288	VKHB 2201	VKS 6310	-	-
VKBA 5541	VKHB 2304	VKHB 2201	VKS 6312	-	-
VKBA 5542	VKHB 2030	VKHB 2003	VKS 6313	-	-
VKBA 5543	VKHB 2050	VKHB 2051	VKS 6310	-	-
VKBA 5544	VKHB 2050	VKHB 2214	VKS 6310	-	-
VKBA 5545	VKHB 2214	VKHB 2201	VKS 6309	-	-
VKBA 5546	VKHB 2212	VKHB 2072	VKS 6311	-	-
VKBA 5547	VKHB 2061	VKHB 2182	VKS 6314	-	-
VKBA 5548	VKHB 2225	VKHB 2002	VKS 6150	-	-
VKBA 5549	-	-	-	-	-
VKBA 5550	VKHB 2178	VKHB 2217	VKS 6354	-	-
VKBA 5551	VKHB 2178	VKHB 2217	VKS 6251	-	-
VKBA 5552	-	-	-	-	-
VKBA 5553	VKHB 2315	VKHB 2315	VKS 6205	-	-

**ARVIN MERITOR (ROR)**

21200321 A	VKS 6205
21220158	VKS 6260
99041035 B	VKHB 2029
99041045 B	VKHB 2051
99041057	VKHB 2030
99041058	VKHB 2297
99041067	VKHB 2298
99041068	VKHB 2299
99041075	VKHB 2315

**BPW**

02.5664.26.57	VKS 6285
02.5664.46.57	VKS 6287
02.5664.55.64	VKS 6250
02.5664.56.64	VKS 6251
02.5664.57.00	VKS 6250
02.5664.58.00	VKS 6251
02.5664.64.57	VKS 6286
02.5664.68.00	VKS 6354
02.64.10.23.00	VKHB 2178
02.6405.95.00	VKHB 2031
02.6407.75.00	VKHB 2028
02.6408.90.00	VKHB 2178
02.6410.23.00	VKHB 2178
02.6410.25.00	VKHB 2303
09.02.6406.50.00	VKHB 2303
09.02.6407.65.00	VKHB 2029
09.02.6407.85.00	VKHB 2225
02.6407.65.00	VKHB 2217
02.6410.22.00	VKHB 2217
02.6410.24.00	VKHB 2177
02.6408.80.00	VKHB 2177
02.6410.29.00	VKHB 2028

**CITROEN**

1300535080	VKHB 2302
3326.27	VKHB 2275
3326.41	VKHB 2302
3730.20	VKHB 2266
3730.22	VKHB 2016
3735.15	VKHB 2267
3735.18	VKHB 2268
996253	VKHB 2268
PSA 3326.41	VKHB 2302
ZF04330648	VKHB 2266
ZF04470124	VKHB 2267
ZF05996248	VKHB 2016

**DAF**

202825	VKHB 2009
325333	VKHB 2313
0140896	VKHB 2004
0174592	VKHB 2043
0174595 + 174595	VKHB 2141
0190069	VKS 6171
0221664	VKHB 2222
0266487	VKHB 2147
0266488	VKHB 2146
0275823	VKHB 2002
0283684	VKHB 2236
0292766	VKS 6180
0556289	VKHB 2070



0556290  
0640618  
0699117  
10271961  
10890343  
10901093  
10901094  
10907034  
117326  
1238034  
1327603  
13H6552  
174592  
174595  
190069  
190164  
196479  
202825  
213688  
254912  
259939  
259940  
260204  
260724  
260725  
266487  
266488  
283686  
292766  
325321  
325333  
325333  
325402  
4805  
490881  
490882  
491899  
491901  
491966  
491968  
493296  
494505  
494535  
494536  
494537  
495520  
535144  
614943  
626875  
631780  
636820  
647330  
676987  
676988  
678157  
AMK 4386  
RTC 3412  
RTC 3427  
RTC 3436  
RTC 3512  
UKC 4805  
AMPB 584  
AJU 1901  
AMPA 012

VKHB 2232  
VKHB 2157  
VKHB 2306  
VKHB 2333  
VKHB 2074  
VKHB 2137  
VKHB 2332  
VKS 6289  
VKS 6164  
VKS 6333  
VKHB 2231  
VKHB 2243  
VKHB 2043  
VKHB 2042  
VKS 6171  
VKS 6168  
VKS 6167  
VKHB 2089  
VKS 6166  
VKHB 2137  
VKS 6165  
VKS 6165  
VKHB 2132  
VKHB 2143  
VKHB 2144  
VKHB 2147  
VKHB 2146  
VKHB 2004  
VKS 6180  
VKS 6170  
VKHB 2142  
VKHB 2221  
VKHB 2131  
VKHB 2238  
VKS 6267  
VKHB 2034  
VKHB 2016  
VKS 6266  
VKHB 2242  
VKS 6290  
VKS 6293  
VKS 6102  
VKHB 2239  
VKHB 2246  
VKS 6120  
VKHB 2241  
VKHB 2144  
VKHB 2068  
VKHB 2070  
VKHB 2140  
VKHB 2067  
VKS 6169  
VKHB 2082  
VKHB 2145  
VKS 6140  
VKS 6290  
VKHB 2239  
VKHB 2237  
VKHB 2246  
VKS 6293  
VKHB 2238  
VKS 6357  
VKS 6358  
VKHB 2161

**FIAT IVECO**

1101597  
1102042  
1102857  
1102858

VKHB 2060  
VKHB 2282  
VKHB 2168  
VKHB 2248



1102859  
1102860  
1102864  
1103142  
1103360  
1103771  
1104922  
1104923  
1109968  
1109981  
1109981  
1110002  
1110016  
1110018  
1110019  
1110020  
1125929  
1126121  
1126887  
1384728  
1905027  
1905172  
1905219  
1905220  
1905221  
1905222  
1905273  
1905300  
1905350  
1905351  
2475845  
2475900  
2475977  
2477421  
2477558  
2478619  
2479949  
26800040  
26800140  
26800160  
26800170  
26800230  
26800250  
26800270  
26800330  
26800350  
26800370  
26800390  
26800580  
26800600  
26800610  
26800620  
26800640  
3345908  
3427559  
38510549  
40000480  
40000691  
40000693  
40000763  
40000953  
40001793  
40001880  
40001883  
40001903  
40001913  
40001933  
40001943  
40002850  
40002851  
40002853  
40003723  
40003733

VKHB 2283  
VKHB 2216  
VKHB 2215  
VKHB 2284  
VKHB 2216  
VKHB 2033  
VKHB 2160  
VKHB 2082  
VKHB 2697  
VKHB 2201  
VKS 6321  
VKHB 2020  
VKHB 2063  
VKHB 2004  
VKHB 2004  
VKHB 2070  
VKHB 2019  
VKHB 2204  
VKHB 2001  
VKHB 2200  
VKHB 2124  
VKHB 2211  
VKHB 2253  
VKHB 2209  
VKHB 2250  
VKHB 2249  
VKHB 2251  
VKHB 2285  
VKHB 2031  
VKHB 2297  
VKS 6319  
VKS 6360  
VKS 6214  
VKS 6318  
VKS 6320  
VKS 6321  
VKS 6204  
VKHB 2204  
VKHB 2020  
VKHB 2017  
VKHB 2019  
VKHB 2080  
VKHB 2031  
VKHB 2212  
VKHB 2262  
VKHB 2202  
VKHB 2201  
VKHB 2003  
VKHB 2001  
VKHB 2070  
VKHB 2002  
VKHB 2198  
VKHB 2072  
VKS 6361  
VKS 6332  
VKS 6105  
VKS 6246  
VKS 6224  
VKS 6224  
VKS 6217  
VKS 6222  
VKS 6210  
VKS 6227  
VKS 6227  
VKS 6221  
VKS 6220  
VKS 6216  
VKS 6212  
VKS 6215  
VKS 6215  
VKS 6215  
VKS 6225  
VKS 6218



40100043 VKS 6211  
 40100063 VKS 6213  
 40100093 VKS 6208  
 40100103 VKS 6223  
 40100110 VKS 6216  
 40100113 VKS 6211  
 40100443 VKS 6225  
 40100463 VKS 6247  
 40100651 VKS 6245  
 40100653 VKS 6245  
 40100663 VKS 6213  
 40100670 VKS 6218  
 40100673 VKS 6363  
 40101093 VKS 6336  
 40101353 VKS 6228  
 40101643 VKS 6323  
 40101733 VKS 6322  
 40102143 VKS 6326  
 40102273 VKS 6316  
 40102321 VKS 6330  
 40102333 VKS 6324  
 4023140 VKHB 2054  
 407001793 VKS 6210  
 4096104 VKHB 2270  
 4096587 VKHB 2151  
 41800341 VKHB 2162  
 41800342 VKHB 2225  
 42062983 VKS 6362  
 4330647 VKHB 2275  
 4330648 VKHB 2266  
 4470124 VKHB 2267  
 4540025 VKHB 2013  
 4560719 VKS 6195  
 4573681 VKHB 2213  
 4690299 VKHB 2214  
 4711928 VKHB 2203  
 5996248 VKHB 2016  
 5996253 VKHB 2268  
 60115335 VKHB 2169  
 7074945 VKHB 2178  
 7160360 VKHB 2059  
 7160361 VKHB 2173  
 7162191 VKHB 2060  
 7164410 VKHB 2154  
 7164487 VKHB 2199  
 7164543 VKHB 2210  
 7164544 VKHB 2080  
 7164705 VKHB 2208  
 7165686 VKHB 2061  
 7166346 VKHB 2137  
 7166349 VKHB 2074  
 71663499 VKHB 2074  
 7169934 VKHB 2255  
 7169935 VKHB 2182  
 7172951 VKHB 2252  
 7172952 VKHB 2251  
 7174945 VKHB 2178  
 7174946 VKHB 2051  
 7177004 VKHB 2212  
 7179838 VKS 6331  
 7603679 VKHB 2038  
 8576283 VKS 6163  
 8582739 VKHB 2065  
 86014686 VKS 6239  
 93160829 VKS 6325  
 93160832 VKS 6180  
 93803934 VKHB 2262  
 93803935 VKHB 2294  
 93806250 VKHB 2262  
 9980734 VKHB 2246  
 9980735 VKHB 2239  
 9980740 VKHB 2258  
 1102857 VKHB 2168



1102858 VKHB 2248  
 1102864 VKHB 2215  
 1104922 VKHB 2160  
 1104923 VKHB 2082  
 1109968 VKHB 2697  
 1905172 VKHB 2211  
 1905216 VKHB 2154  
 1905252 VKHB 2190  
 1905261 VKHB 2065  
 2475900 VKS 6360  
 3345908 VKS 6361  
 40100673 VKS 6363  
 40101093 VKS 6336  
 40101113 VKS 6337  
 40102103 VKS 6335  
 42062983 VKS 6362  
 42101665 VKHB 2286  
 4540025 VKHB 2013  
 4711928 VKHB 2203  
 60141947 VKHB 2199  
 7162944 VKHB 2170  
 7174945 VKHB 2331  
 8123913 VKHB 2074  
 8194950 VKHB 2243  
 8194959 VKHB 2186  
 8582740 VKHB 2179  
 99041057 VKHB 2030

### FORD

0634048 VKHB 2246  
 1583567 VKHB 2270  
 634 048 VKHB 2246  
 634048 VKHB 2246  
 634049 VKHB 2277  
 81AB 1238 AA VKHB 2270  
 A710 1215 CA VKHB 2310  
 A710X 1200 KA VKHB 2309  
 A790X 1242 DA VKHB 2311  
 A790X 1242 EA VKHB 2312  
 A790X 1242 FA VKHB 2142  
 A790X 1242 FA VKHB 2221  
 A790X 1242 FA VKHB 2313  
 TAJAA 1238 A VKHB 2041

### FRUEHAUF

A.JA 0564.001 VKS 6283  
 A.JA 0813.001 VKHB 2227  
 M 003168 VKHB 2279  
 M 00-3125 VKS 6252  
 M 200021-03 VKS 6364  
 M 200021-01 VKS 6365  
 M 200021-02 VKS 6366

### GIGANT (SEA)

0032-208 VKHB 2020  
 0032-210 VKHB 2017  
 0032-211 VKHB 2019  
 0032-214 VKHB 2284  
 0032-216 VKHB 2026  
 0032-218 VKHB 2030  
 0032-220 VKHB 2297  
 0032-310 VKHB 2070  
 0033-116 VKHB 2326  
 0033-118 VKHB 2331  
 0033-208 VKHB 2065  
 0033-213 VKHB 2051



### KÄSSBOHRER

4.753.458.000D VKS 6263  
 4.753.571.000 VKS 6258  
 4.753.656.000 VKS 6259  
 4.753.656.000E VKS 6259  
 4.753.799.000 VKS 6263  
 6.691.128.000 VKHB 2204  
 6.691.130.000 VKHB 2248  
 6.691.130.004 VKS 6294  
 6.691.130.004E VKS 6294  
 6.691.159.000 VKHB 2026

### MAN

6.691.161.000 VKHB 2030  
 6.691.168.000 VKHB 2004  
 6.691.383.000 VKHB 2071  
 6.691.383.000E VKHB 2071  
 6.691.450.000 VKHB 2281  
 6.691.453.000 VKHB 2160  
 06.32480.1000 VKHB 2282  
 06.32480.1200 VKHB 2169  
 06.32489.0002 VKHB 2065  
 06.32489.0009 VKHB 2172  
 06.32489.0012 VKHB 2161  
 06.32489.0019 VKHB 2168  
 06.32489.0021 VKHB 2248  
 06.32489.0032 VKHB 2164  
 06.32489.0044 VKHB 2067  
 06.32489.0045 VKHB 2173  
 06.32489.0051 VKHB 2170  
 06.32489.0060 VKHB 2169  
 06.32489.0063 VKHB 2216  
 06.32489.0066 VKHB 2293  
 06.32489.0071 VKHB 2160  
 06.32489.0072 VKHB 2240  
 06.32499.0005 VKHB 2033  
 06.32499.0013 VKHB 2004  
 06.32499.0016 VKHB 2070  
 06.32499.0036 VKHB 2082  
 06.32499.0040 VKHB 2222  
 06.32499.0044 VKHB 2163  
 06.32499.0046 VKHB 2051  
 06.32499.0048 VKHB 2074  
 06.32499.0058 VKHB 2046  
 06.32499.0063 VKHB 2020  
 06.32499.0079 VKHB 2018  
 06.32499.0081 VKHB 2132  
 06.32499.0096 VKHB 2162  
 06.32499.0097 VKHB 2165  
 06.32499.0103 VKHB 2137  
 06.32499.0108 VKHB 2214  
 06.32499.0126 VKHB 2146  
 06.32499.0127 VKHB 2146  
 06.32499.0131 VKHB 2222  
 06.32499.0155 VKHB 2163  
 06.32499.0175 VKHB 2179  
 06.32499.0177 VKHB 2314  
 06.32499.0066 VKHB 2016  
 06.56281.0605 VKS 6182  
 06.56289.0045 VKHB 2173  
 06.56289.0050 VKS 6197  
 06.56289.0052 VKS 6194  
 06.56289.0065 VKS 6183  
 06.56289.0143 VKS 6185  
 06.56289.0184 VKS 6192  
 06.56289.0186 VKS 6195  
 06.56289.0187 VKS 6191  
 06.56289.0223 VKS 6138



06.56289.0236  
06.56289.0241  
06.56289.0289  
06.56289.0289  
06.56289.0309  
06.56289.0315  
06.56289.0323  
06.56289.0324  
06.56289.0325  
06.56289.0334  
06.56289.0335  
06.56289.0365  
06.56289.0366  
06.56289.0385  
06.56289.0386  
81.52403.6000  
81.52403.6001  
81.52403.6005  
81.52403.6006  
81.93420.0072  
81.93420.0077  
81.93420.0162  
81.93420.0163  
81.93420.0285  
81.93420.6001  
81.93420.6009  
81.93420.6016  
81.96503.0161  
81.96503.0171  
81935010028  
87.52330.0200  
87.52330.0600

VKS 6186  
VKS 6186  
VKHB 2240  
VKS 6296  
VKS 6189  
VKS 6182  
VKS 6329  
VKS 6182  
VKS 6302  
VKS 6181  
VKS 6183  
VKS 6194  
VKS 6197  
VKS 6328  
VKS 6189  
VKS 6341  
VKS 6342  
VKS 6343  
VKS 6344  
VKHB 2068  
VKHB 2065  
VKHB 2174  
VKHB 2175  
VKHB 2320  
VKHB 2075  
VKHB 2272  
VKHB 2044  
VKS 6192  
VKS 6345  
VKHB 2243  
VKHB 2018  
VKHB 2019

**MERCEDES-BENZ**

000 980 42 02  
000 980 50 02  
000 980 54 02  
000 980 54 02  
000 980 55 02  
000 980 55 02  
000 980 72 02  
000 980 74 02  
000 980 75 02  
000 980 93 02  
000 980 96 02  
000 980 97 02  
000 981 03 05  
000 981 22 05  
000 981 24 01  
000 981 33 05  
000 981 36 05  
000 981 41 05  
000 981 46 05  
000 981 56 05  
000 981 59 05  
000 981 72 05  
000 981 74 05  
000 981 75 05  
000 981 79 05  
000 981 83 02  
000 981 84 05  
000 981 90 02  
000 981 90 05  
000 981 92 05  
000 981 94 05  
000 981 95 05  
000 981 96 05  
000 997 14 46  
000 997 74 46  
000720 032016

VKHB 2272  
VKHB 2055  
VKHB 2055  
VKHB 2055  
VKHB 2055  
VKHB 2055  
VKHB 2076  
VKHB 2076  
VKHB 2059  
VKHB 2271  
VKHB 2082  
VKHB 2162  
VKHB 2026  
VKHB 2080  
VKHB 2026  
VKHB 2019  
VKHB 2017  
VKHB 2079  
VKHB 2328  
VKHB 2041  
VKHB 2270  
VKHB 2026  
VKHB 2033  
VKHB 2083  
VKHB 2083  
VKHB 2059  
VKHB 2033  
VKHB 2060  
VKHB 2019  
VKHB 2079  
VKHB 2026  
VKHB 2007  
VKHB 2063  
VKS 6143  
VKS 6144  
VKHB 2157



000720 032019  
000720 032206  
000720 032210  
000720 032211  
000720 032216  
000720 032217  
000720 032304  
000720 032306  
000720 032307  
000720 032310  
000720 432210  
001 980 09 02  
001 980 26 02  
001 980 27 02  
001 980 29 02  
001 980 66 02  
001 980 67 02  
001 981 04 05  
001 981 05 05  
001 981 15 05  
001 981 29 05  
001 981 38 05  
001 981 38 05  
001 981 39 05  
001 981 45 05  
001 981 48 05  
001 981 56 05  
001 981 61 05  
001 981 64 05  
001 981 65 05  
001 981 70 05  
001 981 74 05  
001 981 82 02  
001 981 83 05  
001 981 84 05  
001 981 86 05  
001 981 87 05  
001 981 89 05  
001 981 90 05  
001 981 95 05  
002 981 00 05  
002 981 05 05  
002 981 05 05  
002 981 06 05  
002 981 12 05  
002 981 13 05  
002 981 16 05  
002 981 17 05  
002 981 18 05  
002 981 19 05  
002 981 20 05  
002 981 22 05  
002 981 24 05  
002 981 28 05  
002 981 54 05  
002 981 55 05  
002 981 56 05  
002 981 66 05  
002 981 79 05  
002 981 82 05  
002 981 86 05  
002 981 89 05  
002 981 90 05  
002 981 92 02  
002 981 95 05  
002 997 40 46  
002 997 65 47  
002 997 68 46  
002 997 84 47  
002 997 85 47  
003 981 00 05  
003 981 10 05  
003 981 11 05

VKHB 2161  
VKHB 2016  
VKHB 2017  
VKHB 2019  
VKHB 2026  
VKHB 2080  
VKHB 2058  
VKHB 2007  
VKHB 2063  
VKHB 2070  
VKHB 2017  
VKHB 2051  
VKHB 2161  
VKHB 2028  
VKHB 2151  
VKHB 2124  
VKHB 2158  
VKHB 2074  
VKHB 2075  
VKHB 2016  
VKHB 2070  
VKHB 2075  
VKHB 2075  
VKHB 2074  
VKHB 2083  
VKHB 2033  
VKHB 2063  
VKHB 2016  
VKHB 2306  
VKHB 2016  
VKHB 2063  
VKHB 2070  
VKHB 2070  
VKHB 2317  
VKHB 2019  
VKHB 2019  
VKHB 2007  
VKHB 2017  
VKHB 2058  
VKHB 2007  
VKHB 2041  
VKHB 2075  
VKHB 2075  
VKHB 2074  
VKHB 2191  
VKHB 2060  
VKHB 2200  
VKHB 2080  
VKHB 2080  
VKHB 2017  
VKHB 2058  
VKHB 2017  
VKHB 2019  
VKHB 2054  
VKHB 2161  
VKHB 2081  
VKHB 2081  
VKHB 2060  
VKHB 2068  
VKHB 2318  
VKHB 2028  
VKHB 2028  
VKHB 2082  
VKHB 2076  
VKHB 2155  
VKS 6145  
VKS 6146  
VKS 6147  
VKS 6148  
VKS 6148  
VKHB 2155  
VKHB 2057  
VKHB 2056



003 981 15 05  
003 981 16 05  
003 981 25 05  
003 981 26 05  
003 981 27 05  
003 981 28 05  
003 981 32 05  
003 981 37 05  
003 981 39 05  
003 981 41 05  
003 981 43 05  
003 981 45 05  
003 981 51 05  
003 981 52 05  
003 981 53 05  
003 981 56 05  
003 981 57 05  
003 981 64 05  
003 981 72 05  
003 981 74 05  
003 981 83 05  
003 981 85 05  
003 981 86 05  
003 981 95 05  
003 981 96 05  
003 997 14 46  
004 981 07 05  
004 981 09 05  
004 981 10 05  
004 981 17 05  
004 981 20 05  
004 981 21 05  
004 981 34 05  
004 981 38 05  
004 981 42 05  
004 981 46 05  
004 981 47 05  
004 981 48 05  
004 981 49 05  
004 981 64 05  
004 981 65 05  
004 981 67 05  
004 981 68 05  
004 997 18 47  
004 997 77 45  
005 981 00 05  
005 981 21 05  
005 981 31 05  
005 981 41 05  
005 981 44 05  
005 981 49 05  
005 981 53 05  
005 981 66 05  
005 981 69 05  
005 981 83 05  
005 981 84 05  
005 981 85 05  
005 981 86 05  
005 981 95 05  
005 981 98 05  
005 981 99 05  
005 997 44 46  
005 997 70 46  
006 981 01 05  
006 981 06 05  
006 981 07 05  
006 981 08 05  
006 981 42 05  
006 981 45 05  
006 981 47 05  
006 981 51 05  
006 981 52 05  
006 981 56 05

VKHB 2057  
VKHB 2056  
VKHB 2160  
VKHB 2162  
VKHB 2160  
VKHB 2162  
VKHB 2222  
VKHB 2051  
VKHB 2065  
VKHB 2214  
VKHB 2156  
VKHB 2165  
VKHB 2161  
VKHB 2066  
VKHB 2067  
VKHB 2066  
VKHB 2067  
VKHB 2063  
VKHB 2065  
VKHB 2051  
VKHB 2068  
VKHB 2066  
VKHB 2082  
VKHB 2057  
VKHB 2056  
VKS 6149  
VKHB 2163  
VKHB 2163  
VKHB 2165  
VKHB 2170  
VKHB 2323  
VKHB 2164  
VKHB 2064  
VKHB 2064  
VKHB 2041  
VKHB 2041  
VKHB 2041  
VKHB 2164  
VKHB 2061  
VKHB 2061  
VKHB 2061  
VKHB 2065  
VKS 6150  
VKS 6151  
VKHB 2072  
VKHB 2163  
VKHB 2071  
VKHB 2067  
VKHB 2156  
VKHB 2162  
VKHB 2017  
VKHB 2154  
VKHB 2044  
VKHB 2158  
VKHB 2124  
VKHB 2124  
VKHB 2158  
VKHB 2154  
VKHB 2154  
VKS 6176  
VKS 6152  
VKHB 2124  
VKHB 2026  
VKHB 2063  
VKHB 2002  
VKHB 2201  
VKHB 2191  
VKHB 2161  
VKHB 2151  
VKHB 2066  
VKHB 2060





006 981 62 05  
006 981 63 05  
006 981 97 05  
006 981 99 05  
006 997 04 46  
006 997 05 46  
006 997 21 47  
006 997 69 46  
007 981 00 05  
007 981 04 05  
007 981 14 05  
007 981 25 05  
007 981 57 05  
007 981 76 05  
007 997 36 46  
008 981 34 05  
008 981 58 05  
008 981 83 05  
008 981 84 05  
008 981 95 05  
009 981 08 05  
009 981 41 05  
009 981 43 05  
009 981 60 05  
009 981 81 05  
009 981 93 05  
009 997 39 47  
009 997 67 47  
009 997 92 47  
010 997 01 47  
010 997 24 47  
010 997 79 47  
010 997 81 47  
010 997 84 47  
010 997 86 47  
010 997 87 47  
011 981 68 05  
011 997 25 46  
011 997 54 46  
012 981 40 05  
012 997 11 47  
012 997 67 47  
012 997 91 47  
013 981 39 05  
013 981 42 05  
013 997 05 47  
013 997 06 47  
013 997 59 47  
013 997 94 47  
014 997 99 47  
015 997 01 47  
015 997 46 47  
015 997 56 47  
015 997 57 47  
015 997 58 47  
016 997 56 47  
016 997 77 47  
017 997 11 47  
019 997 48 47  
019 997 90 47  
020 997 05 47  
020 997 39 47  
021 997 89 47  
022 997 34 47  
022 997 52 47  
022 997 53 47  
022 997 59 47  
124 981 03 05  
124 981 03 05  
140 981 00 05  
319 981 00 05  
319 981 02 05  
319 981 04 05

VKHB 2320  
VKHB 2319  
VKHB 2321  
VKHB 2070  
VKS 6153  
VKS 6154  
VKS 6176  
VKS 6155  
VKHB 2164  
VKHB 2060  
VKHB 2234  
VKHB 2155  
VKHB 2156  
VKHB 2016  
VKS 6157  
VKHB 2165  
VKHB 2272  
VKHB 2159  
VKHB 2159  
VKHB 2233  
VKHB 2280  
VKHB 2191  
VKHB 2329  
VKHB 2191  
VKHB 2203  
VKHB 2156  
VKS 6348  
VKS 6158  
VKS 6174  
VKS 6173  
VKS 6172  
VKS 6178  
VKS 6270  
VKS 6178  
VKS 6173  
VKS 6172  
VKHB 2003  
VKS 6159  
VKS 6178  
VKHB 2326  
VKS 6174  
VKS 6288  
VKS 6175  
VKHB 2307  
VKHB 2280  
VKS 6181  
VKS 6346  
VKS 6183  
VKS 6181  
VKS 6299  
VKS 6299  
VKS 6299  
VKS 6299  
VKS 6197  
VKS 6194  
VKS 6183  
VKS 6257  
VKS 6255  
VKS 6150  
VKS 6349  
VKS 6334  
VKS 6353  
VKS 6315  
VKS 6347  
VKS 6351  
VKS 6350  
VKS 6352  
VKHB 2055  
VKHB 2055  
VKHB 2057  
VKHB 2018  
VKHB 2019  
VKHB 2017



319 981 06 05  
327 981 03 05  
327 981 04 05  
327 981 22 05  
335 997 00 47  
631 981 00 05

VKHB 2058  
VKHB 2033  
VKHB 2080  
VKHB 2080  
VKS 6160  
VKHB 2296

**MERCEDES-BENZ DISCOS**

007 981 70 05  
010 981 93 05

VKHB 2225  
VKHB 2002

**MONTENEGRO**

061001023  
061001026  
061001006

VKHB 2080  
VKHB 2080  
VKHB 2227

**PEUGEOT**

1300535080  
3326.27  
3326.41  
3730.20  
3730.22  
3735.15  
3735.18  
996253  
PSA 3326.41  
ZF04330648  
ZF04470124  
ZF05996248

VKHB 2302  
VKHB 2275  
VKHB 2302  
VKHB 2266  
VKHB 2016  
VKHB 2267  
VKHB 2268  
VKHB 2268  
VKHB 2302  
VKHB 2266  
VKHB 2267  
VKHB 2016

**RENAULT-RVI**

0023336033  
0023336034  
0023336042  
0023336074  
0023336078  
0023336081  
0023336124  
0023336246  
0023336864  
0023336874  
0024411680  
0024472286  
0024472569  
0024472667  
0024472709  
00546524  
00671980  
00785895  
0773230500  
0773230900  
0857596000  
50 00 788 712  
5000254793  
50003090069  
50003090902  
5000350029  
5000350189  
5000350270  
5000350272  
5000387566

VKHB 2282  
VKHB 2154  
VKHB 2287  
VKHB 2187  
VKHB 2056  
VKHB 2173  
VKHB 2187  
VKHB 2169  
VKHB 2185  
VKHB 2243  
VKS 6231  
VKS 6202  
VKS 6175  
VKS 6201  
VKS 6234  
VKHB 2065  
VKS 6201  
VKHB 2192  
VKHB 2294  
VKHB 2004  
VKHB 2236  
VKHB 2182  
VKHB 2170  
VKHB 2067  
VKHB 2190  
VKHB 2046  
VKHB 2047  
VKHB 2045  
VKS 6230  
VKS 6118



5000388284  
5000389250  
5000391585  
5000391891  
5000392236  
5000392237  
5000392404  
5000395649  
5000434273  
5000437791  
5000442185  
5000442186  
5000470672  
5000470673  
5000470861  
5000470862  
50005156060  
5000545227  
5000546524  
5000546916  
5000598486  
5000669957  
5000671980  
5000673467  
5000675250  
5000675627  
5000682662  
5000685691  
5000685835  
5000685836  
5000685837  
5000685838  
5000685898  
5000690018  
5000785261  
5000785895  
5000785898  
5000785909  
5000785910  
5000786298  
5000787789  
5000788063  
5000788202  
5000788490  
5000788712  
5000873122  
5000877056  
5003087034  
5003090060  
5003090061  
5003090069  
5003090900  
5003090901  
5003090902  
5003090903  
5010067534  
5010136663  
5010136758  
5010136759  
5010136762  
5010136767  
5010136769  
5010136770  
5010241096  
5010251382  
5516010033  
5516010498  
5516010506  
5516010573  
5516010574  
5516010587  
5516011446  
5516014042

VKHB 2018  
VKHB 2060  
VKHB 2191  
VKS 6229  
VKHB 2191  
VKHB 2060  
VKS 6238  
VKS 6219  
VKHB 2067  
VKHB 2051  
VKHB 2068  
VKHB 2068  
VKHB 2068  
VKHB 2066  
VKHB 2068  
VKHB 2066  
VKS 6305  
VKS 6239  
VKHB 2065  
VKS 6219  
VKHB 2061  
VKHB 2068  
VKS 6201  
VKHB 2182  
VKHB 2158  
VKHB 2194  
VKHB 2161  
VKHB 2199  
VKHB 2045  
VKHB 2047  
VKHB 2044  
VKHB 2046  
VKS 6306  
VKHB 2182  
VKS 6233  
VKHB 2192  
VKHB 2194  
VKHB 2194  
VKHB 2192  
VKHB 2061  
VKS 6234  
VKHB 2017  
VKHB 2017  
VKS 6140  
VKHB 2182  
VKHB 2051  
VKHB 2184  
VKS 6303  
VKHB 2184  
VKHB 2184  
VKHB 2067  
VKHB 2067  
VKHB 2179  
VKHB 2190  
VKHB 2057  
VKS 6175  
VKHB 2066  
VKHB 2057  
VKHB 2190  
VKHB 2065  
VKHB 2067  
VKHB 2051  
VKHB 2184  
VKHB 2161  
VKHB 2294  
VKHB 2045  
VKHB 2046  
VKHB 2016  
VKHB 2018  
VKHB 2019  
VKHB 2067  
VKHB 2047  
VKHB 2020



5516014319  
5516015596  
5516015599  
5516015803  
5516015839  
5516016788  
7701003394  
7703090029  
7703090034  
7703090098  
959232207  
23336006  
0003155310  
0023336006  
0023336044  
0023336046  
0023336123  
0023336246  
0024411680  
0024472286  
0024472667  
0024472709  
0773230500  
0773230700  
0959904216  
5000168317  
5000350020  
5000350029  
5000350189  
5000350270  
5000350272  
5000392404  
5000395649  
5000515606  
5000545227  
5000675627  
5000685691  
5000685838  
5000685839  
5000685898  
5000690018  
5000785261  
5000786298  
5000787789  
5000788063  
5000788202  
5001830654  
5003087034  
5003090068  
5010136762  
5010136766  
5010136767  
5010136769  
5516010574  
5516010587  
5516014042  
5516015596  
5516015599  
5516015803  
5516016788  
7701003394  
7703090085

VKHB 2048  
VKS 6236  
VKS 6237  
VKS 6130  
VKHB 2044  
VKHB 2044  
VKS 6235  
VKHB 2296  
VKHB 2188  
VKHB 2189  
VKHB 2018  
VKHB 2141  
VKS 6232  
VKHB 2042  
VKHB 2160  
VKHB 2186  
VKHB 2186  
VKHB 2169  
VKS 6231  
VKS 6202  
VKS 6201  
VKS 6234  
VKHB 2294  
VKHB 2063  
VKHB 2180  
VKS 6254  
VKHB 2048  
VKHB 2046  
VKHB 2047  
VKHB 2045  
VKS 6230  
VKS 6238  
VKS 6219  
VKS 6305  
VKS 6239  
VKHB 2194  
VKHB 2199  
VKHB 2046  
VKHB 2048  
VKS 6306  
VKHB 2182  
VKS 6233  
VKHB 2061  
VKS 6234  
VKHB 2017  
VKHB 2017  
VKHB 2320  
VKS 6303  
VKHB 2179  
VKHB 2065  
VKHB 2179  
VKHB 2067  
VKHB 2051  
VKHB 2019  
VKHB 2067  
VKHB 2020  
VKS 6236  
VKS 6237  
VKS 6130  
VKHB 2044  
VKS 6235  
VKHB 2016

## SAF

4 200 0011 00  
4 200 1006 00  
4.200.0014.00  
4.200.0011.00  
4.200.0012.00  
4.200.0015.00

VKHB 2016  
VKHB 2029  
VKHB 2198  
VKHB 2202  
VKHB 2201  
VKHB 2283



4.200.0027.00  
4.200.0028.00  
4.200.0033.00  
4.200.0034.00  
4.200.0055.00  
4.200.0057.00  
4.200.0058.00  
4.200.0060.00  
4.200.0063.00  
4.200.0064.00  
4.200.1007.00  
4.343.0008.00  
4.373.0002.00  
4.373.0003.00  
4.373.0005.00  
4.373.0006.00  
4.373.0008.00  
4.373.0010.00  
4.373.0012.00  
4.373.0013.00  
4.373.0014.00

## SCANIA

1104500  
1121456  
1121458  
121257  
1309342  
1309570  
1313719  
1329837  
1329838  
1334535  
1342363  
1342706  
1342708  
1362149  
1364631  
14102  
14103  
14623  
14698  
14764  
14835  
14836  
159496  
173320  
174717  
177893  
252914  
260998  
284843  
291060  
291076  
291463  
297991  
297999  
300278  
309113  
322748  
322749  
33352  
33948  
350984  
354076  
362226  
370074  
370075  
370076  
374330

VKHB 2030  
VKHB 2212  
VKHB 2003  
VKHB 2072  
VKHB 2214  
VKHB 2182  
VKHB 2061  
VKHB 2051  
VKHB 2067  
VKHB 2173  
VKHB 2050  
VKS 6312  
VKS 6309  
VKS 6310  
VKS 6292  
VKS 6311  
VKS 6312  
VKS 6249  
VKS 6314  
VKS 6310  
VKS 6313

VKS 6262  
VKS 6241  
VKS 6253  
VKS 6104  
VKS 6244  
VKHB 2048  
VKS 6272  
VKS 6241  
VKS 6242  
VKS 6254  
VKS 6242  
VKHB 2305  
VKS 6274  
VKHB 2004  
VKHB 2321  
VKHB 2033  
VKHB 2026  
VKHB 2004  
VKHB 2001  
VKHB 2002  
VKHB 2030  
VKHB 2003  
VKS 6106  
VKS 6108  
VKHB 2697  
VKHB 2033  
VKS 6123  
VKHB 2028  
VKHB 2065  
VKHB 2029  
VKS 6111  
VKS 6124  
VKS 6109  
VKS 6110  
VKS 6107  
VKS 6125  
VKHB 2024  
VKHB 2006  
VKS 6105  
VKHB 2031  
VKS 6126  
VKHB 2032  
VKHB 2281  
VKS 6109  
VKS 6124  
VKS 6111  
VKHB 2255



375086  
375087  
383343  
384045  
384047  
392039

VKS 6261  
VKS 6284  
VKHB 2147  
VKS 6242  
VKS 6241  
VKHB 2228

## SMB

M 003168  
M 00-3125  
M 200021-03  
M 200021-01  
M 200021-02

VKHB 2279  
VKS 6252  
VKS 6364  
VKS 6365  
VKS 6366

## TRAILOR

43752  
T6014000T000  
T6015000D000  
M003168  
43752  
M200021-03  
M200021-01  
M200021-02

VKS 6295  
VKHB 2226  
VKHB 2205  
VKHB 2279  
VKS 6295  
VKS 6364  
VKS 6365  
VKS 6366

## VOLKSWAGEN

091 517 185  
091 517 185 B  
113 517 185  
113 517 185 C  
113 517 185 D  
211 405 645 D  
251 405 645 B  
291 501 317 F  
291 501 319 B  
291 407 645  
293 501 319  
2D0 407 625  
2D0 501 319 A  
2D0 501 319 B  
900 070 9340  
999 059 06500

VKHB 2275  
VKHB 2275  
VKHB 2272  
VKHB 2272  
VKHB 2272  
VKHB 2270  
VKHB 2271  
VKS 6163  
VKHB 2017  
VKHB 2267  
VKHB 2060  
VKHB 2057  
VKHB 2017  
VKHB 2060  
VKHB 2270  
VKHB 2270

## VOLVO

1089552  
11073  
11137  
11148  
1194652  
1522372  
1522373  
1577624  
1587792  
1593459  
1594257  
1610078  
1610765  
16107658  
1611991  
1652119  
1652127  
1652563

VKS 6134  
VKHB 2007  
VKHB 2015  
VKHB 2074  
VKHB 2004  
VKS 6132  
VKS 6179  
VKS 6133  
VKS 6134  
VKS 6207  
VKS 6136  
VKS 6137  
VKS 6135  
VKS 6135  
VKS 6271  
VKHB 2697  
VKHB 2065  
VKHB 2173



1654320	VKHB 2228
1654326	VKHB 2066
1672249	VKS 6132
1696066	VKS 6138
1698580	VKHB 2029
1698582	VKS 6195
1699339	VKHB 2225
1699340	VKHB 2003
1699341	VKS 6297
181001 + 181002	VKHB 2039
181086	VKHB 2031
181128 + 181298	VKHB 2040
181133 + 183356	VKHB 2309
181278 + 181279	VKHB 2042
181299 + 181125	VKHB 2041
181325 + 181055	VKHB 2009
181338 + 181402	VKHB 2014
181348 + 181125	VKHB 2038
181546 + 181356	VKHB 2008
181584 + 181585	VKHB 2270
181596 + 181279	VKHB 2143
181664 + 183040	VKHB 2052
181669	VKHB 2001
183245	VKHB 2175
183326	VKHB 2053
183348	VKHB 2050
183351	VKHB 2029
183583	VKHB 2016
183648	VKHB 2182
183667	VKHB 2046
183684	VKHB 2018
183763	VKHB 2020
183765	VKHB 2017
183766	VKHB 2047
183767	VKHB 2046
183768	VKHB 2048
183769	VKHB 2019
183777	VKHB 2045
183778	VKHB 2044
183812 + 183813	VKHB 2023
183813	VKHB 2023
183817	VKHB 2021
184068	VKHB 2282
18424	VKHB 2074
18459	VKHB 2697
184623	VKHB 2169
184625	VKHB 2306
184672	VKHB 2051
184678	VKHB 2222
184679	VKHB 2065
184794	VKHB 2043
20428192	VKHB 2036
273394	VKS 6127
3090331	VKS 6298
3123521	VKS 6243
6771541	VKS 6139
6771769	VKS 6140
6772029	VKS 6141
6773195	VKS 6142
6876153	VKS 6163
7011137	VKHB 2015
7169934	VKHB 2255
8151816	VKHB 2024
8151820	VKHB 2036
942186	VKS 6127
944664	VKS 6113
944665	VKS 6115
944667	VKS 6114
946026	VKS 6128
946027	VKS 6129
947269	VKS 6130
947270	VKS 6131
947271	VKS 6239
968013	VKS 6202





VKHB 2001	FIAT-IVECO	26800580
	IVECO	1126887
	SCANIA	14698
VKHB 2002	VOLVO	181669
	DAF	0275823
	FIAT-IVECO	26800610
VKHB 2003	MERCEDES-BENZ	006 981 08 05
	SCANIA	14764
	FIAT-IVECO	26800390
VKHB 2004	MERCEDES-BENZ	011 981 68 05
	SAF	4.200.0033.00
	SCANIA	14836
VKHB 2006	VOLVO	1699340
	DAF	0140896
	DAF	283686
VKHB 2007	FIAT-IVECO	1110018
	FIAT-IVECO	1110019
	KÄSSBOHRER	6.691.168.000
VKHB 2008	MAN	06.32499.0013
	RENAULT-RVI	0773230900
	SCANIA	1362149
VKHB 2009	SCANIA	14623
	VOLVO	1194652
	SCANIA	322749
VKHB 2013	MERCEDES-BENZ	000 981 95 05
	MERCEDES-BENZ	000720 032306
	MERCEDES-BENZ	001 981 87 05
VKHB 2014	MERCEDES-BENZ	001 981 95 05
	VOLVO	11073
	VOLVO	181546 + 181356
VKHB 2015	DAF	202825
	VOLVO	181325 + 181055
	FIAT-IVECO	4540025
VKHB 2016	VOLVO	181338 + 181402
	VOLVO	11137
	VOLVO	7011137
VKHB 2017	CITROEN	3730.22
	CITROEN	ZF05996248
	DAF	491899
VKHB 2018	FIAT-IVECO	5996248
	MAN	06.34299.0066
	MERCEDES-BENZ	000720 032206
VKHB 2019	MERCEDES-BENZ	001 981 15 05
	MERCEDES-BENZ	001 981 61 05
	MERCEDES-BENZ	001 981 65 05
VKHB 2020	MERCEDES-BENZ	007 981 76 05
	PEUGEOT	3730.22
	PEUGEOT	ZF05996248
VKHB 2021	RENAULT-RVI	5516010506
	RENAULT-RVI	7703090085
	SAF	4 200 0011 00
VKHB 2022	VOLVO	183583
	FIAT-IVECO	26800160
	MERCEDES-BENZ	000 981 36 05
VKHB 2023	MERCEDES-BENZ	000720 032210
	MERCEDES-BENZ	000720 432210
	MERCEDES-BENZ	001 981 89 05
VKHB 2024	MERCEDES-BENZ	002 981 19 05
	MERCEDES-BENZ	002 981 22 05
	MERCEDES-BENZ	005 981 53 05
VKHB 2025	MERCEDES-BENZ	319 981 04 05
	RENAULT-RVI	5000788063
	RENAULT-RVI	5000788063
VKHB 2026	RENAULT-RVI	5000788202
	RENAULT-RVI	5000788202
	VOLKSWAGEN	291 501 319 B
VKHB 2027	VOLKSWAGEN	2D0 501 319 A
	VOLVO	183765
	MAN	06.32499.0079
VKHB 2028	MAN	87.52330.0200
	MERCEDES-BENZ	319 981 00 05
	RENAULT-RVI	5000388284



VKHB 2019	RENAULT-RVI	5516010573
	RENAULT-RVI	959232207
	VOLVO	183684
VKHB 2020	FIAT-IVECO	1125929
	FIAT-IVECO	26800170
	MAN	87.52330.0600
VKHB 2021	MERCEDES-BENZ	000 981 33 05
	MERCEDES-BENZ	000 981 90 05
	MERCEDES-BENZ	000720 032211
VKHB 2022	MERCEDES-BENZ	001 981 84 05
	MERCEDES-BENZ	001 981 86 05
	MERCEDES-BENZ	002 981 24 05
VKHB 2023	MERCEDES-BENZ	319 981 02 05
	RENAULT-RVI	5516010574
	RENAULT-RVI	5516010574
VKHB 2024	VOLVO	183769
	FIAT-IVECO	1110002
	FIAT-IVECO	26800140
VKHB 2025	MAN	06.32499.0063
	RENAULT-RVI	5516014042
	RENAULT-RVI	5516014042
VKHB 2026	VOLVO	183763
	VOLVO	183817
	VOLVO	183812 + 183813
VKHB 2027	VOLVO	183813
	SCANIA	322748
	VOLVO	8151816
VKHB 2028	KÄSSBOHRER	6.691.159.000
	MERCEDES-BENZ	000 981 03 05
	MERCEDES-BENZ	000 981 24 01
VKHB 2029	MERCEDES-BENZ	000 981 72 05
	MERCEDES-BENZ	000 981 94 05
	MERCEDES-BENZ	000720 032216
VKHB 2030	MERCEDES-BENZ	006 981 06 05
	SCANIA	14103
	BPW	02.6407.75.00
VKHB 2031	BPW	02.6410.29.00
	MERCEDES-BENZ	001 980 27 02
	MERCEDES-BENZ	002 981 86 05
VKHB 2032	MERCEDES-BENZ	002 981 89 05
	SCANIA	260998
	ARVIN MERITOR(ROR)	99041035 B
VKHB 2033	BPW	09.02.6407.65.00
	SAF	4 200 1006 00
	SCANIA	291060
VKHB 2034	VOLVO	1698580
	VOLVO	183351
	ARVIN MERITOR(ROR)	99041057
VKHB 2035	FIAT-IVECO	99041057
	KÄSSBOHRER	6.691.161.000
	SAF	4.200.0027.00
VKHB 2036	SCANIA	14835
	BPW	02.6405.95.00
	FIAT-IVECO	1905350
VKHB 2037	FIAT-IVECO	26800250
	SCANIA	33948
	VOLVO	181086
VKHB 2038	SCANIA	354076
	FIAT-IVECO	1103771
	MAN	06.32499.0005
VKHB 2039	MERCEDES-BENZ	000 981 74 05
	MERCEDES-BENZ	000 981 84 05
	MERCEDES-BENZ	001 981 48 05
VKHB 2040	MERCEDES-BENZ	327 981 03 05
	SCANIA	14102
	SCANIA	177893
VKHB 2041	DAF	490882
	VOLVO	20428192
	VOLVO	8151820
VKHB 2042	FIAT-IVECO	7603679
	VOLVO	181348 + 181125
	VOLVO	181001 + 181002



VKHB 2040	VOLVO	181128 + 181298
VKHB 2041	FORD	TAJAA 1238 A
	MERCEDES-BENZ	000 981 56 05
	MERCEDES-BENZ	002 981 00 05
	MERCEDES-BENZ	004 981 46 05
	MERCEDES-BENZ	004 981 47 05
	MERCEDES-BENZ	004 981 48 05
	VOLVO	181299 + 181125
VKHB 2042	DAF	174595
	RENAULT-RVI	0023336006
	VOLVO	181278 + 181279
VKHB 2043	DAF	0174592
	DAF	174592
	VOLVO	184794
VKHB 2044	MAN	81.93420.6016
	MERCEDES-BENZ	005 981 69 05
	RENAULT-RVI	5000685837
	RENAULT-RVI	5516015839
	RENAULT-RVI	5516016788
	RENAULT-RVI	5516016788
	VOLVO	183778
VKHB 2045	RENAULT-RVI	5000350270
	RENAULT-RVI	5000350270
	RENAULT-RVI	5000685835
	RENAULT-RVI	5516010033
	VOLVO	183777
VKHB 2046	MAN	06.32499.0058
	RENAULT-RVI	5000350029
	RENAULT-RVI	5000350029
	RENAULT-RVI	5000685838
	RENAULT-RVI	5000685838
	RENAULT-RVI	5516010498
	VOLVO	183667
	VOLVO	183767
VKHB 2047	RENAULT-RVI	5000350189
	RENAULT-RVI	5000350189
	RENAULT-RVI	5000685836
	RENAULT-RVI	5516011446
	VOLVO	183766
VKHB 2048	RENAULT-RVI	5000350020
	RENAULT-RVI	5000685839
	RENAULT-RVI	5516014319
	SCANIA	1309570
	VOLVO	183768
VKHB 2050	SAF	4.200.1007.00
	VOLVO	183348
VKHB 2051	ARVIN MERITOR(ROR)	99041045 B
	BPW	02.6407.65.00
	FIAT-IVECO	7174946
	MAN	06.32499.0046
	MERCEDES-BENZ	001 980 09 02
	MERCEDES-BENZ	003 981 37 05
	MERCEDES-BENZ	003 981 74 05
	RENAULT-RVI	5000437791
	RENAULT-RVI	5000873122
	RENAULT-RVI	5010136769
	RENAULT-RVI	5010136769
	SAF	4.200.0060.00
	VOLVO	184672
VKHB 2052	VOLVO	181664 + 183040
VKHB 2053	VOLVO	183326
VKHB 2054	FIAT-IVECO	4023140
	MERCEDES-BENZ	002 981 28 05
VKHB 2055	MERCEDES-BENZ	000 980 50 02
	MERCEDES-BENZ	000 980 54 02
	MERCEDES-BENZ	000 980 54 02
	MERCEDES-BENZ	000 980 55 02
	MERCEDES-BENZ	000 980 55 02
	MERCEDES-BENZ	124 981 03 05
	MERCEDES-BENZ	124 981 03 05
VKHB 2056	MERCEDES-BENZ	003 981 11 05
	MERCEDES-BENZ	003 981 16 05



	MERCEDES-BENZ	003 981 96 05
	RENAULT-RVI	0023336078
VKHB 2057	MERCEDES-BENZ	003 981 10 05
	MERCEDES-BENZ	003 981 15 05
	MERCEDES-BENZ	003 981 95 05
	MERCEDES-BENZ	140 981 00 05
	RENAULT-RVI	5003090903
	RENAULT-RVI	5010136758
	VOLKSWAGEN	2D0 407 625
VKHB 2058	MERCEDES-BENZ	000720 032304
	MERCEDES-BENZ	001 981 90 05
	MERCEDES-BENZ	002 981 20 05
	MERCEDES-BENZ	319 981 06 05
VKHB 2059	FIAT-IVECO	7160360
	MERCEDES-BENZ	000 980 75 02
	MERCEDES-BENZ	000 981 83 02
VKHB 2060	FIAT-IVECO	1101597
	FIAT-IVECO	7162191
	MERCEDES-BENZ	000 981 90 02
	MERCEDES-BENZ	002 981 13 05
	MERCEDES-BENZ	002 981 66 05
	MERCEDES-BENZ	006 981 56 05
	MERCEDES-BENZ	007 981 04 05
	RENAULT-RVI	5000389250
	RENAULT-RVI	5000392237
	VOLKSWAGEN	293 501 319
	VOLKSWAGEN	2D0 501 319 B
VKHB 2061	FIAT-IVECO	7165686
	MERCEDES-BENZ	004 981 64 05
	MERCEDES-BENZ	004 981 65 05
	MERCEDES-BENZ	004 981 67 05
	RENAULT-RVI	5000598486
	RENAULT-RVI	5000786298
	RENAULT-RVI	5000786298
	SAF	4.200.0058.00
VKHB 2063	FIAT-IVECO	1110016
	MERCEDES-BENZ	000 981 96 05
	MERCEDES-BENZ	000720 032307
	MERCEDES-BENZ	001 981 56 05
	MERCEDES-BENZ	001 981 70 05
	MERCEDES-BENZ	003 981 64 05
	MERCEDES-BENZ	006 981 07 05
	RENAULT-RVI	0773230700
VKHB 2064	MERCEDES-BENZ	004 981 34 05
	MERCEDES-BENZ	004 981 38 05
VKHB 2065	FIAT-IVECO	1905261
	FIAT-IVECO	8582739
	MAN	06.32489.0002
	MAN	81.93420.0077
	MERCEDES-BENZ	003 981 39 05
	MERCEDES-BENZ	003 981 72 05
	MERCEDES-BENZ	004 981 68 05
	RENAULT-RVI	00546524
	RENAULT-RVI	5000546524
	RENAULT-RVI	5010136762
	RENAULT-RVI	5010136762
	SCANIA	284843
	VOLVO	1652127
	VOLVO	184679
VKHB 2066	MERCEDES-BENZ	003 981 52 05
	MERCEDES-BENZ	003 981 56 05
	MERCEDES-BENZ	003 981 85 05
	MERCEDES-BENZ	006 981 52 05
	RENAULT-RVI	5000470673
	RENAULT-RVI	5000470862
	RENAULT-RVI	5010136663
	VOLVO	1654326
VKHB 2067	DAF	636820
	MAN	06.32489.0044
	MERCEDES-BENZ	003 981 53 05
	MERCEDES-BENZ	003 981 57 05
	MERCEDES-BENZ	005 981 41 05



	RENAULT-RVI	50003090069
	RENAULT-RVI	5000434273
	RENAULT-RVI	5003090069
	RENAULT-RVI	5003090900
	RENAULT-RVI	5010136767
	RENAULT-RVI	5010136767
	RENAULT-RVI	5010136767
	RENAULT-RVI	5516010587
	RENAULT-RVI	5516010587
	SAF	4.200.0063.00
VKHB 2068	DAF	614943
	MAN	81.93420.0072
	MERCEDES-BENZ	002 981 79 05
	MERCEDES-BENZ	003 981 83 05
	MERCEDES-BENZ	004 981 42 05
	RENAULT-RVI	5000442185
	RENAULT-RVI	5000442186
	RENAULT-RVI	5000470672
	RENAULT-RVI	5000470861
	RENAULT-RVI	5000669957
VKHB 2070	DAF	0556289
	DAF	626875
	FIAT-IVECO	1110020
	FIAT-IVECO	26800600
	MAN	06.32499.0016
	MERCEDES-BENZ	000720 032310
	MERCEDES-BENZ	001 981 29 05
	MERCEDES-BENZ	001 981 74 05
	MERCEDES-BENZ	001 981 82 02
	MERCEDES-BENZ	006 981 99 05
VKHB 2071	KÄSSBOHRER	6.691.383.000
	KÄSSBOHRER	6.691.383.000E
	MERCEDES-BENZ	005 981 31 05
VKHB 2072	BPW	02.6406.70.00
	FIAT-IVECO	26800640
	MERCEDES-BENZ	005 981 00 05
	SAF	4.200.0034.00
VKHB 2074	DAF	10890343
	FIAT-IVECO	7166349
	FIAT-IVECO	71663499
	FIAT-IVECO	8123913
	MAN	06.32499.0048
	MERCEDES-BENZ	001 981 04 05
	MERCEDES-BENZ	001 981 39 05
	MERCEDES-BENZ	002 981 06 05
	VOLVO	11148
	VOLVO	18424
VKHB 2075	MAN	81.93420.6001
	MERCEDES-BENZ	001 981 05 05
	MERCEDES-BENZ	001 981 38 05
	MERCEDES-BENZ	001 981 38 05
	MERCEDES-BENZ	002 981 05 05
	MERCEDES-BENZ	002 981 05 05
VKHB 2076	MERCEDES-BENZ	000 980 72 02
	MERCEDES-BENZ	000 980 74 02
	MERCEDES-BENZ	002 981 92 02
VKHB 2079	MERCEDES-BENZ	000 981 41 05
	MERCEDES-BENZ	000 981 92 05
VKHB 2080	FIAT-IVECO	26800230
	FIAT-IVECO	7164544
	MERCEDES-BENZ	000 981 22 05
	MERCEDES-BENZ	000720 032217
	MERCEDES-BENZ	002 981 17 05
	MERCEDES-BENZ	002 981 18 05
	MERCEDES-BENZ	327 981 04 05
	MERCEDES-BENZ	327 981 22 05
VKHB 2081	MERCEDES-BENZ	002 981 55 05
	MERCEDES-BENZ	002 981 56 05
VKHB 2082	DAF	676987
	FIAT-IVECO	1104923
	FIAT-IVECO	1104923
	MAN	06.32499.0036
	MERCEDES-BENZ	000 980 96 02



	MERCEDES-BENZ	002 981 90 05
	MERCEDES-BENZ	003 981 86 05
VKHB 2083	MERCEDES-BENZ	000 981 75 05
	MERCEDES-BENZ	000 981 79 05
	MERCEDES-BENZ	001 981 45 05
VKHB 2089	DAF	202825
VKHB 2124	FIAT-IVECO	1905027
	MERCEDES-BENZ	001 980 66 02
	MERCEDES-BENZ	005 981 84 05
	MERCEDES-BENZ	005 981 85 05
	MERCEDES-BENZ	006 981 01 05
VKHB 2131	DAF	325402
VKHB 2132	DAF	260204
	MAN	06.32499.0081
VKHB 2137	DAF	10901093
	DAF	254912
	FIAT-IVECO	7166346
	MAN	06.32499.0103
VKHB 2140	DAF	631780
VKHB 2141	DAF	0174595 + 174595
	RENAULT-RVI	23336006
VKHB 2142	DAF	325333
	FORD	A790X 1242 FA
VKHB 2143	DAF	260724
	VOLVO	181596 + 181279
VKHB 2144	DAF	260725
	DAF	535144
VKHB 2145	DAF	676988
VKHB 2146	DAF	0266488
	DAF	266488
	MAN	06.32499.0126
	MAN	06.32499.0127
VKHB 2147	DAF	0266487
	DAF	266487
	SCANIA	383343
VKHB 2151	FIAT-IVECO	4096587
	MERCEDES-BENZ	001 980 29 02
	MERCEDES-BENZ	006 981 51 05
VKHB 2154	FIAT-IVECO	1905216
	FIAT-IVECO	7164410
	MERCEDES-BENZ	005 981 66 05
	MERCEDES-BENZ	005 981 95 05
	MERCEDES-BENZ	005 981 98 05
	RENAULT-RVI	0023336034
VKHB 2155	MERCEDES-BENZ	002 981 95 05
	MERCEDES-BENZ	003 981 00 05
	MERCEDES-BENZ	007 981 25 05
VKHB 2156	MERCEDES-BENZ	003 981 43 05
	MERCEDES-BENZ	005 981 44 05
	MERCEDES-BENZ	007 981 57 05
	MERCEDES-BENZ	009 981 93 05
VKHB 2157	DAF	0640618
	MERCEDES-BENZ	000720 032016
VKHB 2158	MERCEDES-BENZ	001 980 67 02
	MERCEDES-BENZ	005 981 83 05
	MERCEDES-BENZ	005 981 86 05
	MERCEDES-BENZ	005 981 99 05
	RENAULT-RVI	5000675250
VKHB 2159	MERCEDES-BENZ	008 981 83 05
	MERCEDES-BENZ	008 981 84 05
VKHB 2160	FIAT-IVECO	1104922
	FIAT-IVECO	1104922
	KÄSSBOHRER	6.691.453.000
	MAN	06.32489.0071
	MERCEDES-BENZ	003 981 25 05
	MERCEDES-BENZ	003 981 27 05
	RENAULT-RVI	0023336044
VKHB 2161	MAN	06.32489.0012
	MERCEDES-BENZ	000720 032019
	MERCEDES-BENZ	001 980 26 02
	MERCEDES-BENZ	002 981 54 05
	MERCEDES-BENZ	003 981 51 05



	MERCEDES-BENZ	006 981 47 05			RENAULT-RVI	0023336046
	RENAULT-RVI	5000682662			RENAULT-RVI	0023336123
	RENAULT-RVI	5010241096		<b>VKHB 2187</b>	RENAULT-RVI	0023336074
<b>VKHB 2162</b>	FIAT-IVECO	41800341			RENAULT-RVI	0023336124
	MAN	06.32499.0096		<b>VKHB 2188</b>	RENAULT-RVI	7703090034
	MERCEDES-BENZ	000 980 97 02		<b>VKHB 2189</b>	BPW	02.6401.25.00
	MERCEDES-BENZ	003 981 26 05			RENAULT-RVI	7703090098
	MERCEDES-BENZ	003 981 28 05		<b>VKHB 2190</b>	FIAT-IVECO	1905252
	MERCEDES-BENZ	005 981 49 05			RENAULT-RVI	50003090902
<b>VKHB 2163</b>	MAN	06.32499.0044			RENAULT-RVI	5003090902
	MAN	06.32499.0155			RENAULT-RVI	5010136759
	MERCEDES-BENZ	004 981 07 05		<b>VKHB 2191</b>	MERCEDES-BENZ	002 981 12 05
	MERCEDES-BENZ	004 981 09 05			MERCEDES-BENZ	006 981 45 05
	MERCEDES-BENZ	005 981 21 05			MERCEDES-BENZ	009 981 41 05
<b>VKHB 2164</b>	MAN	06.32489.0032			MERCEDES-BENZ	009 981 60 05
	MERCEDES-BENZ	004 981 21 05			RENAULT-RVI	5000391585
	MERCEDES-BENZ	004 981 49 05			RENAULT-RVI	5000392236
	MERCEDES-BENZ	007 981 00 05		<b>VKHB 2192</b>	RENAULT-RVI	00785895
<b>VKHB 2165</b>	MAN	06.32499.0097			RENAULT-RVI	5000785895
	MERCEDES-BENZ	003 981 45 05			RENAULT-RVI	5000785910
	MERCEDES-BENZ	004 981 10 05		<b>VKHB 2194</b>	RENAULT-RVI	5000675627
	MERCEDES-BENZ	008 981 34 05			RENAULT-RVI	5000675627
<b>VKHB 2168</b>	FIAT-IVECO	1102857			RENAULT-RVI	5000785898
	MAN	06.32489.0019			RENAULT-RVI	5000785909
<b>VKHB 2169</b>	FIAT-IVECO	60115335		<b>VKHB 2198</b>	FIAT-IVECO	26800620
	MAN	06.32480.1200			SAF	4.200.0014.00
	MAN	06.32489.0060		<b>VKHB 2199</b>	FIAT-IVECO	60141947
	RENAULT-RVI	0023336246			FIAT-IVECO	7164487
	RENAULT-RVI	0023336246			RENAULT-RVI	5000685691
	VOLVO	184623			RENAULT-RVI	5000685691
<b>VKHB 2170</b>	FIAT-IVECO	7162944		<b>VKHB 2200</b>	FIAT-IVECO	1384728
	MAN	06.32489.0051			MERCEDES-BENZ	002 981 16 05
	MERCEDES-BENZ	004 981 17 05		<b>VKHB 2201</b>	FIAT-IVECO	1109981
	RENAULT-RVI	5000254793			FIAT-IVECO	26800370
<b>VKHB 2172</b>	MAN	06.32489.0009			MERCEDES-BENZ	006 981 42 05
<b>VKHB 2173</b>	FIAT-IVECO	7160361		<b>VKHB 2202</b>	SAF	4.200.0012.00
	MAN	06.32489.0045			FIAT-IVECO	26800350
	MAN	06.56289.0045			SAF	4.200.0011.00
	RENAULT-RVI	0023336081		<b>VKHB 2203</b>	FIAT-IVECO	4711928
	SAF	4.200.0064.00			MERCEDES-BENZ	009 981 81 05
	VOLVO	1652563		<b>VKHB 2204</b>	FIAT-IVECO	1126121
<b>VKHB 2174</b>	MAN	81.93420.0162			IVECO	26800040
<b>VKHB 2175</b>	MAN	81.93420.0163			KÄSSBOHRER	6.691.128.000
	VOLVO	183245		<b>VKHB 2205</b>	TRAILOR	T6015000D000
<b>VKHB 2177</b>	BPW	02.6410.24.00		<b>VKHB 2208</b>	FIAT-IVECO	7164705
	BPW	02.6408.80.00		<b>VKHB 2209</b>	FIAT-IVECO	1905220
<b>VKHB 2178</b>	BPW	02.64.10.23.00		<b>VKHB 2210</b>	FIAT-IVECO	7164543
	BPW	02.6408.90.00		<b>VKHB 2211</b>	FIAT-IVECO	1905172
	BPW	02.6410.23.00		<b>VKHB 2212</b>	FIAT-IVECO	26800270
	BPW	09.02.6408.90.00			FIAT-IVECO	7177004
	FIAT-IVECO	7074945			SAF	4.200.0028.00
	FIAT-IVECO	7174945		<b>VKHB 2213</b>	FIAT-IVECO	4573681
<b>VKHB 2179</b>	FIAT-IVECO	8582740		<b>VKHB 2214</b>	FIAT-IVECO	4690299
	MAN	06.32499.0175			MAN	06.32499.0108
	RENAULT-RVI	5003090068			MERCEDES-BENZ	003 981 41 05
	RENAULT-RVI	5003090901			SAF	4.200.0055.00
<b>VKHB 2179</b>	RENAULT-RVI	5010136766		<b>VKHB 2215</b>	FIAT-IVECO	1102864
	RENAULT-RVI	0959904216			FIAT-IVECO	1102864
<b>VKHB 2182</b>	FIAT-IVECO	7169935		<b>VKHB 2216</b>	FIAT-IVECO	1102860
	RENAULT-RVI	50 00 788 712			FIAT-IVECO	1103360
	RENAULT-RVI	5000673467			MAN	06.32489.0063
	RENAULT-RVI	5000690018		<b>VKHB 2217</b>	BPW	02.6407.65.00
	RENAULT-RVI	5000690018		<b>VKHB 2221</b>	DAF	325333
	RENAULT-RVI	5000788712			FORD	A790X 1242 FA
	SAF	4.200.0057.00		<b>VKHB 2222</b>	DAF	0221664
	VOLVO	183648			MAN	06.32499.0040
<b>VKHB 2184</b>	RENAULT-RVI	5000877056			MAN	06.32499.0131
	RENAULT-RVI	5003090060			MERCEDES-BENZ	003 981 32 05
	RENAULT-RVI	5003090061			VOLVO	184678
	RENAULT-RVI	5010136770		<b>VKHB 2225</b>	BPW	09.02.6407.85.00
<b>VKHB 2185</b>	RENAULT-RVI	0023336864			FIAT-IVECO	41800342
<b>VKHB 2186</b>	FIAT-IVECO	8194959			VOLVO	1699339



VKHB 2226	TRAILOR	T6014000T00
VKHB 2227	ARVIN MERITOR (ROR)	AJA 0813.001
VKHB 2228	SCANIA	392039
	VOLVO	1654320
VKHB 2231	DAF	1327603
VKHB 2232	DAF	0556290
VKHB 2233	MERCEDES-BENZ	008 981 95 05
VKHB 2234	MERCEDES-BENZ	007 981 14 05
VKHB 2236	DAF	0283684
	RENAULT-RVI	0857596000
VKHB 2237	DAF	RTC 3427
VKHB 2238	DAF	4805
	DAF	UKC 4805
VKHB 2239	DAF	494535
	DAF	RTC 3412
	FIAT-IVECO	9980735
VKHB 2240	MAN	06.32489.0072
	MAN	06.56289.0289
VKHB 2241	DAF	495520
VKHB 2242	DAF	491966
VKHB 2243	DAF	13H6552
	FIAT-IVECO	8194950
	MAN	81935010028
	RENAULT-RVI	0023336874
VKHB 2246	DAF	494536
	DAF	RTC 3436
	FIAT-IVECO	9980734
	FORD	0634048
	FORD	634 048
	FORD	634048
VKHB 2248	FIAT-IVECO	1102858
	KÄSSBOHRER	6.691.130.000
	MAN	06.32489.0021
VKHB 2249	FIAT-IVECO	1905222
VKHB 2250	FIAT-IVECO	1905221
VKHB 2251	FIAT-IVECO	7172952
	IVECO	1905273
VKHB 2252	FIAT-IVECO	7172951
VKHB 2253	FIAT-IVECO	1905219
VKHB 2255	FIAT-IVECO	7169934
	SCANIA	374330
	VOLVO	7169934
VKHB 2258	FIAT-IVECO	9980740
VKHB 2262	FIAT-IVECO	26800330
	FIAT-IVECO	93803934
	FIAT-IVECO	93806250
VKHB 2266	CITROEN	3730.20
	CITROEN	ZF04330648
	FIAT-IVECO	4330648
	PEUGEOT	3730.20
	PEUGEOT	ZF04330648
VKHB 2267	CITROEN	3735.15
	CITROEN	ZF04470124
	FIAT-IVECO	4470124
	PEUGEOT	3735.15
	PEUGEOT	ZF04470124
	VOLKSWAGEN	291 407 645
VKHB 2268	CITROEN	3735.18
	CITROEN	996253
	FIAT-IVECO	5996253
	PEUGEOT	3735.18
	PEUGEOT	996253
VKHB 2270	FIAT-IVECO	4096104
	FORD	1583567
	FORD	81AB 1238 AA
	MERCEDES-BENZ	000 981 59 05
	VOLKSWAGEN	211 405 645 D
	VOLKSWAGEN	900 070 9340
	VOLKSWAGEN	999 059 06500
	VOLVO	181584 + 181585
VKHB 2271	MERCEDES-BENZ	000 980 93 02
	VOLKSWAGEN	251 405 645 B



VKHB 2272	MAN	81.93420.6009
	MERCEDES-BENZ	000 980 42 02
	MERCEDES-BENZ	008 981 58 05
	VOLKSWAGEN	113 517 185
	VOLKSWAGEN	113 517 185 C
	VOLKSWAGEN	113 517 185 D
VKHB 2275	CITROEN	3326.27
	FIAT-IVECO	4330647
	PEUGEOT	3326.27
	VOLKSWAGEN	091 517 185
	VOLKSWAGEN	091 517 185 B
VKHB 2277	FORD	634049
VKHB 2279	FRUEHAUF	M003168
	SMB	M003168
	TRAILOR	M003168
VKHB 2280	MERCEDES-BENZ	009 981 08 05
	MERCEDES-BENZ	013 981 42 05
VKHB 2281	KÄSSBOHRER	6.691.450.000
	SCANIA	362226
VKHB 2282	FIAT-IVECO	1102042
	MAN	06.32480.1000
	RENAULT-RVI	0023336033
	VOLVO	184068
VKHB 2283	FIAT-IVECO	1102859
	SAF	4.200.0015.00
VKHB 2284	FIAT-IVECO	1103142
VKHB 2285	FIAT-IVECO	1905300
VKHB 2286	FIAT-IVECO	42101665
VKHB 2287	RENAULT-RVI	0023336042
VKHB 2293	MAN	06.32489.0066
	FIAT-IVECO	93803935
	RENAULT-RVI	0773230500
	RENAULT-RVI	0773230500
	RENAULT-RVI	5010251382
VKHB 2296	MERCEDES-BENZ	631 981 00 05
	RENAULT-RVI	7703090029
VKHB 2297	ARVIN MERITOR(ROR)	99041058
	FIAT-IVECO	1905351
VKHB 2298	ARVIN MERITOR (ROR)	99041067
VKHB 2299	ARVIN MERITOR (ROR)	99041068
VKHB 2302	CITROEN	1300535080
	CITROEN	3326.41
	CITROEN	PSA 3326.41
	PEUGEOT	1300535080
	PEUGEOT	3326.41
	PEUGEOT	PSA 3326.41
VKHB 2303	BPW	02.6410.25.00
	BPW	09.02.6406.50.00
VKHB 2305	SCANIA	1342706
VKHB 2306	DAF	0699117
	MERCEDES-BENZ	001 981 64 05
	VOLVO	184625
VKHB 2307	MERCEDES-BENZ	013 981 39 05
VKHB 2309	FORD	A710X 1200 KA
	VOLVO	181133 + 183356
VKHB 2310	FORD	A710 1215 CA
VKHB 2311	FORD	A790X 1242 DA
VKHB 2312	FORD	A790X 1242 EA
VKHB 2313	DAF	325333
	FORD	A790X 1242 FA
VKHB 2314	MAN	06.32499.0177
VKHB 2315	ARVIN MERITOR (ROR)	99041075
VKHB 2317	MERCEDES-BENZ	001 981 83 05
VKHB 2318	MERCEDES-BENZ	002 981 82 05
VKHB 2319	MERCEDES-BENZ	006 981 63 05
VKHB 2320	MAN	81.93420.0285
	MERCEDES-BENZ	006 981 62 05
	RENAULT-RVI	5001830654
VKHB 2321	MERCEDES-BENZ	006 981 97 05
	SCANIA	1364631
VKHB 2323	MERCEDES-BENZ	004 981 20 05
VKHB 2326	MERCEDES-BENZ	012 981 40 05





VKHB 2328	MERCEDES-BENZ	000 981 46 05
VKHB 2329	MERCEDES-BENZ	009 981 43 05
VKHB 2331	FIAT-IVECO	7174945
VKHB 2332	DAF	10901094
VKHB 2333	DAF	10271961
VKHB 2697	FIAT-IVECO	1109968
	SCANIA	174717
	VOLVO	1652119
	VOLVO	18459
	ARVIN MERITOR (ROR)	99041058
VKHB 2698	ARVIN MERITOR (ROR)	99041067
VKHB 2699	ARVIN MERITOR (ROR)	99041068w



VKS 6102	DAF	494505
VKS 6104	SCANIA	121257
VKS 6105	FIAT-IVECO	38510549
	SCANIA	33352
VKS 6106	SCANIA	159496
VKS 6107	SCANIA	300278
VKS 6108	SCANIA	173320
VKS 6109	SCANIA	297991
	SCANIA	370074
VKS 6110	SCANIA	297999
VKS 6111	SCANIA	291076
	SCANIA	370076
VKS 6113	VOLVO	944664
VKS 6114	VOLVO	944667
VKS 6115	VOLVO	944665
VKS 6118	RENAULT-RVI	5000387566
VKS 6120	DAF	494537
VKS 6123	SCANIA	252914
VKS 6124	SCANIA	291463
	SCANIA	370075
VKS 6125	SCANIA	309113
VKS 6126	SCANIA	350984
VKS 6127	VOLVO	273394
	VOLVO	942186
VKS 6128	VOLVO	946026
VKS 6129	VOLVO	946027
VKS 6130	RENAULT-RVI	5516015803
	RENAULT-RVI	5516015803
	VOLVO	947269
VKS 6131	VOLVO	947270
VKS 6132	VOLVO	1522372
	VOLVO	1672249
VKS 6133	VOLVO	1577624
VKS 6134	VOLVO	1089552
	VOLVO	1587792
VKS 6135	VOLVO	1610765
	VOLVO	16107658
VKS 6136	VOLVO	1594257
VKS 6137	VOLVO	1610078
VKS 6138	MAN	06.56289.0223
	VOLVO	1696066
VKS 6139	VOLVO	6771541
VKS 6140	DAF	678157
	RENAULT-RVI	5000788490
	VOLVO	6771769
VKS 6141	VOLVO	6772029
VKS 6142	VOLVO	6773195
VKS 6143	MERCEDES-BENZ	000 997 14 46
VKS 6144	MERCEDES-BENZ	000 997 74 46
VKS 6145	MERCEDES-BENZ	002 997 40 46
VKS 6146	MERCEDES-BENZ	002 997 65 47
VKS 6147	MERCEDES-BENZ	002 997 68 46
VKS 6148	MERCEDES-BENZ	002 997 84 47
	MERCEDES-BENZ	002 997 85 47
VKS 6149	MERCEDES-BENZ	003 997 14 46
VKS 6150	MERCEDES-BENZ	004 997 18 47
	MERCEDES-BENZ	019 997 48 47
VKS 6151	MERCEDES-BENZ	004 997 77 45
VKS 6152	MERCEDES-BENZ	005 997 70 46
VKS 6153	MERCEDES-BENZ	006 997 04 46
VKS 6154	MERCEDES-BENZ	006 997 05 46
VKS 6155	MERCEDES-BENZ	006 997 69 46
VKS 6157	MERCEDES-BENZ	007 997 36 46
VKS 6158	MERCEDES-BENZ	009 997 67 47
VKS 6159	MERCEDES-BENZ	011 997 25 46
VKS 6160	MERCEDES-BENZ	335 997 00 47
VKS 6163	FIAT-IVECO	8576283
	VOLKSWAGEN	291 501 317 F
	VOLVO	6876153
VKS 6164	DAF	117326
VKS 6165	DAF	259939
	DAF	259940



VKS 6166	DAF	213688
VKS 6167	DAF	196479
VKS 6168	DAF	190164
VKS 6169	DAF	647330
VKS 6170	DAF	325321
VKS 6171	DAF	0190069
	DAF	190069
VKS 6172	MERCEDES-BENZ	010 997 24 47
	MERCEDES-BENZ	010 997 87 47
VKS 6173	MERCEDES-BENZ	010 997 01 47
	MERCEDES-BENZ	010 997 86 47
VKS 6174	MERCEDES-BENZ	009 997 92 47
	MERCEDES-BENZ	012 997 11 47
VKS 6175	MERCEDES-BENZ	012 997 91 47
	RENAULT-RVI	0024472569
	RENAULT-RVI	5010067534
VKS 6176	MERCEDES-BENZ	005 997 44 46
	MERCEDES-BENZ	006 997 21 47
VKS 6178	MERCEDES-BENZ	010 997 79 47
	MERCEDES-BENZ	010 997 84 47
	MERCEDES-BENZ	011 997 54 46
VKS 6179	VOLVO	1522373
VKS 6180	DAF	0292766
	DAF	292766
	FIAT-IVECO	93160832
VKS 6181	MAN	06.56289.0334
	MERCEDES-BENZ	013 997 05 47
	MERCEDES-BENZ	013 997 94 47
VKS 6182	MAN	06.56281.0605
	MAN	06.56289.0315
	MAN	06.56289.0324
VKS 6183	MAN	06.56289.0065
	MAN	06.56289.0335
	MERCEDES-BENZ	013 997 59 47
	MERCEDES-BENZ	016 997 56 47
VKS 6185	MAN	06.56289.0143
VKS 6186	MAN	06.56289.0236
	MAN	06.56289.0241
VKS 6189	MAN	06.56289.0309
	MAN	06.56289.0386
VKS 6191	MAN	06.56289.0187
VKS 6192	MAN	06.56289.0184
	MAN	81.96503.0161
VKS 6194	MAN	06.56289.0052
	MAN	06.56289.0365
	MERCEDES-BENZ	015 997 58 47
VKS 6195	FIAT-IVECO	4560719
	MAN	06.56289.0186
	VOLVO	1698582
VKS 6197	MAN	06.56289.0050
	MAN	06.56289.0366
	MERCEDES-BENZ	015 997 57 47
VKS 6201	RENAULT-RVI	0024472667
	RENAULT-RVI	0024472667
	RENAULT-RVI	00671980
	RENAULT-RVI	5000671980
VKS 6202	RENAULT-RVI	0024472286
	RENAULT-RVI	0024472286
	VOLVO	968013
VKS 6204	FRUEHAUF	T6502085P
	IVECO	2479949
VKS 6205	ARVIN MERITOR(ROR)	21200321 A
VKS 6207	VOLVO	1593459
VKS 6208	FIAT-IVECO	40100093
VKS 6210	FIAT-IVECO	40001793
	FIAT-IVECO	407001793
VKS 6211	FIAT-IVECO	40100043
	FIAT-IVECO	40100113
VKS 6212	FIAT-IVECO	40001943
VKS 6213	FIAT-IVECO	40100063
	FIAT-IVECO	40100663
VKS 6214	FIAT-IVECO	2475977



VKS 6215	FIAT-IVECO	40002850
	FIAT-IVECO	40002851
	FIAT-IVECO	40002853
VKS 6216	FIAT-IVECO	40001933
	FIAT-IVECO	40100110
VKS 6217	FIAT-IVECO	40000763
VKS 6218	FIAT-IVECO	40003733
	FIAT-IVECO	40100670
VKS 6219	RENAULT-RVI	5000395649
	RENAULT-RVI	5000395649
	RENAULT-RVI	5000546916
VKS 6220	FIAT-IVECO	40001913
VKS 6221	FIAT-IVECO	40001903
VKS 6222	FIAT-IVECO	40000953
VKS 6223	FIAT-IVECO	40100103
VKS 6224	FIAT-IVECO	40000691
	FIAT-IVECO	40000693
VKS 6225	FIAT-IVECO	40003723
	FIAT-IVECO	40100443
VKS 6227	FIAT-IVECO	40001880
	FIAT-IVECO	40001883
VKS 6228	FIAT-IVECO	40101353
VKS 6229	RENAULT-RVI	5000391891
VKS 6230	RENAULT-RVI	5000350272
	RENAULT-RVI	5000350272
VKS 6231	RENAULT-RVI	0024411680
	RENAULT-RVI	0024411680
VKS 6232	RENAULT-RVI	0003155310
VKS 6233	RENAULT-RVI	5000785261
	RENAULT-RVI	5000785261
VKS 6234	RENAULT-RVI	0024472709
	RENAULT-RVI	0024472709
	RENAULT-RVI	5000787789
	RENAULT-RVI	5000787789
VKS 6235	RENAULT-RVI	7701003394
	RENAULT-RVI	7701003394
VKS 6236	RENAULT-RVI	5516015596
	RENAULT-RVI	5516015596
VKS 6237	RENAULT-RVI	5516015599
	RENAULT-RVI	5516015599
VKS 6238	RENAULT-RVI	5000392404
	RENAULT-RVI	5000392404
VKS 6239	ARVIN MERITOR(ROR)	5000545227
	FIAT-IVECO	86014686
	RENAULT-RVI	5000545227
	RENAULT-RVI	5000545227
	VOLVO	947271
VKS 6241	SCANIA	1121456
	SCANIA	1329837
	SCANIA	384047
VKS 6242	SCANIA	1329838
	SCANIA	1342363
	SCANIA	384045
VKS 6243	VOLVO	3123521
VKS 6244	SCANIA	1309342
VKS 6245	FIAT-IVECO	40100651
	FIAT-IVECO	40100653
VKS 6246	FIAT-IVECO	40000480
VKS 6247	FIAT-IVECO	40100463
VKS 6249	SAF	4.373.0010.00
VKS 6250	BPW	02.5664.55.64
	BPW	02.5664.57.00
	BPW	02.5665.57.00
VKS 6251	BPW	02.5664.56.64
	BPW	02.5664.58.00
VKS 6252	FRAUHAUF	M00-3125
	SMB	M00-3125
VKS 6253	SCANIA	1121458
VKS 6254	RENAULT-RVI	5000168317
	SCANIA	1334535
VKS 6255	MERCEDES-BENZ	017 997 11 47
VKS 6257	MERCEDES-BENZ	016 997 77 47

VKS 6258	KÄSSBOHRER	4.753.571.000
VKS 6259	KÄSSBOHRER	4.753.656.000
	KÄSSBOHRER	4.753.656.000E
VKS 6260	ARVIN MERITOR(ROR)	21220158
VKS 6261	SCANIA	375086
VKS 6262	SCANIA	1104500
VKS 6263	KÄSSBOHRER	4.753.458.000D
	KÄSSBOHRER	4.753.799.000
VKS 6266	DAF	491901
VKS 6267	DAF	490881
VKS 6270	MERCEDES-BENZ	010 997 81 47
VKS 6271	VOLVO	1611991
VKS 6272	SCANIA	1313719
VKS 6274	SCANIA	1342708
VKS 6283	FRUEHAUF	A.JA 0564.001
VKS 6284	SCANIA	375087
VKS 6285	BPW	02.5664.26.57
VKS 6286	BPW	02.5664.64.57
VKS 6287	BPW	02.5664.46.57
	SAF	0.256.6446.57
VKS 6288	MERCEDES-BENZ	012 997 67 47
VKS 6289	DAF	10907034
VKS 6290	DAF	491968
	DAF	AMK 4386
	SAF	4.373.0005.00
VKS 6292	DAF	493296
VKS 6293	DAF	RTC 3512
VKS 6294	KÄSSBOHRER	6.691.130.004
	KÄSSBOHRER	6.691.130.004E
	TRAILOR	43752
VKS 6295	MAN	06.56289.0289
VKS 6296	MAN	1699341
VKS 6297	VOLVO	3090331
VKS 6298	VOLVO	014 997 99 47
VKS 6299	MERCEDES-BENZ	015 997 01 47
	MERCEDES-BENZ	015 997 46 47
	MERCEDES-BENZ	015 997 56 47
VKS 6302	MAN	06.56289.0325
VKS 6303	RENAULT-RVI	5003087034
	RENAULT-RVI	5003087034
VKS 6305	RENAULT-RVI	5000515606
	RENAULT-RVI	50005156060
VKS 6306	RENAULT-RVI	5000685898
	RENAULT-RVI	5000685898
VKS 6309	SAF	4.373.0002.00
VKS 6310	SAF	4.373.0003.00
	SAF	4.373.0013.00
VKS 6311	SAF	4.373.0006.00
VKS 6312	SAF	4.343.0008.00
	SAF	4.373.0008.00
VKS 6313	SAF	4.373.0014.00
VKS 6314	SAF	4.373.0012.00
VKS 6315	MERCEDES-BENZ	021 997 89 47
VKS 6316	FIAT-IVECO	40102273
VKS 6318	FIAT-IVECO	2477421
VKS 6319	FIAT-IVECO	2475845
VKS 6320	FIAT-IVECO	2477558
VKS 6321	FIAT-IVECO	1109981
	FIAT-IVECO	2478619
VKS 6322	FIAT-IVECO	40101733
VKS 6323	FIAT-IVECO	40101643
VKS 6324	FIAT-IVECO	40102333
VKS 6325	FIAT-IVECO	93160829
VKS 6326	FIAT-IVECO	40102143
VKS 6328	MAN	06.56289.0385
VKS 6329	MAN	06.56289.0323
VKS 6330	FIAT-IVECO	40102321
VKS 6331	FIAT-IVECO	7179838
VKS 6332	FIAT-IVECO	3427559
VKS 6333	DAF	1238034
VKS 6334	MERCEDES-BENZ	020 997 05 47
VKS 6335	FIAT-IVECO	40102103



VKS 6336	FIAT-IVECO	40101093
VKS 6337	FIAT-IVECO	40101113
VKS 6341	MAN	81.52403.6000
VKS 6342	MAN	81.52403.6001
VKS 6343	MAN	81.52403.6005
VKS 6344	MAN	81.52403.6006
VKS 6345	MAN	81.96503.0171
VKS 6346	MERCEDES-BENZ	013 997 06 47
VKS 6347	MERCEDES-BENZ	022 997 34 47
VKS 6348	MERCEDES-BENZ	009 997 39 47
VKS 6349	MERCEDES-BENZ	019 997 90 47
VKS 6350	MERCEDES-BENZ	022 997 53 47
VKS 6351	MERCEDES-BENZ	022 997 52 47
VKS 6352	MERCEDES-BENZ	022 997 59 47
VKS 6353	MERCEDES-BENZ	020 997 39 47
VKS 6354	BPW	02.5664.68.00
VKS 6357	DAF	AMPB 584
VKS 6358	DAF	AJU 1901
VKS 6360	FIAT-IVECO	2475900
VKS 6361	FIAT-IVECO	3345908
VKS 6362	FIAT-IVECO	42062983
VKS 6363	FIAT-IVECO	40100673
VKS 6364	FRAUHAUF, SMB, TRAILOR	M200021-03
VKS 6365	FRAUHAUF, SMB, TRAILOR	M200021-01
VKS 6366	FRAUHAUF, SMB, TRAILOR	M200021-02





07087 X/K-07210 X  
 10R 33108 A  
 1380/Q/1328/Q  
 18690/18620/Q  
 18790/18720/Q  
 25590/Q/25520/Q  
 2789/2720/QCL7C  
 30205 J2/Q  
 30209 J2/Q  
 30215 J2/Q  
 30216 J2/Q  
 30217 J2/Q  
 30218 J2  
 30220 J2  
 30221 J2  
 30305 J2  
 30307 J2/Q  
 30309 J2/Q  
 30311 J2/Q  
 30312 J2/Q  
 32006 X/Q  
 32008 X/Q  
 32010 X/Q  
 32010 X/QCL7CVB026  
 32011 X/Q  
 32012 X/QCL7C  
 32013 X/Q  
 32014 X/Q  
 32015 X/Q  
 32016 X/Q  
 32017 X/Q  
 32018 X/Q  
 32019 X/Q  
 32020 X/Q  
 32021 X/Q  
 32021X/528595  
 32022 X/Q  
 32024 X  
 32206 J2/Q  
 32207 J2/Q  
 32208 J2/Q  
 32209 J2/Q  
 32210 J2/Q  
 32211 J2/Q  
 32214 J2/Q  
 32215 J2/Q  
 32216 J2/Q  
 32217 J2/Q  
 32218 J2/Q  
 32219 J2  
 32219 J2/VB129  
 32220 J2  
 32221 J2  
 32304 J2/Q  
 32305 J2  
 32306 J2/Q  
 32306 JR  
 32307 J2/Q  
 32308 J2/Q  
 32309 BJ2/QCL7C  
 32309 J2/Q  
 32310 J2/Q  
 32310 J2/QU4  
 32310 TN9  
 32311 J2  
 32312 J2/Q  
 32314 J2/Q  
 33011/Q  
 33012/Q  
 33013/Q  
 33014  
 33015/Q



VKHB 2238  
 VKHB 2268  
 VKHB 2055  
 VKHB 2239  
 VKHB 2246  
 VKHB 2309  
 VKHB 2054  
 VKHB 2189  
 VKHB 2296  
 VKHB 2168  
 VKHB 2204  
 VKHB 2697  
 VKHB 2248  
 VKHB 2164  
 VKHB 2215  
 VKHB 2262  
 VKHB 2202  
 VKHB 2201  
 VKHB 2198  
 VKHB 2283  
 VKHB 2267  
 VKHB 2188  
 VKHB 2191  
 VKHB 2275  
 VKHB 2060  
 VKHB 2234  
 VKHB 2199  
 VKHB 2154  
 VKHB 2282  
 VKHB 2157  
 VKHB 2169  
 VKHB 2170  
 VKHB 2161  
 VKHB 2306  
 VKHB 2160  
 VKHB 2323  
 VKHB 2281  
 VKHB 2216  
 VKHB 2016  
 VKHB 2018  
 VKHB 2020  
 VKHB 2015  
 VKHB 2017  
 VKHB 2019  
 VKHB 2284  
 VKHB 2033  
 VKHB 2026  
 VKHB 2080  
 VKHB 2030  
 VKHB 2031  
 VKHB 2210  
 VKHB 2297  
 VKHB 2212  
 VKHB 2058  
 VKHB 2294  
 VKHB 2007  
 VKHB 2317  
 VKHB 2063  
 VKHB 2001  
 VKHB 2236  
 VKHB 2004  
 VKHB 2070  
 VKHB 2299  
 VKHB 2303  
 VKHB 2002  
 VKHB 2003  
 VKHB 2072  
 VKHB 2156  
 VKHB 2045  
 VKHB 2047  
 VKHB 2044  
 VKHB 2046

33016/Q  
 33017/Q  
 33018/Q  
 33019/Q  
 33020/Q  
 33020/QVB091  
 33021/Q  
 33021/QVB091  
 33022  
 330356 A/Q  
 331074/Q  
 33108/Q  
 33109/Q  
 33111 JR  
 33111/Q  
 33112/QVB259  
 33113/Q  
 33113/QVB022  
 33115/Q  
 33116/Q  
 33116/TN9/QCLNVB091  
 33117/Q  
 33118 TN9/QVT621  
 33118/Q  
 331293/Q  
 331933/Q  
 331974 A/Q  
 33205/QVQ077  
 33206/Q  
 33207/Q  
 33208 JR-1/33208 J  
 33208/Q  
 33209/Q  
 33210/Q  
 33211/Q  
 33212/Q  
 33213 JR  
 33213/Q  
 33214/Q  
 33215/Q  
 33216/Q  
 33216/QVB091  
 33217/Q  
 33220  
 332330 B/Q  
 33287/Q/33462/Q  
 33822/Q/33895/Q  
 3490/TIM.3420  
 3581/3525/Q  
 3585/Q/3525/Q  
 368 A/362 A/Q  
 3780/Q/3720/Q  
 3782/3720  
 387 A/382 A/Q  
 394 A/395 S  
 39580/W/2/39520/2/Q  
 39581/39520/Q  
 39590/39520/Q  
 3984/3920  
 42687/42620  
 45291/TIM.45220  
 47490/47420  
 47678/Q/47620/Q  
 47686/47620/Q  
 47687/47620/Q  
 48393/48320  
 495 AX/493  
 495/493  
 504376 A  
 52375/52618  
 529656  
 537/532 X/Q



VKHB 2140  
 VKHB 2321  
 VKHB 2048  
 VKHB 2082  
 VKHB 2124  
 VKHB 2145  
 VKHB 2162  
 VKHB 2146  
 VKHB 2163  
 VKHB 2079  
 VKHB 2081  
 VKHB 2190  
 VKHB 2056  
 VKHB 2318  
 VKHB 2059  
 VKHB 2233  
 VKHB 2214  
 VKHB 2159  
 VKHB 2222  
 VKHB 2326  
 VKHB 2298  
 VKHB 2158  
 VKHB 2178  
 VKHB 2331  
 VKHB 2155  
 VKHB 2132  
 VKHB 2172  
 VKHB 2057  
 VKHB 2179  
 VKHB 2182  
 VKHB 2320  
 VKHB 2065  
 VKHB 2067  
 VKHB 2068  
 VKHB 2061  
 VKHB 2173  
 VKHB 2319  
 VKHB 2051  
 VKHB 2066  
 VKHB 2028  
 VKHB 2194  
 VKHB 2232  
 VKHB 2225  
 VKHB 2165  
 VKHB 2071  
 VKHB 2311  
 VKHB 2075  
 VKHB 2242  
 VKHB 2009  
 VKHB 2089  
 VKHB 2258  
 VKHB 2310  
 VKHB 2131  
 VKHB 2277  
 VKHB 2034  
 VKHB 2036  
 VKHB 2088  
 VKHB 2175  
 VKHB 2074  
 VKHB 2039  
 VKHB 2241  
 VKHB 2076  
 VKHB 2221  
 VKHB 2313  
 VKHB 2142  
 VKHB 2144  
 VKHB 2312  
 VKHB 2333  
 VKHB 2328  
 VKHB 2185  
 VKHB 2064  
 VKHB 2014

547518  
 567/563  
 580/572/Q  
 580486  
 582/572/Q  
 593 X/594/Q  
 594/592 A/Q  
 621/612  
 6386/K-6320/Q  
 64432/64708  
 6581 X/6535  
 663/653/Q  
 681 A/672  
 683/672  
 687/672  
 749 A/Q/742/Q  
 801785  
 BT1-0084/Q  
 BT1-0163/Q  
 BT1B 328251/Q  
 BT1B 328286/Q  
 BT1B 639417/Q  
 CK-47487/SK-47420/Q  
 CK-598 A/K-592 A  
 H 212749/H 212710  
 HM 212049/HM 212010  
 HM 215249/HM 215210  
 HM 218248/W/2A/210/2A/Q  
 HM 220110/Q/HM 220149/Q  
 HM 220149 A/W/110/QV002  
 JF 9549/9510  
 JH 211749/JH 211710  
 JH 415647/JH 415610  
 JHM 720249/JHM 720210  
 JM 205149/110/Q  
 JM 207049/JM 207010  
 JM 511946/Q/JM 511910/Q  
 JM 714249/210/Q  
 JXC 25370CA/JXC 25370DA  
 JXC 25678 CA  
 JXC 25716 C/JXC 25716 D  
 K-387 A/K-382  
 KHM.220110/567549  
 L 33114/QCLNVQ276/R 33114/  
 QCLNVQ276  
 L 68149/110/Q  
 LM 11949/910/Q  
 LM 12749/710/Q  
 LM 300849/811/QCL7A  
 LM 48548/510/Q  
 R 32217 J2/QVB128/L 32217/Q  
 R 33209/QCLNVB323/L 33209/  
 QCLNVQ276  
 RBT1B 329138/QVQ276/34478/2/  
 QVQ276  
 RT2ED 070/QCLNVB061/LT2ED 070/  
 QCLN  
 T2ED 045  
 T2ED 050/Q  
 T2ED 055/QCLN  
 T2ED 070/QCLNVB061  
 T2EE 060/Q  
 T2EE 100  
 T3FE 075/QVB481  
 XAA 32008 X  
 XC 8640 CD/HM 220110

VKHB 2174  
 VKHB 2208  
 VKHB 2041  
 VKHB 2314  
 VKHB 2038  
 VKHB 2180  
 VKHB 2040  
 VKHB 2008  
 VKHB 2013  
 VKHB 2187  
 VKHB 2213  
 VKHB 2043  
 VKHB 2141  
 VKHB 2042  
 VKHB 2143  
 VKHB 2052  
 VKHB 2307  
 VKHB 2280  
 VKHB 2315  
 VKHB 2240  
 VKHB 2293  
 VKHB 2053  
 VKHB 2200  
 VKHB 2083  
 VKHB 2332  
 VKHB 2286  
 VKHB 2050  
 VKHB 2029  
 VKHB 2285  
 VKHB 2032  
 VKHB 2192  
 VKHB 2287  
 VKHB 2203  
 VKHB 2186  
 VKHB 2023  
 VKHB 2021  
 VKHB 2243  
 VKHB 2137  
 VKHB 2250  
 VKHB 2302  
 VKHB 2253  
 VKHB 2276  
 VKHB 2329  
 VKHB 2252  
 VKHB 2237  
 VKHB 2270  
 VKHB 2271  
 VKHB 2272  
 VKHB 2151  
 VKHB 2211  
 VKHB 2249  
 VKHB 2209  
 VKHB 2251  
 VKHB 2184  
 VKHB 2255  
 VKHB 2006  
 VKHB 2024  
 VKHB 2228  
 VKHB 2147  
 VKHB 2231  
 VKHB 2266  
 VKHB 2305



d	D	W		d	D	W	
14,5	16,5	13	VKS 6349	100	135	13	VKS 6164
40	72	7	VKS 6293	100	135	13	VKS 6169
44	85	10/8	VKS 6229	100	135	15/13	VKS 6260
48	62	10	VKS 6228	100	140	15	VKS 6259
50	65	8	VKS 6179	100	140	17	VKS 6207
50	70	9/8	VKS 6262	100	140	20,5/15	VKS 6333
52	72	12	VKS 6149	102	135,3	13	VKS 6166
53	68	10,5	VKS 6230	104	130	33/15	VKS 6332
53	97	11/10	VKS 6219	105	130	12	VKS 6358
58	80	10/8	VKS 6236	105	136	13	VKS 6215
62	80	10/9,5	VKS 6299	105	136	13	VKS 6323
63,5	88,9	11,13	VKS 6120	105	140	18	VKS 6345
68	85	10	VKS 6325	107,6	152,6	19,5	VKS 6252
68	90	10	VKS 6231	108	140	14	VKS 6241
68,3	80	8	VKS 6118	109	140	19	VKS 6134
70	81,5	6	VKS 6146	110	128	9	VKS 6309
70	81,5	6,5	VKS 6263	110	130	12	VKS 6142
70	90	10	VKS 6163	110	130	12	VKS 6348
70	90	14,5	VKS 6316	110	130	13	VKS 6237
72	100	10	VKS 6170	110	130	13	VKS 6360
75	90	8	VKS 6305	110	130	14	VKS 6253
75	90	10/9,5	VKS 6346	110	130	50/18	VKS 6320
75	95	13	VKS 6159	110	140	12	VKS 6107
75	100	10	VKS 6105	110	140	13	VKS 6144
75	100	12	VKS 6148	110	140	13	VKS 6186
75	100	13	VKS 6143	110	140	14	VKS 6361
75	100	13	VKS 6227	110	140	15	VKS 6284
75	100	13	VKS 6272	110	140	17	VKS 6141
76	137	15,5/10	VKS 6341	110	140	17	VKS 6297
77	103/98,4	19,3	VKS 6137	110	140	13/12	VKS 6255
78	103	18	VKS 6298	110	146	27	VKS 6295
80	95	8	VKS 6130	110	152,6	16,5	VKS 6364
80	100	10	VKS 6238	110	152,6	19,5	VKS 6365
80	100	12/9,5	VKS 6288	110	152,6	19,5	VKS 6366
81	100	10	VKS 6296	111	146	24,5	VKS 6204
81	100	15,5/10	VKS 6342	112	136,8	10,5	VKS 6110
84	113	18	VKS 6271	114	152	14,8	VKS 6330
85	110	13	VKS 6131	114	170/114	27/14	VKS 6171
85	110	13	VKS 6235	115	140	13/12	VKS 6178
85	114,5	12,5	VKS 6290	115	150	13	VKS 6151
86	105	6/5	VKS 6315	115	156	17,9	VKS 6133
90	110	13	VKS 6173	115	136,7	8	VKS 6250
90	110	13	VKS 6221	115	154/142	28	VKS 6168
90	110	120	VKS 6266	117	139/137	32	VKS 6113
90	120	13	VKS 6153	120	140	13	VKS 6138
90	130	17	VKS 6267	120	140	13	VKS 6310
90	112,7	12,85	VKS 6147	120	140	13/12	VKS 6319
92	125	17	VKS 6167	120	140	15,5/13,5	VKS 6303
93	110	13	VKS 6314	120	145	15	VKS 6154
95	110	10/9,5	VKS 6239	120	145	14,2/12	VKS 6352
95	115	10	VKS 6302	120	145	15/12	VKS 6270
95	115	13	VKS 6321	120	150	15	VKS 6150
95	115	14	VKS 6208	120	150	15	VKS 6234
95	115	13/12	VKS 6172	120	152	22,7	VKS 6205
95	120	13	VKS 6155	120	160	17	VKS 6140
95	120	10/9,5	VKS 6329	120	160	15/13	VKS 6201
95	120	13/12	VKS 6174	120	157,5	20	VKS 6354
95	130	16	VKS 6326	121	170	17/15,5	VKS 6324
95	155	8	VKS 6294	123	160	33	VKS 6318
98,5	123,8	20,6/14	VKS 6289	123	167	17,5	VKS 6242
100	120	10	VKS 6217	125	143	13	VKS 6285
100	120	12	VKS 6202	125	150	13	VKS 6216
100	120	13	VKS 6157	125	150	13	VKS 6312
100	125	13	VKS 6175	125	150	14	VKS 6254
100	130	12	VKS 6182	125	150	15/13	VKS 6176
100	130	12	VKS 6247	125	150	15/13	VKS 6257
100	130	13	VKS 6158	125	160	15	VKS 6261
100	130	13	VKS 6220	125	160	17	VKS 6126
100	130	14	VKS 6211	125	160	17	VKS 6180
100	130	17	VKS 6357	125	152,4	15	VKS 6145
100	130	18,5	VKS 6306	127	169,8	14	VKS 6129



d	D	W		d	D	W	
128	148	12	VKS 6337				
128	152,3	25	VKS 6335				
130	160	16	VKS 6328				
134	152	13	VKS 6210				
134	152	14	VKS 6245				
135	165	17	VKS 6139				
135	170	18/15,75	VKS 6258				
135	156,7	12/8	VKS 6251				
137	161,9	15/12	VKS 6109				
140	110	14	VKS 6361				
140	160	12	VKS 6308				
140	160	14	VKS 6223				
140	160	13/11	VKS 6249				
140	160	13/12	VKS 6233				
140	164	23,5/20	VKS 6132				
140	170	13,5	VKS 6212				
140	170	14	VKS 6213				
145	167	13	VKS 6287				
145	170	13	VKS 6246				
145	170	15/12	VKS 6111				
145	175	14	VKS 6183				
145	175	16	VKS 6189				
145	175	17	VKS 6136				
145	175	17	VKS 6353				
145	175	13/12	VKS 6181				
145	175	19/17	VKS 6243				
145	205/175	20/18	VKS 6334				
148	170,2	31,5	VKS 6115				
150	168	13	VKS 6222				
150	170	12	VKS 6362				
150	170	14	VKS 6336				
150	170	15	VKS 6313				
150	180	13/11	VKS 6160				
155	180	29/24	VKS 6124				
158	188	18/14,5	VKS 6244				
160	180	10	VKS 6194				
160	180	10	VKS 6197				
160	180	15	VKS 6292				
160	185	14	VKS 6165				
160	188	14	VKS 6286				
162	191	12,4	VKS 6123				
162	187,3	12,7	VKS 6125				
168	192,5	30/12	VKS 6135				
170	190	15	VKS 6191				
170	190	15/12	VKS 6185				
180	200	12	VKS 6218				
180	200	12	VKS 6225				
180	200	12	VKS 6363				
180	200	15	VKS 6224				
180	200	15	VKS 6311				
180	200	17	VKS 6322				
107,5	153	25	VKS 6283				
107,6	152,6	19,5	VKS 6252				
117,4	142,8	12,7	VKS 6108				
117,4	152,4	22,17	VKS 6214				
120,6	152,4	13	VKS 6128				
133,3	180	17	VKS 6331				
133,3	155,6	14	VKS 6114				
134,5	155,6	9,5	VKS 6232				
136,5	162	12,7	VKS 6104				
148,5	180,3	26,7	VKS 6127				
149,9	176	16	VKS 6274				
150,8	177,8	12,7	VKS 6106				
152,4	178	12	VKS 6307				
52,39	66,67	7,94	VKS 6102				
53,98	76,2	12,5	VKS 6152				
87,26	120,7	15,4	VKS 6192				

# Remarks

## ARVIN MERITOR (ROR)

- 1) Grease lubricated

## BPW

- 1) Lowloader
- 2) Except lowloader

## CITROËN

- 4) Ch.-604496, 1982-89
- 5) Ch.604497-, 1889-90
- 6) Left wheel, Ch.-289710, 1982-86
- 7) Right wheel, Ch.-289710, 1982-86
- 8) Left wheel, Ch.289711-, 1986-93
- 9) Right wheel, Ch.289711-, 1986-93
- 10) 1982-87
- 11) Left wheel, Ch.-289710, 1982-87
- 12) Right wheel, Ch.-289710, 1982-87
- 13) Left wheel, Ch.289711-, 1987
- 14) Right wheel, Ch.289711-, 1987
- 15) Ch.-604496, 1987-89
- 16) Ch.604497-, 1989-93
- 17) Left wheel, 1987-93
- 18) Right wheel, 1987-93
- 19) Ch.-604496, 1986-89
- 20) 1986-93
- 21) 1973-75
- 22) 1973-88
- 24) Left wheel, 1986-93
- 25) Right wheel, 1986-93

## DAF

- 1) Single rear wheel
- 2) Dual rear wheel
- 3) Track width 1718 mm, with 10 bolts hub
- 4) Track width 1655 mm, with 8 bolts hub
- 5) Except hub centration
- 6) With hub centration
- 7) With hub centration. Black seal
- 8) With hub centration. Blue seal
- 9) With hub reduction
- 10) Except FAR
- 11) With FAR
- 12) Except FA, FT
- 13) With FA, FT
- 14) Except hub centration. Black seal
- 15) Except hub centration. Blue seal
- 16) Black seal
- 17) Blue seal
- 18) 1983-85
- 19) Ch.237886-, single rear wheel
- 21) 1984-85
- 22) 1985-12/89
- 23) -12/89
- 24) Oil Seal/ABS-ring not integrated

## FIAT – IVECO

- 4) Left wheel
- 5) Right wheel
- 6) Left wheel, 10/77-05/79
- 7) Right wheel, 10/77-05/79
- 8) Left wheel, 06/79-06/81
- 9) Right wheel, 06/79-06/81
- 10) 10/77-06/81
- 11) Left wheel, 06/81-09/84
- 12) Right wheel, 06/81-09/84
- 13) 06/81-09/84
- 14) Left wheel, 10/84-88
- 15) Right wheel, 10/84-88
- 16) 10/84-88
- 17) 03/85-88
- 18) Ch.-604496, 1982-89
- 19) Ch.604497-, 1989-93
- 20) Left wheel, ch.-278757, 1982-86
- 21) Right wheel, ch.-278757, 1982-86
- 22) Left wheel, ch.278758-, 1986-93
- 23) Right wheel, ch.278758-, 1986-93
- 24) 1982-86
- 25) Ch.-604496, 1986-89
- 26) Left wheel, 1986-93
- 27) Right wheel, 1986-93
- 28) 10/77-12/86
- 29) 01/87-
- 30) Except 50-9 D, 50-9 V
- 31) 04/91-04/92
- 32) 01/85-
- 33) Disc brakes
- 34) 12/85-
- 36) 1991-94
- 37) Left wheel, 1991-94
- 38) Right wheel, 1991-94
- 39) Except ABS
- 40) Except models for Switzerland
- 41) Models for Switzerland
- 42) Ratio 4.23/1
- 43) Except ratio 4.23/1
- 44) Ratio 4.23/1. Except models for Switzerland
- 45) Except ratio 4.23/1. Except models for Switzerland
- 46) Except ratio 3.79/1
- 47) Ratio 3.79/1
- 48) CH. -173788
- 49) Ch.173789-. Axle -1824487
- 50) Ch.173789-. Axle 1824488-
- 51) Ch.173789-
- 52) 95 mm inner bearing bore diameter
- 53) 105 mm inner bearing bore diameter. Axle -1824487
- 54) 105 mm inner bearing bore diameter. Axle 1824488-
- 55) Steering axle. Non-steering axle, Spare part No 7177196
- 56) Non-steering axle, Spare part No 7177168
- 57) 100 mm inner bearing bore diameter
- 58) Axle -1824487
- 59) Axle 1824488-
- 60) Left wheel, 06/79-01/97
- 61) Right wheel, 06/79-01/97
- 62) 06/81-01/97
- 63) Left wheel, 06/81-88
- 64) Right wheel, 06/81-88
- 65) Except ratio 5.22/1. -02/96
- 66) Ratio 5.22/1. -02/96
- 67) Left wheel, 06/79-02/96
- 68) Right wheel, 06/79-02/96
- 69) 10/77-09/84
- 70) Except "Iveco check control"
- 71) "Iveco check control"
- 72) Left wheel, -02/96



# Remarks

- 73) Right wheel, -02/96
- 74) -02/96
- 75) Ratio 5.62/1
- 76) Except ratio 5.62/1
- 77) ABS
- 78) Left wheel, 03/85-88
- 79) Right wheel, 03/85-88
- 81) 02/96
- 82) 03/96-
- 83) 1994-
- 84) 1996-
- 85) Single row taper roller bearings
- 86) Double row taper roller bearing
- 87) Non-steering axle
- 88) Steering axle
- 89) Front wheel drive
- 90) Except front wheel drive

## FORD

- 1) 1965-91
- 2) 07/74-12/77
- 3) 08/65-12/77
- 5) 01/71-12/77
- 6) 11/73-12/77
- 7) 01/78-10/85
- 8) Left wheel, 11/85-91
- 9) Right wheel, 11/85-91
- 10) 11/85-91
- 11) 1992-97
- 12) 01/81-03/87
- 13) 03/87-12/92

## FRUEHAUF

- 1) 107, 6 mm axle, with brakes CI/C2
- 2) 110 mm axle, with brakes D1/K1/H1
- 3) 110 mm axle, with brakes C1/C2/L1/L2 (100 teeth)
- 4) 110 mm axle, with brakes C3/C5 (80 teeth)

## MAN

- 1) -11/93
- 2) 12/93-
- 3) W25/86-W27/90
- 4) W28/90-
- 5) Non ABS
- 6) ABS
- 7) 01/90-
- 8) Hub. 81.35701.0081
- 9) Hub. 81.35701.0127
- 10) 20" TRILEX
- 11) Hub. 81.35701.0141
- 12) Except "TRILEX"
- 13) "TRILEX"
- 14) -W18/94
- 15) W19/94-
- 16) -W27/96
- 17) W28/96-, 19.5" hub
- 18) W28/96-, 20/22.5" hub

## MERCEDES-BENZ

- 3) 1983-94
- 4) Ch.-48630
- 5) Ch.48631-
- 6) Diesel engine ch.-17768, petrol engine ch.-1288
- 7) Diesel engine ch.17768-78114, petrol engine ch.1289-4706
- 8) Diesel engine ch.78115-, petrol engine ch.4707-
- 9) 55 mm inner bearing bore diameter
- 20) Axle -1358880
- 11) Axle 1358881-
- 13) Axle -1278813
- 14) Axle 1278814-
- 19) Axle -1390839
- 20) Axle 1390840-
- 21) Axle -1278313
- 22) Axle 1278314-
- 24) Drum brake
- 25) With ABS, axle -021298
- 26) With ABS, axle 021299-
- 27) Axle -724723
- 28) Axle 724724-
- 29) Hub: 355 356 44 01
- 30) Hub: 346 356 30 01
- 34) Twin wheels
- 35) 1995-98
- 36) 1996-98
- 37) Hub: 668 356 01 01, 668 356 02 01
- 38) Hub: 972 356 01 01
- 39) Hub: 976 356 11 01
- 40) Hub: 678 356 04 01
- 41) Hub: 675 356 01 01
- 42) Disc brake
- 43) Hub: 942 334 08 01
- 44) Hub: 942 334 07 01, 949 334 05 01

## MONTENEGRO

- 1) Axle 061001243, 061001243A
- 2) Axle 06-1-1068
- 3) Axle 06-1-1176, 061001231
- 4) Axle 061001271
- 5) Axle 061001231A
- 6) Axle 061001230, 061001230A
- 7) Axle 06-1-1025
- 8) Axle 061001170A
- 9) Axle 061001299
- 10) Axle 061001210, 061001210B, 061001295
- 11) Axle 06-1-1103, 06-1-1170
- 12) Axle 06-1-1100, 06-1-1102, 06-1-1106, 06-1-1108, 06-1-1173, 06-1-1174

# Remarks

## PEUGEOT

- 1) Ch.-604496, 1982-89
- 2) Ch.604497-, 1989-92
- 3) Left wheel, Ch.-244300, 1982-85
- 4) Right wheel, Ch.-244300, 1982-85
- 5) Left wheel, Ch.244301-, 1986-92
- 6) Right wheel, Ch.244301-, 1986-92
- 7) Ch.-604496, 1988-89
- 8) Ch.604497-, 1989-92
- 9) Left wheel, 1988-92
- 10) Right wheel, 1988-92
- 11) Left wheel, 1982-92
- 12) Right wheel, 1982-92
- 13) Ch.-604496, 1986-89
- 14) 1986-92
- 15) 1967-09/70
- 16) 10/70-80
- 17) 1967-80
- 18) 1980-88

## RVI

- 12) -14/06/85
- 13) 17/06/85-
- 14) -12/82
- 15) 01/83-
- 16) -15/11/85
- 17) 18/11/85-
- 18) -1986
- 19) 1987-
- 22) 07/86-
- 23) -14/03/84
- 24) 15/03/84-
- 25) 10/84-01/86
- 26) 02/86-
- 27) -09/84
- 28) -01/86
- 29) 10/84-
- 30) -09/83
- 31) 10/83-
- 33) -08/79
- 34) 09/79-
- 35) -08/84 MOT 62030
- 36) -12/83
- 37) 01/84-
- 38) -12/85
- 39) 01/86-
- 40) 12/92-
- 41) -05/91
- 42) 06/91-03/93
- 43) 04/93-
- 44) -08/84 MOT 62030. -N 1539
- 45) -08/84 MOT 62030. N 1540-
- 46) -08/93
- 47) 09/93-
- 48) Except ABS. -08/91
- 49) ABS. -08/91
- 50) 09/91-03/93
- 51) 09/91-
- 52) -03/93
- 53) -08/91
- 54) -07/90
- 55) 08/90-
- 56) -02/91
- 57) 03/91-
- 58) -09/90
- 59) -02/92

- 60) 03/92-
- 61) -05/95
- 62) 06/95-
- 63) Drum brakes
- 64) Disc brakes
- 65) -02/85
- 66) 03/85-
- 67) -17/11/93
- 68) 18/11/93-
- 69) 10/87-
- 70) ABS
- 71) -12/92
- 72) 01/93-
- 73) 01/77-14/03/84
- 74) 03/86-
- 75) Except ABS. -08/91. Except "Trilex".
- 76) ABS. -08/91. Except "Trilex".
- 77) "Trilex"-20". -03/93.
- 78) "Trilex"-24". -03/93.
- 79) 09/91-03/93. Except "Trilex".
- 80) -02/86
- 81) -12/87
- 82) Locking nut M75. -05/91
- 83) Locking nut M70. -05/91
- 84) Except ABS
- 85) With ABS
- 86) -05/95
- 87) 06/95-
- 88) -03/89
- 89) 04/89-
- 90) 1973-1989
- 91) Except engine G9T
- 92) With engine G9T
- 93) -1983
- 94) 1984-1985
- 95) 1986-02/89
- 96) 03/89-. Inner bearing 35x72x24,5
- 97) 03/89-. Inner bearing 35x62x18
- 98) -03/89
- 99) 04/89-
- 100) -06/97
- 101) 07/97-

## SAF

- 1) 01/84-11/87
- 2) 01/82-11/87
- 3) 08/83-11/87
- 4) -11/87
- 5) 9-10.5 ton

# Remarks

## SCANIA

- 1) Ch.-1032241
- 2) Ch.1032242-
- 3) Disc wheels, ch.-1032241
- 4) Disc wheels, ch.1032242-
- 5) Spoke wheels
- 6) Disc wheels, ch.-1097602 SSS, ch.-4246024 SN
- 7) Disc wheels, ch.1097603 SSS-, ch.4246025 SN-
- 8) Spoke wheels, ch.-1105665 SSS, ch.-4238514 SN
- 9) Spoke wheels, ch.1105666 SSS-, ch.4238515 SN-
- 10) Disc wheels
- 11) Spoke wheels, chassis width 2300 mm
- 12) Spoke wheels 20" or 22.5" hub, ch.-1103187 SSS, ch.-4248317 SN
- 13) Spoke wheels 20" or 22.5" hub, ch.1103188 SSS-, ch.4248318 SN-
- 14) Spoke wheels, 24" hub
- 15) Ch.-1097602 SSS, ch.-4246024 SN
- 16) Ch.1097603 SSS-, ch.4246025 SN-
- 17) Disc wheels, ch.-1033747
- 18) Disc wheels, ch.1033748-
- 19) Spoke wheels 20" or 22" hub, ch.-1103187 SSS, ch.-4248317 SN
- 20) Spoke wheels, 20" or 22" hub, ch.1033188 SSS-, ch.4248318 SN-
- 21) Disc wheels, spoke wheels
- 22) Disc wheels, (4x2, 6x2, 6x4)
- 23) Spoke wheels, (4x2, 6x2, 6x4) 20" or 22,5" hub
- 24) Spoke wheels, 24" hub. Brake shoe 178 mm
- 25) Spoke wheels, 24" hub. Brake shoe 203 mm
- 26) Twin steer axle
- 27) Spoke wheels, 20", 22,5" or 24" hub
- 28) Without hub reduction
- 29) With hub reduction
- 30) Disc wheels, ch.-1029858
- 31) Disc wheels, ch.1029859-
- 32) Disc wheels, spoke wheels, 24" hub
- 33) Disc wheels, spoke wheels, 20" or 22,5" hub
- 34) Disc wheels, spoke wheels, 20", 22.5" or 24" hub
- 35) Disc wheels, ch.-1161721 SSS, ch.-4292924 SN
- 36) Disc wheels, ch.1161722 SSS-, ch.4292925 SN-
- 37) Disc wheels, spoke wheels, 24" hub, ch.-1180029 SSS
- 38) Disc wheels, spoke wheels, 24" hub, ch.1180030 SSS-
- 39) Disc wheels, ch.-1850412
- 40) Disc wheels, ch.1850413-
- 41) Leaf springs susp. ch.-1801229
- 42) Leaf springs susp. ch.1801230-
- 43) Air suspension, ch.-1802872
- 44) Air suspension, ch.1802873-
- 45) Ch.-1801229
- 46) Ch.1801230-
- 47) Disc wheels, ABS/Non ABS
- 48) ABS/Non ABS
- 49) Air suspension
- 50) Air suspension. ABS
- 51) Air suspension, trapeze suspension
- 52) Air suspension, trapeze suspension. ABS
- 53) Disc wheel, ch.-1871409
- 54) Ch.1871410-1871595
- 55) Ch.1871596-
- 56) Ch.1871410-
- 57) Brake shoe 5"
- 58) Brake shoes 7". Ch.1801196-
- 59) Ch.-1801195
- 60) Ch.1801196-
- 61) Ch.-1808231
- 62) Ch.1808232-
- 63) ABS/Non ABS. Ch.-1808901, Ch.1808902-
- 64) ABS/Non ABS. Ch.-1806768, Ch.1806769-
- 65) Hub for trailing axle
- 66) Disc wheel, ABS/Non. Ch.-1808901, Ch.1808902-
- 67) Air suspension. 22.5" hub
- 68) Air suspension. 22.5" hub. ABS
- 69) ABS
- 70) Hub 8.25 x 22.5"
- 71) Hub 8.25 x 22.5". ABS
- 72) Hub 9.00 x 22.5"
- 73) Hub 9.00 x 22.5". ABS
- 74) 6.5 tons
- 75) 6.5 tons. ABS
- 76) 7.1 tons
- 77) 7.1 tons. ABS
- 78) 6.5 tons. Ch.-1820117, Ch.1820118-
- 79) 6.5 tons. Ch.-1820117. ABS
- 80) 7.1 tons. Ch.-1820117
- 81) 7.1 tons. Ch.-1820117. ABS
- 82) ABS/Non ABS. Ch.-1820117, Ch.1820118-
- 83) Air suspension, ch.-1801229
- 84) Air suspension, ch.1801230-1802872
- 85) Disc wheels, Non ABS, Ch.9015825 SAN-, Ch.4362206 SNL-, Ch.1226892 SSS-
- 86) Disc wheels, ABS, Ch.9015825 SAN-, Ch.4362207 SNL-, Ch.1226892 SSS-
- 87) Spoke wheels, ABS/Non ABS
- 88) Disc wheels, ABS/Non ABS, Ch.9015825 SAN-, Ch.4362207 SNL-, Ch.1226892 SSS-
- 89) Disc wheels, Non ABS, Ch.9015825 SAN-, Ch.4362207 SNL-, Ch.1226207 SSS-
- 90) Disc wheels, Non ABS
- 91) Disc wheels, Non ABS, RP/RBP 730
- 92) Non ABS, RP/RBP 832
- 93) Disc wheels, ABS
- 94) Disc wheels/Spoke wheels, ABS/Non ABS, Ch.9015825 SAN-, Ch.4362207 SNL-, Ch.1226892 SSS-
- 95) Spoke wheels, Non ABS
- 96) Disc wheels, Ch.1820118-, ABS
- 97) Disc wheels, Ch.1820118-, Non ABS
- 98) To Ch.nr: Scania Sodertalje 1242205, Scania Zwolle 4397541, Scania Angers 9034654, Scania Katrineholm 1833391
- 99) Disc wheels, Disc brake, ABS
- 100) Spoke wheels 22", 22,5" hub
- 101) RP/RBP 832
- 102) 22", 22,5", 24" hub
- 103) 20", 22,5" hub, RBP/RP730
- 104) 24" hub, RP/RBP 832
- 105) Disc wheels Ch.-9015824 SAN, Ch.-4365570 SNL, Ch.-1226891 SSS
- 106) Disc wheels, ABS, Ch.-9015824 SAN, Ch.-4362206 SNL, Ch.-1226891 SSS
- 107) Disc wheels, Disc brake, ABS/Non ABS

# Remarks

## SMB

- 1) 107, 6 mm axle, with brakes C1/C2
- 2) 110 mm axle, with brakes D1/K1/H1
- 3) 110 mm axle, with brakes C1/C2/L1/L2 (100 teeth)
- 4) 110 mm axle, with brakes C3/C5 (80 teeth)

## TRAILOR

- 1) 107, 6 mm axle, with brakes C1/C2
- 2) 110 mm axle, with brakes D1/K1/H1
- 3) 110 mm axle, with brakes C1/C2/L1/L2 (100 teeth)
- 4) 110 mm axle, with brakes C3/C5 (80 teeth)

## VOLKSWAGEN

- 1) 1976-96
- 2) Ch.-28DD-007273, 1976-83, 12 mm locking ring
- 3) Ch.28DD-007274 - 28G-015891, 83-03/86, 16 mm locking ring
- 4) Ch.28G-015892 - 21N-006785, 04/86-07/91, 20 mm locking ring
- 5) Ch.21N-006786 -, 08/91-96, 22,5 mm locking ring
- 6) Twin wheel, 1976-96
- 7) Except twin wheel. Ch.28G-015892 - 21N-006785, 04/86-07/91, 20 mm locking ring
- 8) Except twin wheel. Ch.21N-006786 -, 08/91-96, 22,5 mm locking ring
- 9) Coil springs, 1979-82
- 10) Leaf springs, ch.-28-B-018540, 1979-81
- 11) Leaf springs, ch.28-B-018541-, 1981-82
- 12) 1979-82
- 13) Ch.-28-B-019162, 1979-81
- 14) Ch.28-B-019163-, 1981-82
- 15) 1983-96
- 16) 3500 kg, 1983-96
- 17) 4000 kg, 1983-96
- 18) 1984-96
- 19) 1962-67
- 20) 1968-79
- 21) Ch.-24-E-023827, 1980-84
- 22) Ch.24-E-023828-, 1984-92
- 24) 1962-70
- 25) 1971-92
- 26) 10/84-92
- 27) 1993-00
- 29) 1991-00
- 30) 800-1200 kg, 1991-00


## VOLVO

- 1) Hub 363067
- 2) 57 mm stub axle
- 3) Ch.-20653
- 4) Disc wheels, ch.20654-
- 5) Spoke wheels, ch.20654-
- 6) Disc wheels, spoke wheels, -1503875
- 7) Spoke wheels, 1503876-
- 8) Without hub reduction, ch.36634-
- 9) With hub reduction
- 10) Without hub reduction
- 11) Disc wheels
- 12) Spoke wheels
- 13) Ch.-6997
- 14) Disc wheels, ch.6998-
- 15) Spoke wheels, ch.6998-
- 16) Stiff springs
- 17) Soft springs
- 18) Ch.-7050
- 19) Ch.7051-
- 20) Ch.-23510
- 21) Ch.23511-
- 22) Ch.-2376
- 23) Ch.2377-
- 24) Ch.-6450
- 25) Ch.6451-
- 26) Ch.-703
- 27) Ch.704-
- 28) Ch.-21671
- 29) Ch.21672-
- 30) Ch.-3145 (approx.)
- 31) Ch.3146 (approx.)-6871
- 32) Ch.6872-
- 33) Ch.-2728
- 34) Ch.2729-6871
- 35) ABS/Non ABS
- 36) Semi, rigid axle
- 37) For vehicle with fixed construction
- 38) For vehicle without fixed construction
- 39) Disc wheels, bolt circle diam. 335 mm
- 40) ABS/Non ABS. Disc wheels, bolt circle diam. 335 mm
- 41) Disc wheels, ch.-27087
- 42) Disc wheels, ch.27088-
- 43) Spoke wheels 20" hub, ch.-27087
- 44) Spoke wheels 22" hub, ch.-27087
- 45) Spoke wheels, ch.27088-
- 46) Spoke wheels 20" hub
- 47) Spoke wheels, without hub reduction
- 48) Disc wheels, ch.-19745
- 49) Disc wheels, ch.19746-
- 50) With air suspension and special design
- 51) With S-ride and single wheels
- 52) Disc wheels, earlier models
- 53) Spoke wheels, earlier models
- 54) Construction vehicle with straight front axle and heightened belly clearance
- 55) Spoke wheels, ABS/Non ABS
- 56) Disc wheels, ABS/Non ABS
- 57) Disc wheels, BGT 18/21/26 with leaf springs susp. rear
- 58) Disc wheels, air susp. S-ride, rear steer
- 59) With air suspension and rear steer
- 60) ABS/Non ABS, with leaf springs susp.
- 61) Ch.-12099
- 62) Ch.12100-
- 63) Ch.12001-
- 64) Disc wheels, ch.-11549
- 65) Disc wheels, ch.11550-
- 66) Ch.-26821

# Remarks

- 67) Ch.26822-
- 68) Disc wheels, ch.-40640, ABS/Non ABS
- 69) Spoke wheels 20" hub, without hub reduction
- 70) Spoke wheels 24" hub, without hub reduction
- 71) Disc wheels, ch.-20876, ABS/Non ABS
- 72) Disc wheels, ch.20877-, ABS/Non ABS
- 73) Disc wheels, ch.25001-40640, bolt circle diam. 335 mm
- 74) Spoke wheels 20" hub, ch.25001-40640
- 75) Spoke wheels 24" hub, ch.25001-40640
- 76) With air suspension, ch.-25000
- 77) S-ride, rear steer, ch.25001-40640
- 78) Disc wheels, with hub reduction
- 79) Ch.-52439
- 80) Ch.52440-
- 81) Disc wheels, ch.306000-, bolt circle diam. 335 mm
- 82) Spoke wheels 20", 24" hub, ch.306000-
- 83) Disc wheels, ch.306000-, ABS/Non ABS, bolt circle diam. 335
- 84) Disc wheels, ch.-46315
- 85) Disc wheels, ch.46316-, ABS/Non ABS
- 86) Spoke wheels 24" hub, ch.49001-
- 87) Disc wheels 20", 22.5", 24" hub
- 88) Construction vehicle with straight front axle
- 89) Spoke wheels 24" hub
- 90) Ch.-36763
- 91) Ch.36764-
- 92) Ch.-65820
- 93) Ch.-65820, Spoke wheels 20", 24" hub
- 94) Disc wheels, without hub reduction
- 95) Disc wheels, ch.-22914
- 96) Disc wheels, ch.22915-
- 97) Spoke wheels 20" hub, ch.34001-
- 98) Spoke wheels 24" hub, ch.34001-
- 99) With air suspension
- 100) Special model, super volyme S-10609, S-10610, S-10801, S-11010, S-97024, S-97025, ch.314000-
- 101) Spoke wheels, 20", 24" hub
- 102) Spoke wheels, with single reduction
- 103) Tandem axle with hub reduction
- 104) Single mounted trailing wheel, disc wheels
- 105) Double mounted trailing wheels, disc wheels
- 106) Ch.-15169
- 107) Ch.15170-
- 108) Disc wheels, ch.-8779
- 109) Disc wheels, ch.8780-
- 110) Spoke wheels, ch.-12000
- 111) Spoke wheels 20" hub, ch.12001-
- 112) Spoke wheels 24" hub, ch.12001-
- 113) Spoke wheels 22", 22.5", 24" hub
- 114) Spoke wheels 20" hub, with leaf springs suspension, ABS/Non ABS
- 115) Spoke wheels 24" hub, with leaf springs suspension
- 116) Spoke wheels 20" hub, with air suspension
- 117) Spoke wheels, ch.314000-, with air suspension, rear
- 118) Special model, super volume; 1) S-10099, S-10365, S-10803, S-11011 2) S-10111, S-10112, S-97024, S-97025
- 119) Ch.7980
- 120) Ch.7981-
- 121) Ch.-3404
- 122) Ch.3405-7980
- 123) Ch.-5256
- 124) Ch.5257-
- 125) B 6F
- 126) B 6FA
- 127) Ch.865-. Except Ch.873-875, oil lubricated
- 128) B 6F, B 609, B 610
- 129) B 6FA, ch.-404, hub 6772232
- 130) B 6FA, ch.405-
- 131) Ch.20000-
- 132) Ch.-10521. Grease lubricated
- 133) Ch.10522-. Oil lubricated
- 134) Grease lubricated, rear steer
- 135) Oil lubricated, rear steer ABS/Non ABS
- 136) Oil lubricated
- 137) Ch.-3906
- 138) Ch.3907-
- 139) Ch.4308-. ABS
- 140) Including front axle load, FAT 5,0
- 141) CHID-B169140, disc wheels, bolt circle diam. 335 mm
- 142) Non ABS, disc wheels, bolt circle diam. 335 mm, disc
- 143) Hub 6774825. Including front axle load. FAT 4,7
- 144) CHID -B170985
- 145) CHID B170986-
- 146) S-60677, S-60936
- 147) Disc wheels, bolt circle diam. 335 mm, with air suspension.
- 148) Disc wheels, bolt circle diam. 335 mm, BAT 11,5 with leaf springs suspension.
- 149) 6X2 TAG (HENDRICKSON)
- 150) 6774825, 6795568
- 151) Incl. special model; S-60945, S-60990, S-60993, S-61208, S-61230
- 152) B 6FA, ch.-404. (Repl. 6772232, 6770991, 6771541, 960234, 6772691, 965768, 18665. One psc of each)
- 153) ABS/Non ABS. Ch.5000-
- 154) Ch.5000-
- 155) CHID.-A276505, -B190367, -563621
- 156) BAT 10,0 BAT 10,9 BAT 11,2
- 157) BAT 11,5 BLF-B BAT 13,0
- 158) BAT 11,5 LUF-B
- 159) Including front axle load FAT 4,7
- 160) WTT-D275
- 161) Ch.-A286102, -B207062, D120498

FIAT VOLKSWAGEN FORD SEAT FIAT LANCIA ZASTAVA INNOCENTI ALFA  
ROEN PEUGEOT RENAULT OPEL BEDFORD VAUXHALL LADA TOYOTA  
SCHE NISSAN IVECO POLSKI CHRYSLER ROVER ALFA TALBOT HYUND  
A BMW SAAB MAZDA DAEWOO VOLVO MITSUBISHI DAITHATSU HONI  
SKI OPEL BEDFORD MERCEDES-BENZ KIA SUZUKI SUBARU ISUZU J  
I VOLKSWAGEN FORD SEAT FIAT LANCIA ZASTAVA INNOCENTI ALFA  
ROEN PEUGEOT RENAULT OPEL BEDFORD VAUXHALL LADA TOYOTA  
SCHE NISSAN IVECO POLSKI CHRYSLER ROVER ALFA TALBOT HYUND  
A BMW SAAB MAZDA DAEWOO VOLVO MITSUBISHI DAITHATSU HONI  
SKI OPEL BEDFORD MERCEDES-BENZ KIA SUZUKI SUBARU ISUZU J  
I VOLKSWAGEN FORD SEAT FIAT LANCIA ZASTAVA INNOCENTI ALFA  
ROEN PEUGEOT RENAULT OPEL BEDFORD VAUXHALL LADA TOYOTA

	<p>Truck parts distributor</p>



Official  
Supplier



Scuderia  
Ferrari